

TexInspec

Home and Termite Inspections Since 1985

817-265-5452 972-231-1945

This Home Inspection Report Prepared Exclusively For:

Happy Homeowner

1234 Sunshine Road Pleasantville, TX 76182

PROPERTY INSPECTION REPORT

To schedule an inspection call: Tarrant (817) 265-5452 Dallas (972) 231-1945

Fax: (817) 577-3506

Prepared For: <u>Happy Homeowner</u>

(Name of Client)

Concerning: <u>1234 Sunshine Road</u>

(Address of Inspected Property) (City, State, Zip)

<u>1234567</u>

(TexInspec Report Number)

By: Your Inspector, #12345

(Name and License Number of Inspector)

Really Soon

(Date)

(Name, and License Number of Sponsoring Inspector, if required)

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at www.trec.texas.gov.

Pleasantville, TX 76182

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standards for inspections by TREC licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. **Comments may be provided by the inspector whether or not an item is deemed deficient.** The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

(Continued on page 3)

PROPERTY INSPECTION REPORT

To schedule an inspection call: Tarrant (817) 265-5452 Dallas (972) 231-1945

Fax: (817) 577-3506

Prepared For: Happy Homeowner

(Name of Client)

Concerning: 1234 Sunshine Road Pleasantville, TX 76182 123456

(Address of Inspected Property) (City, State, Zip) (TexInspec Report Number)

By: Your Inspector, #12345
Really Soon

(Name and License Number of Inspector) (Date)

(Name, and License Number of Sponsoring Inspector, if required)

(Continued from page 2)

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathrooms, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices; and
- lack of electrical bonding and grounding.

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

(Continued on page 4)

Licensed and Regulated by the Texas Department of Agriculture, PO Box 12847, Austin, Texas 78711-2847, Phone (866) 918-4481 Fax (888)232-2567 TPCL 0570557



Since 1985 817-265-5452 972-231-1945

PROPERTY INSPECTION REPORT

To schedule an inspection call: Tarrant (817) 265-5452 Dallas (972) 231-1945

Fax: (817) 577-3506

Prepared For: Happy Homeowner

Concerning: 1234 Sunshine Road

Pleasantville, TX 76182 (Address of Inspected Property) (City, State, Zip)

(TexInspec Report Number)

By: Your Inspector, #12345

(Name and License Number of Inspector)

Really Soon

(Date)

(Name, and License Number of Sponsoring Inspector, if required)

(Continued from page 3)

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms require a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

- This report is received in agreement with the buyer's acceptance of the Real Estate Inspection Agreement (including the box labeled "DISCLAIMER OF WARRANTIES"). The Client understands and agrees the Real Estate Inspection Agreement is a part of the Inspection Report and acceptance of or payment for the Inspection Report by the Client will confirm this Agreement, even if the client was not present at the inspection and/or has not signed this Agreement.
- Client has 7 (seven) days to submit written objection to the terms of the agreement otherwise, client is bound by the Agreement and Terms and Conditions of the Report, if not previously signed/accepted.
- Paint, Floor Coverings, and other Cosmetic Items are SPECIFICALLY EXCLUDED from this report.
- TexInspec may have an affiliation with a third party service provider ("TPSP"), including Vivint, in order to offer you additional value-added services. By entering into this agreement you authorize TexInspec to provide your contact information (including telephone number) to the TPSP, waive and release any restrictions that may prevent the TPSP from contacting you (including by telephone), and authorize the TPSP to contact you (including by telephone) regarding special home alarm system offers. Compensation may be received from outside companies for services/information provided by TexInspec pertaining to this inspection, unless otherwise requested in writing.

- Buyer has received a notebook of useful information.
- Buyer has received a Home Inspection Information Sheet.
- This report cannot and does not represent the operation or condition of any items after the date and time of this inspection.
- These items should not be considered a complete list of all defects with the house. This list is Limited to those items that are Readily Accessible and the inspector(s) noted at the time of the inspection.
- This inspection does not include a mold test unless specifically requested. If indications of water penetration are known, such as notes of water penetration on this report or seller's disclosure or any visible water stains, recommend a mold inspection/test be considered.
- Some area utility companies may pressure test the gas line prior to turning on the utilities. Pressure testing the line is beyond the scope of this inspection and may find gas line leaks not noted at the time of inspection. Recommend contacting the local gas company regarding start up procedure prior to closing on the property and having the line pressure checked by them if available.
- With the termite inspection you automatically receive three FREE months of our Termite and Carpenter Ant Warranty for a small filing fee of \$2.79. After the Free 3 months of receiving this protection for free, we will automatically charge you the lowest monthly price that we offer for our termite warranty of only \$12.97 per month, billed quarterly, beginning on the fourth month.

(Date) Saturday, October 10, 2015	Customer Signature:		Thank
		INVOICE	
Residential Inspection	\$0.00		\$0.00
	\$0.00	Sewer Cam Inspection	\$0.00
Gas Line Leak Check	\$0.00		\$0.00
Swimming Pool Swi	\$0.00		\$0.00
	Tot	al	\$ 0.00
Method of Payment	☐ Credit Card Card	d #:	Expiration Date:
☐ Check # ☐ Cash	Name on Card:	Zip code:	Security Code:
	Billing Address:		

Licensed and Regulated by the Texas Department of Agriculture, PO Box 12847, Austin, Texas 78711-2847, Phone (866) 918-4481 Fax (888)232-2567 TPCL 0570557

Property Inspection Report

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed deficient.

I = Inspected		NI = Not Inspecte		Inspected $NP = Not Present$ $D = Deficient$	
I	NI	NP	D		Inspection Item
			\boxtimes	I. A.	STRUCTURAL SYSTEMS Foundations Type of Foundation(s): Slab on Grade □ Pier and Beam □ Other Comments: See the note(s) under the Structural Systems section of the Addendum page(s). Method used to inspect the crawlspace: □ Entered □ Viewed from opening □ No Access □ There are no significant cracks or movement noted at this time.
				В.	Grading & Drainage Comments: See the note(s) under the Structural section of the Addendum page(s).
				C.	Roof Covering Materials Type(s) of Roof Covering:
				D.	Roof Structures and Attics Viewed From: ☐ Entered ☐ Viewed from opening ☐ No Access Approximate Average Depth of Insulation: 12-14 inches (Approximate) Comments: ☐ See the note(s) under the Structural section of the Addendum page(s). ☐ Framing type: Conventional ☐ Parts of the attic are not readily accessible. Insulation Type: ☐ Blown Fiberglass ☐ Blown Rockwool ☐ Fiberglass Batts ☐ Rockwool Batts ☐ Cellulose ☐ Other NOTES: POWER ATTIC VENTILATORS ARE NOT TESTED.
				E.	Walls (Interior and Exterior) Comments: See the note(s) under the Structural section of the Addendum page(s). Exterior wall covering type: MOSTLY BRICK, CEMENTIOUS BOARD
				F.	Ceilings & Floors Comments: See the note(s) under the Structural section of the Addendum page(s).
				G.	Doors (Interior and Exterior) Comments: See the note(s) under the Structural section of the Addendum page(s). NOTES: INTERIOR DOOR LOCKS ARE NOT INSPECTED.

Report Identification: #Error! Reference source not found. - 1234 Sunshine Road, Pleasantville, TX 76182 Page 6 of 19

I = Inspected		NI = Not Inspected		Inspected NP = Not Present D = Deficient	
I	NI	NP	D		Inspection Item
				н.	Windows Comments: See the note(s) under the Structural section of the Addendum page(s). NOTES: SIGNS OF LOST SEALS IN THE THERMAL PANE WINDOWS MAY APPEAR AND DISAPPEAR AS TEMPERATURE/HUMIDITY CHANGES. SOME WINDOWS WITH LOST SEALS MAY NOT BE EVIDENT AT THE TIME OF THE INSPECTION. WINDOWS ONLY CHECKED FOR OBVIOUS FOGGING. IF SOME LOST SEALS WERE NOTED, RECOMMEND ALL WINDOWS BE CHECKED BY A SPECIALIST FOR FURTHER LOST SEALS. STORM WINDOWS ONLY CHECKED FOR DAMAGED OR MISSING GLASS. RECOMMEND LOCAL MUNICIPALITIES BE CONSULTED FOR FURTHER INFORMATION CONCERNING THE USE AND SAFETY REQUIREMENTS SUGGESTED FOR THE USE OF BURGLAR BARS.
\boxtimes				I.	Stairways (Interior and Exterior) Comments: See the note(s) under the Structural section of the Addendum page(s).
				J.	
				K.	Porches, Balconies, Decks, and Carports Comments: See the note(s) under the Structural section of the Addendum page(s). I NI NP D Wood deck location: None NOTES: ONLY THE PORCHES, DECKS OR BALCONIES ATTACHED AND/OR ABUTTED TO THE STRUCTURE AND ARE USED FOR INGRESS AND EGRESS ARE INSPECTED. PORCHES, WALKS AND DRIVEWAYS ARE ONLY INSPECTED AS THEY RELATE TO INDICATIONS OF FOUNDATION MOVEMENT.
				L.	Other Comments: See the note(s) under the Structural section of the Addendum page(s). NOTE: CABINETS AND COUNTERTOPS ARE NOT INSPECTED.
					ELECTRICAL SYSTEMS Service Entrance and Panels Comments: See the note(s) under the Electrical section of the Addendum page(s). Amps: 200/200 Volts: 120/240 Unable to inspect underground services. Location of the Main Electrical & Sub Panels: Garage Rear exterior of house Master Bedroom Closet Other NOTE: MOST COMPONENTS OF THE ELECTRICAL SYSTEM ARE NOT READILY ACCESSIBLE, UNABLE TO INSPECT INACCESSIBLE ITEMS/COMPONENTS.
				В.	Branch Circuits, Connected Devices, and Fixtures Type of Wiring: ☐ Copper ☐ Aluminum Comments: ☐ See the note(s) under the Electrical section of the Addendum page(s). GFCI Resets located at: ☐ Kitchen ☐ Master Bathroom ☐ Garage ☐ Hall Bathroom ☐ Pool Equipment ☐ Circuit breakers in the Main Electrical Panel ☐ Other ☐ I ☐ NI ☐ NP ☐ D Smoke Detectors NOTES: SMOKE AND CARBON MONOXIDE DETECTORS INSTALLED ABOVE THE REASONABLE REACH OF THE INSPECTOR ARE NOT TESTED. IF TESTED, TESTED WITH THE TEST BUTTON ONLY.

Acceptance of this report and/or relying on the information within constitutes acceptance of the Real Estate Inspections Agreement (found as the last two pages of the report) even if the agreement is not signed.

DETECTORS THAT ARE PART OF THE SECURITY SYSTEM ARE NOT TESTED.

Report Identification: #Error! Reference source not found. - 1234 Sunshine Road, Pleasantville, TX 76182

Page 7 of 19

I = Inspected NI = Not Inspected **NP** = **Not Present** D = Deficient NI NP D **Inspection Item** III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS \boxtimes \boxtimes A. Heating Equipment Type of Systems: Central-Forced Gas Other Comments: See the note(s) under the Heating-AC section of the Addendum page(s). If unit uses natural gas: Type of connector line: Flex Type of Pilot: Standing Automatic Igniter Number of units: Three Electric heat air out: ____ °F Location: Upstairs Emergency heat air out: _____ °F Electric heat air out: _____ °F Location: Downstairs Emergency heat air out: _____ °F Electric heat air out: _____ °F Location: Master Suite Emergency heat air out: ____ °F Electric heat air out: ${}^{\circ}F$ Location: Emergency heat air out: _____ °F NOTES: THERMOSTATS ARE CHECKED IN MANUAL MODE ONLY. FULL EVALUATION OF THE INTEGRITY OF A HEAT EXCHANGER REQUIRES DISMANTLING OF THE FURNACE AND IS BEYOND THE SCOPE OF THIS INSPECTION. RECOMMEND TURNING THE PILOT OFF IN THE SUMMER TO HELP PREVENT RUST BUILD-UP IN THE HEAT EXCHANGER. \boxtimes **B.** Cooling Equipment Type of Systems: Central-Forced Comments: See the note(s) under the *Heating-AC* section of the Addendum page(s). *Number of units:* Three Temperature Differential: 19 °F Location: Upstairs Location: <u>Downstairs</u> Temperature Differential: 18 °F Location: Master Suite Temperature Differential: 18 °F Location: Temperature Differential: ${}^{\circ}F$ Only able to do a limited check of the A/C systems due to low outside temperature. Unable to check the condensate drain(s) due to low outside temperature. No secondary drain pan was noted below the unit. NOTES: UNIT(S) ARE NOT INSPECTED FOR CLEANLINESS AND/OR FOR RUST. RECOMMEND THE FILTER BE CLEANED OR CHANGED ON A REGULAR BASIS. UNITS ARE NOT INSPECTED FOR PROPER SIZE OR EFFICIENCY. UNITS ARE NOT DISASSEMBLED OR OPENED FOR INSPECTION. \boxtimes П C. Duct Systems, Chases, and Vents Comments: See the note(s) under the Heating-AC section of the Addendum page(s). Heating-A/C filter: \boxtimes Fiberglass, size(s): \square 12x24x1 \square 14x25x1 16x25x1 \square 20x20x1 \boxtimes 20x25x1 \square 25x25x1 \boxtimes Other ☐ Washable ☐ Electrostatic ☐ Media (3-4 inch) ☐ Ultra-Violet ☐ Hammock style Report Identification: #Error! Reference source not found. - 1234 Sunshine Road, Pleasantville, TX 76182

Page 8 of 19 NI = Not Inspected D = Deficient I = Inspected **NP** = **Not Present** NI NP D **Inspection Item** IV. PLUMBING SYSTEMS \boxtimes \boxtimes A. Plumbing Supply, Distribution Systems and Fixtures Location of Water Meter: Front yard Location of Main Water Supply Valve: Water meter Static Water Pressure Reading: 75 p.s.i. *Comments:* See the note(s) under the *Plumbing* section of the Addendum page(s). Type of Water Supply Lines (Visible): Copper The water meter was checked for any movement. NOTE: SHUTOFF VALVES ARE NOT TESTED, INCLUDING ICE MAKER AND LAUNDRY VALVES. OPEN DRAINS, I.E. FLOOR DRAINS, LAUNDRY DRAINS, ETC. ARE NOT TESTED. UNLESS OTHERWISE SPECIFICALLY NOTED STATIC WATER PRESSURE IS MEASURED AT AN OUTSIDE WATER FAUCET. WATER PRESSURE CAN DIFFER GREATLY BASED ON THE TIME OF DAY AND LOCATION OF READING. **☑** I **☐** NI **☐** NP **☐** D Gas Supply: Natural Gas Type of Gas Supply Lines: Black Steel Location of Main Valve: Garage Side NOTE: PROPANE SYSTEMS ARE NOT INSPECTED. A GAS LINE LEAK CHECK IS RECOMMENDED TO TEST FOR LEAKS THAT ARE NOT READILY DETECTABLE. X \boxtimes B. Drains, Wastes, and Vents Comments: \boxtimes See the note(s) under the *Plumbing* section of the Addendum page(s). Type of Drain Pipes: Plastic Type of Vent Pipes: Plastic \boxtimes \boxtimes C. Water Heating Equipment Energy Sources: Gas Electric Other Capacity: 50/50 gallons Comments: \boxtimes See the note(s) under the *Plumbing* section of the Addendum page(s). If unit uses natural gas: Type of connector line: Flex/flex Number of Water Heaters: Two Location(s): Upstairs Closet/Rear Exterior Closet \boxtimes \boxtimes D. Hydro-Massage Therapy Equipment Comments: \boxtimes See the note(s) under the *Plumbing* section of the Addendum page(s). Cover is absent or inaccessible for area under tub. V. APPLIANCES A. Dishwasher \boxtimes Comments: See the note(s) under the Appliances section of the Addendum page(s). NOTES: LOWER PANEL NOT REMOVED FOR INSPECTION. BACKFLOW PREVENTION MAY NOT BE VISIBLE ON SOME UNITS. **B.** Food Waste Disposers *Comments:* See the note(s) under the *Appliances* section of the Addendum page(s).

NOTE: RANGE VENT NOT CHECKED FOR CLEANLINESS.

C. Range Hood and Exhaust Systems

 \boxtimes

Comments: See the note(s) under the *Appliances* section of the Addendum page(s).

Recirculating (vent pipe not required) Vented (Updraft) Vented (Downdraft)

Report Identification: #Error! Reference source not found. - 1234 Sunshine Road, Pleasantville, TX 76182

Page 9 of 19

I = Inspected NI = Not Inspected **NP** = **Not Present** D = Deficient NI **Inspection Item** \boxtimes D. Ranges, Cooktops, and Ovens Comments: \boxtimes See the note(s) under the Appliances section of the Addendum page(s). ☐ Electric Elements ☐ Gas Burners Type of Pilot: Standing Automatic Igniter If unit uses natural gas: Type of connector line: Flex Oven thermostat: Temperature Reading: 355°F / 352°F NOTES: OVEN CHECKED AT 350°F. IF PRESENT, DELAY TIMER, SELF-CLEAN MODE AND LOCK ARE NOT TESTED. Gas line not readily accessible. Anti-tip device not required. \boxtimes E. Microwave Ovens Comments: \boxtimes See the note(s) under the Appliances section of the Addendum page(s). NOTE: MICROWAVE OVEN(S) NOT INSPECTED FOR RADIATION LEAKS. F. Mechanical Exhaust Vents and Bathroom Heaters *Comments:* See the note(s) under the *Appliances* section of the Addendum page(s). \boxtimes П **G.** Garage Door Operators Comments: See the note(s) under the Appliances section of the Addendum page(s). \boxtimes H. Dryer Exhaust Systems - Comments: See the note(s) under the *Appliances* section of the Addendum page(s). NOTE: DRYER VENT NOT CHECKED FOR CLEANLINESS. LINT MAY COLLECT IN THE VENT PIPE OVER TIME CAUSING THE DRYER TO OVER-HEAT AND/OR NOT FUNCTION PROPERLY. VI. OPTIONAL SYSTEMS A. Landscape Irrigation (Sprinkler) Systems \bowtie Comments: \boxtimes See the note(s) under the Optional Systems section of the Addendum page(s). Control Panel Location: GARAGE Coverage: Front Yard Back Yard Side Yard(s) Zones used: 1-7 Valve Box Location: FRONT YARD NOTE: SPRINKLER CONTROLS ARE OPERATED IN MANUAL MODE ONLY. \boxtimes B. Swimming Pools, Spas, Hot Tubs, and Equipment Type of Construction: \square In ground \square Above ground \square Other *Comments:* See the note(s) under the *Optional Systems* section of the Addendum page(s). Shell Type: ☐ Gunite ☐ Fiberglass ☐ Vinyl Other There is no significant movement in the shell at this time. The main drain is plumbed into the skimmers, unable to fully evaluate the main drain. Type of filter: Sand Cartridge D. E. Other The following items were noted as being present: Slide Ladder □ Diving Board Nool Sweep Heater NOTES: POOL NOT CHECKED FOR SHELL LEAKAGE OR TESTED IN BACKWASH MODE. THE POOL COATING IS CONSIDERED COSMETIC AND IS NOT PART OF THIS INSPECTION. ALL CONTROLS ARE OPERATED IN THE MANUAL MODE ONLY. ANCILLARY EQUIPMENT SUCH AS COMPUTER CONTROLS, CHLORINATORS OR OTHER CHEMICAL DISPENSERS, OR WATER IONIZATION DEVICES OR CONDITIONERS ARE NOT INSPECTED. \bowtie C. Outbuildings Comments: See the note(s) under the Optional Systems section of the Addendum page(s). Type: ____

Acceptance of this report and/or relying on the information within constitutes acceptance of the Real Estate Inspections Agreement (found as the last two pages of the report) even if the agreement is not signed.

Report Identification: #Error! Reference source not found. - 1234 Sunshine Road, Pleasantville, TX 76182 Page 10 of 19

I = Inspected NI = Not Inspected **NP** = **Not Present** D = Deficient NI D **Inspection Item D.** Private Water Wells (A coliform analysis is recommended.) Type of Pump: Type of Storage Equipment: _ Comments: See the note(s) under the Optional Systems section of the Addendum page(s). NOTES: WATER WELL SYSTEMS ARE INSPECTED FOR FUNCTIONALITY ONLY. COLIFORM TESTING IS RECOMMENDED. \boxtimes E. Private Sewage Disposal (Septic) Systems Type of System: Location of Drain Field: _ Comments: See the note(s) under the Optional Systems section of the Addendum page(s). Is property occupied at time of inspection? \(\subseteq \text{Yes} \) No NOTE: IN UNOCCUPIED HOMES, A FUNCTIONAL TEST MAY BE INSUFFICIENT AS THE SYSTEM WAS NOT UNDER REGULAR USE AT THE TIME OF THE INSPECTION. Does tank have a visible riser? Yes No Method of evaluation: Dye & Visual Visual only Was water run for minimum of 30 minutes?
Yes No Was any effluent and/or dye visible on ground?

Yes No Functional drainage? Yes No Drain field too close to well or other hazard? \(\subseteq\) Yes \(\subseteq\) No NOTES: SEPTIC SYSTEMS ARE TESTED FOR FUNCTIONALITY ONLY. RECOMMEND CONSULTING WITH THE COUNTY HEALTH DEPARTMENT FOR INFORMATION REGARDING INSPECTION, CERTIFICATION AND MAINTENANCE OF THE SEPTIC SYSTEMS. \boxtimes F. Outdoor Cooking Equipment Energy Source: Natural Gas Propane Electric Other *Comments:* See the note(s) under the *Optional Systems* section of the Addendum page(s). \boxtimes **G.** Gas Supply Systems - Comments: Meter Check: With all gas appliances and associated pilot lights turned off in the house, there is no measurable gas flow through the gas meter and the pilot lights were relit. NOTE: GAS LINE LEAK TEST IS AT FUNCTIONAL PRESSURE ONLY. PRESSURIZED LEAK TEST MAY REVEAL OR CREATE LEAKS THAT ARE NOT DETECTABLE WITH THIS TESTING METHOD. \boxtimes H. Whole-House Vacuum Systems - Comments: See the note(s) under the *Optional Systems* section of the Addendum page(s). NOTE: SYSTEM IS TEST AT THE UNIT ONLY, AMOUNT OF SUCTION IS NOT TESTED. \boxtimes П I. Other Comments: See the note(s) under the Optional Systems section of the Addendum page(s).

Addendum Page

ITEMS THAT ARE DEFICIENT AND ITEMS THAT ARE QUESTIONABLE AS TO PERFORMING FUNCTION AS INTENDED AS REQUIRED BY THE TEXAS REAL ESTATE COMMISSION (TREC). REPAIR IS NOT MANDATORY. REFER TO THE TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS, FORM OP-I, IN YOUR NOTEBOOK.

I. STRUCTURAL SYSTEMS

- 1. The foundation has shifted in one or two areas evident mainly by cracks in the brickwork and stonework, trim separation, and uneven separation at the expansion joint at the garage side. There are several doors throughout the house that do not latch properly, including: the master bedroom door, the laundry room door, the downstairs rear corner bedroom door, the downstairs rear corner bedroom closet door, and the downstairs rear corner hall closet door. There is poor drainage in some areas around the perimeter of the foundation, mainly along the rear. Recommend this be corrected to help minimize future foundation movement. However, I do not believe foundation repairs are warranted at this time. Proper maintenance should be maintained to minimize foundation movement.
- 2. There are cracks in the brick/stonework above the front entryway arch and above the breezeway arch. Recommend an engineer be consulted for further evaluation.
- 3. There are a few damaged shingles on the roof. There is also tree damage in at least one area. Tree limbs should be kept trimmed to help prevent damage to the roof.
- 4. Caulking is needed around some of the windows between the window framing, overhead garage door trim and exterior brickwork to help prevent water penetration. Unable to determine the condition of the underlying materials.
- 5. There is peeling paint at the gable vents.
- 6. There is at least one improperly attached downspout.
- 7. The overhead garage door trim is deteriorated and needs to be properly sealed to prevent water penetration and further deterioration. Unable to determine the condition of the underlying materials.
- 8. There is an improper cover by the rear exterior door. Recommend a solid cover be installed.
- 9. There are indications of overflow at the gutter at the front of the house by the front entry.
- 10. There is a missing insulation batt in the upstairs attic.

II. <u>ELECTRICAL SYSTEMS</u>

- 1. Not all of the recommended electrical outlets in the single car garage are GFCI (Ground Fault Circuit Interrupter) protected.
- 2. There is a wire that is too short in the right main electrical panel and does not have sufficient clearance around the breakers.
- 3. There is a unprotected hole in the top corner of the left main electrical panel that wires pass through.

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

- 1. The insulation on the A/C coolant (suction) line is damaged on the outside of the house by the outside ac unit.
- 2. The exterior A/C electrical shutoffs are locked shut so no access was possible.
- 3. The downstairs furnace failed to light when tested. Recommend a heating specialist be consulted to check the heat exchanger and to check the furnace for proper and safe operation.
- 4. There is condensate dripping off the master suite ac unit in the attic.

Addendum Page

ITEMS THAT ARE DEFICIENT AND ITEMS THAT ARE QUESTIONABLE AS TO PERFORMING FUNCTION AS INTENDED AS REQUIRED BY THE TEXAS REAL ESTATE COMMISSION (TREC). REPAIR IS NOT MANDATORY. REFER TO THE TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS, FORM OP-I, IN YOUR NOTEBOOK.

IV. PLUMBING SYSTEMS

- 1. There is at least one damaged drain cap mainly at the rear.
- 2. There is a water leak under the kitchen sink at the flexible hose for the removable spray head/spout. Unable to determine the condition of the underlying materials.
- 3. The tall master bathroom sink hot water faucet is not properly secured.
- 4. The short master bathroom sink is slow to drain.
- 5. The bath tub/showers enclosure need caulk grout repair to help prevent water penetration to the underlying materials. Am unable to determine condition of underlying materials.
- 6. There is corrosion at the water connections for the water heater in the upstairs closet.

V. <u>APPLIANCES</u>

- 1. The kitchen downdraft range exhaust vent is not properly attached to the wall.
- 2. The rear left burner and the front right burner do not light when tested. The automatic igniters fail to spark when tested.
- 3. There are components in the top of the microwave that are melted.
- 4. Recommend removing/disabling the manual lock for the overhead garage door when an automatic opener is connected.
- 5. Unable to locate the GFCI (Ground Fault Circuit Interrupter) for the master bath recirculating tub.

VI. OPTIONAL SYSTEMS

Sprinkler System

- 1. There is no rain/freeze sensor for the sprinkler system.
- 2. The conduit for the sprinkler control wires is damaged at the rear exterior of the garage.

Swimming Pool

- 3. The left gate is not self closing/ self latching.
- 4. There is some rust at the water feature pool pump cover.
- 5. There is a disconnected conduit at the water feature pool pump.
- 6. The pool sweep motor is not properly connected to the bonding.
- 7. The pool sweep leaf bag is missing.
- 8. The pool sweep tail sponge cover is missing.
- 9. There is a crack with rust stains at the main pool steps.
- 10. There is damage to the plaster in the pool on the side of the spa.
- 11. There is rust at the diving board mount and the bolts are exposed.
- 12. The blower makes a loud metallic whining noise while in use.
- 13. The backwash drain line is broken off at the viewing port.



Front of the house



Sample of damaged insulation on ac coolant line



Sample of locked ac shut-off boxes



Sample of loose gutter downspout diverter



Sample of exposed sprinkler control wires at damaged conduit



Sample of uneven separation at expansion joint

Acceptance of this report and/or relying on the information within constitutes acceptance of the Real Estate Inspections Agreement (found as the last two pages of the report) even if the agreement is not signed.

REI 7-3 (Revised 05/2013)

Page 13 of 19



Sample of separation around the garage door frames



Sample of improper set vent-a-hood exhaust vent cover



Sample of cracks above archways



Sample of tree limbs touching the roof



General photo of water meter (no movement at this time)



Sample of peeling paint at gable vent

Acceptance of this report and/or relying on the information within constitutes acceptance of the Real Estate Inspections Agreement (found as the last two pages of the report) even if the agreement is not signed.

REI 7-3 (Revised 05/2013)

Page 14 of 19



Sample of damaged drainage head



Sample of gutter overflowing at the front of the house



Sample of tree damage on the roof



Sample of damaged backwash drain line



Sample of disconnected conduit at the pool



Sample of crack with rust stain in the pool

Acceptance of this report and/or relying on the information within constitutes acceptance of the Real Estate Inspections Agreement (found as the last two pages of the report) even if the agreement is not signed. Page 15 of 19

REI 7-3 (Revised 05/2013)



Sample of damaged plaster in the pool



Sample of rust and exposed bolts at the diving board



Sample of water leak under the kitchen sink



Sample of melted components in the microwave



Photo of the master bath recirculating tub running



Sample of corrosion on water heater supply fitting

Acceptance of this report and/or relying on the information within constitutes acceptance of the Real Estate Inspections Agreement (found as the last two pages of the report) even if the agreement is not signed. Page 16 of 19


REI 7-3 (Revised 05/2013)



Sample of condensate dripping off the master suite ac unit



Sample of missing insulation in the attic

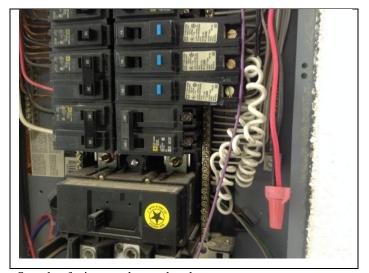

Sample of wire too close to breakers



Sample of unprotected wires passing through panel



7510 Davis Blvd., Suite D North Richland Hills, TX 76182 (972) 231-1945 or (817) 265-5452

Real Estate Inspection Agreement

Customer Name: Happy Homeowner Date: October 10, 2015

The above parties agree to the following on consideration for the fee received below, TEXINSPEC, INC. shall provide a licensed real estate inspector to perform a "Real Estate Inspection" on the property located at:

Address: 1234 Sunshine Road, Pleasantville, TX 76182

SCOPE: The inspection(s) is a "limited visual inspection(s)" of the "Readily Accessible Items Agreed To Be Inspected" on the real estate property located at the above address. We follow the Inspection standards as currently promulgated and published by the Texas Real Estate Commission and the Structural Pest Control Board. These are the agreed standards of practice for the performance of this inspection. (A copy of which is a available upon request at the inspection or prior to the inspection.) The inspection is intended to be a practical, non-destructive examination of the functions of the building, its components and equipment. The examination is limited to visual, audible and operational techniques. We do not inspect for building codes, soil analysis, design, adequacy, capacity, efficiency, sizing, value, floodplain location, presence of LEAD PAINT, ASBESTOS, OR OTHER HAZARDOUS MATERIALS. Code Compliance inspection of existing structures is specifically excluded from the inspection, although some codes may be used as a reference and basis for the Inspector's opinions. Please refer to the HOME INSPECTION INFORMATION sheet included in the Coping With the Joys of Home Ownership manual to obtain a better understanding of what an inspection includes and does not include.

Customer agrees that items not included in the inspection report are specifically excluded from the inspection and should be performed by other inspectors or technicians more qualified and knowledgeable in those areas.

EXCLUSIVITY: The inspection is performed for the exclusive use of the customer and is subject to the terms and conditions of this document and specific terms and conditions noted in the inspection report, which may include additional clarification of definitions, limitations, and exclusions.

REPORT: "Unless otherwise specified, no warranties or guarantees expressed or implied," including any implied warranties, or fitness of merchantability is included as part of the inspection or the report unless specifically stated. The inspection report will contain the opinion of the inspector on the items inspected that are found to be deficient on the day of the inspection only. The inspection or the report will not include opinions as to the adequacy, efficiency, quality, durability, or future life and performance of any item inspected. Those opinions are specifically excluded from the inspection or the report.

It is agreed that **opinions** expressed by the inspectors **are only opinions** and shall not constitute a basis for any claim of negligence or breach of contract. For the **purpose** of the **inspection**, **the report** and this **agreement**, **negligence and breach of contract is defined** as failure to inspect items **agreed** to be **inspected** by **both parties**. No other interpretation shall apply.

This report is received in agreement with the buyer's acceptance of the Real Estate Inspection Agreement (including the box labeled "DISCLAIMER OF WARRANTIES"). The Client understands and agrees the Real Estate Inspection Agreement is a part of the Inspection Report and acceptance of or payment for the Inspection Report by the Client will confirm this Agreement, even if the client was not present at the inspection and/or has not signed this Agreement.

Client has 7 (seven) days to submit written objection to the terms of this agreement otherwise, client is bound by this Agreement and Terms and Conditions of the Report, if not previously signed/accepted.

Distribution of Report – We are authorized to distribute copies of the Inspection Report to those directly involved in this transaction, unless otherwise instructed in writing.

TexInspec may have an affiliation with a third party service provider ("TPSP"), including Vivint, in order to offer you additional value-added services. By entering into this agreement you authorize TexInspec to provide your contact information (including telephone number) to the TPSP, waive and release any restrictions that may prevent the TPSP from contacting you (including by telephone), and authorize the TPSP to contact you (including by telephone) regarding special home alarm system offers. Compensation may be received from outside companies for services/information provided by TexInspec pertaining to this inspection, unless otherwise requested in writing.

Before completion of any **contractual agreements** on the property inspected, Customer agrees to obtain **second opinions** on items where performance may be reported as questionable, and to hold TEXINSPEC and the Inspector free from any liability on those items.

DISCLAIMER OF WARRANTIES

THE COMPANY MAKES NO GUARANTEE OR WARRANTY AS TO ANY OF THE FOLLOWING:

- 1. That all defects have been found or that company will pay for repair of undisclosed defects.
- 2. That any of the items inspected are designed or constructed in good workmanlike manner.
- 3. That any of the items inspected will continue to perform in the future as they are performing at the time of the inspection.

The customer agrees and understands that the maximum liability incurred by TEXINSPEC for errors and omissions in the inspection, including liability, of any inspector, owner, or employee of TEXINSPEC, if any, to the customer shall be <u>limited to the amount of the fee paid for the inspection, not to exceed \$500.00</u>. The customer further agrees to a one-year statute of limitations to make any and all claims. The Customer agrees to pay all legal expenses and reasonable compensation for loss of time that may be incurred by TEXINSPEC, any inspector, owner, or employee of TEXINSPEC as a result of any legal action by the customer where the customer does not prevail.

The customer agrees to notify TEXINSPEC by telephone and in writing, within two (2) business days of evidence of the problem and to allow TEXINSPEC and inspector five (5) business days to respond. Inspector must be allowed access to the property to evaluate these items before any corrective action is taken. The customer agrees and understands that any repairs or corrective action taken without consultation with TEXINSPEC relieves TEXINSPEC of any and all liability.

DISPUTE RESOLUTION: Any dispute, controversy or claim arising out of, or relating to, this agreement or the breach there of shall be submitted to final and binding arbitration under the Expedited Arbitration Rules of the National Academy of Conciliators. The decision of the Arbitrator appointed there under shall be final and binding, and judgment on the award may be entered in to any court of competent jurisdiction.

NOTICE: YOU, THE CONSUMER, HAVE OTHER RIGHTS AND REMEDIES UNDER THE TEXAS DECEPTIVE TRADE PRACTICES-CONSUMER PROTECTIVE ACT WHICH IS IN ADDITION TO ANY REMEDIES WHICH MAY BE AVAILABLE UNDER ANY CONTRACT. FOR MORE INFORMATION CONCERNING YOUR RIGHTS, CONTACT THE CONSUMER PROTECTION DIVISION OF THE ATTORNEY GENERAL'S OFFICE, YOUR LOCAL DISTRICT OR COUNTY ATTORNEY, OR THE ATTORNEY OF YOUR CHOICE.

ACKNOWLEDGMENT: The undersigned have reviewed this document, understand its contents and agree to the terms and conditions contained herein. In the absence of the Customer to sign this agreement prior to or at the time of the inspection, scheduling of the inspection, acceptance of the report, and/or payment for the inspection is an acknowledgment, acceptance, and agreement by the client to the terms of this agreement, and acknowledges that the inspection includes only those items listed, mentioned and specified in the report.

I am requesting the following inspection(s) and/or test(s):						
Structural	☐ Termite	Lifetime Termite Warranty				
	 .	Lead Based Paint Test				
	☐ Separate Structure	Sewer Cam Inspection				
Inspection(s) and/or test(s) not marked are specifically declined: Initials:						
FEE: (payable at the time of the inspection) $\frac{\$ 0.00}{}$ is for a visual inspection of the readily accessible areas of the structure. The inspection is limited to what is visible at the time of the inspection.						
Customer: ${\mathcal X}_{\underline{}}$						
(If this is a joint purchase, signer represents actual authority to sign for all parties.)						
	Structural Swimming Pool Mold Screening marked are specifically of the inspection) \$ 0.0 in is limited to what is	Structural				