# Power Steering Cold Start Squawk/Squeal Type Noise When Outside Temperature Below -24C (-12F) (Replace Power Steering Fluid) #04-02-32-002 - (Mar 1, 2004)

Power Steering Cold Start Squawk/Squeal Type Noise When Outside Temperature Below -24°C (-12°F) (Replace Power Steering Fluid)

2004 Cadillac CTS, CTS-V

with 3.6L or 5.7L Engine (VINS 7, S -- RPOs LY7, LS6)

### **Condition**

#### Important

This condition, which is related to power steering fluid viscosity, should not be confused with conditions having similar symptoms such as those described in the Symptom List in the Power Steering System subsection of the Service Manual.

Some customers may comment on hearing a squawk/squeal type noise coming from the engine compartment and occurring when the outside ambient temperatures are very low (approximately -24°C (-12°F) and lower).

#### Cause

This condition may be due to the low ambient temperatures causing the power steering fluid to thicken in the same manner as any other petroleum-based oil or fluid. Upon cold starting, the fluid resists movement and does not circulate through the power steering pump as easily as it does after warming and thinning to its normal operating viscosity.

### Correction

Service Information

1. Flush the old fluid from the power steering system. Refer to Flushing the Power Steering System in the Power Steering sub-section of the Service Manual or SI document #662938.





- 2. Fill the power steering system with new Cold Climate Power Steering Fluid.
- 3. Bleed the power steering system to remove any trapped air. Refer to Bleeding the Power Steering System in the Power Steering sub-section of the Service Manual or SI document #487449.

### **Parts Information**

Part Number	Description	Size
12345866 (Canada 10953484)	Cold Climate Dower Steering Eluid	16 oz (0.5 L)
12345867 (Canada 10953471)	Cold Climate Power Steering Fluid	32 oz (1.0 L)

Parts are currently available from GMSPO.

### **Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
E9404*	P/Steering Fluid Flush and Replace w/Cold Climate Fluid	1.4 hrs
*This is a unique labor operation to be used only with this bulletin.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



## © Copyright General Motors Corporation. All Rights Reserved.

Document ID# 1465996	
2004 Cadillac CTS	