Home Inspection By Stephen Ruback 17515 Spring Cypress, C136, Cypress, TX 77429 832-489-1071

PROPERTY INSPECTION REPORT

Prepared For:	Client Name	
Concerning:	ANY St., Your City, TX 77XXX	
	(Address or Other Identification of Inspected Property)	
Ву:	Stephen Ruback, License Number 6030	Now
	(Name and License Number of Inspector) $n/a \\$	(Date)
	(Name, License Number and Signature of Sponsoring Inspector, if required)	

The inspection of the property listed above must be performed in compliance with the rules of the Texas Real Estate Commission (TREC).

The inspection is of conditions which are present and visible at the time of the inspection, and all of the equipment is operated in normal modes. The inspector must indicate which items are in need of repair or are not functioning and will report on all applicable items required by TREC rules.

This report is intended to provide you with information concerning the condition of the property at the time of inspection. Please read the report carefully. If any item is unclear, you should request the inspector to provide clarification.

It is recommended that you obtain as much history as is available concerning this property. This historical information may include copies of any seller's disclosures, previous inspection or engineering reports, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovation, remodeling, additions or other such activities have taken place at this property.

Property conditions change with time and use. Since this report is provided for the specific benefit of the client(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Report # 502127

This was a HUD home that had been vacated for some time, and showed many signs of long term neglect. Gas and water was turned off. While electricity was on, several exposed wires were energized and provided serious safety hazards. No functional appliances were present.

Report Identification: ANY St., Your City, TX 77XXX Page 2 of 9

Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. Comments may be provided by the inspector whether or not an item is deemed in need of repair.

I=Inspected		NI=Not Inspected		NPNot Present R=Not Functioning or In Need of Repair	
I	NI	NP	R		Inspection Item
•			•	explanation.) Comments (An Pier and beam f of repair. Perimeter support opening. Full opening all vertical examine adjact perimeter beat Loose electrical Ground under his structure – results of the structure	opinion on performance is mandatory.): oundation appears to function, but several conditions are in need out beam showed signs of moisture and deterioration at back extent of deterioration not visible or readily accessible. Suggest ent areas and have qualified foundation technician/engineer cent beams for moisture and deterioration. If deterioration of m is widespread, this is likely to require significant cost to repair. wires visible under house – safety hazard. ouse was wet to touch and drainage was not directed away from pair. structure and ground was less than 18 inches – repair. dequate – repair. not screened to keep animals out – repair.
•				Gutters missing Gutters/down sp "R801.3 Roof of to exist, all do roofs that will least 5 feet (I system." [Er Several areas sle foundation — A minimum of inches for oth Low spots near drainage away	valve for water heater directed under structure – safety hazard. bouts do not direct water at least five feet from structure. drainage. In areas where expansive or collapsible soils are known wellings shall have a controlled method of water disposal from a collect and discharge all roof drainage to the ground surface at the structure of the ground surface at the structure of the ground surface at the structure of the structur
~			•	Comments: Roc Asphalt shingle Some shingles l Original design	ng (If the roof is inaccessible, report the method used to inspect.) of covering inspected by binoculars. If s appear to be near the end of their useful life. If ifted – repair. If was apparently wood shingles, which have been replaced with thing and asphalt shingles.

=lr	spect	ed	N	I=Not Inspected NPNot Present R=Not Functioning or In Need of Repair
ı	NI	NP	R	Inspection Item
~	M13 with large from acco inche appli	an cest ape that the ordance (7 iance es by	Jacob Appopening opening opening opening opening opening opening with 162 min where 163 min where 164 30 in	D. Roof Structure and Attic (if the attic is inaccessible, report the method used to inspect.) Comments: Front section of roof showed some visible bowing. Ridge board did not extend below cut ends of rafters – repair. Rafters were 2x4 lumber instead of 2x6. Insulation thickness nominally 0 inches to 4 inches. Several areas with thin or no insulation should be filled in. Attic flooring does not provide the minimum 30 inch access at least 3/4 inch thick to and in front of mechanical equipment – repair. pliances in attics. Attics containing appliances requiring access shall be provided g and a clear and unobstructed passageway large enough to allow removal of the see, but not less than 30 inches (762 mm) high and 22 inches (559 mm) wide and not seet (6096 mm) in length when measured along the centerline of the passageway ing to the appliance. The passageway shall have continuous solid flooring in a Chapter 5 not less than 24 inches (610 mm) wide. A level service space at least 30 m)deep and 30 inches (762 mm) wide shall be present along all sides of the e access is required. The clear access opening dimensions shall be a minimum of 20 nches (508 mm by 762 mm), where such dimensions are large enough to allow largest appliance. Facia boards rotted and with gaps – repair. Roof vent covers corroded, patly missing – repair. Cover on attic access door warped – repair.
•			•	 E. Walls (interior and Exterior) Comments: Exterior: Several holes and cracks should be patched or sealed. Wood trim and siding rotted, warped, gapped and generally open to elements – replace. East wall showed a visible bulge. North West corner showed signs of movement in excess of 1/2 inch relative to adjacent window – repair. This could be an indication of additional damage inside wall. The only way to be sure of extent of damage is to open wall for further inspection. Expansion joints in brick walls not present. AC service line entrance probably open with signs of animal infestation – repair.
				 Interior: Several holes should be repaired. Large holes under sinks – repair. Hole in East wall at bottom of window showed signs of deterioration of structure under window – repair. Full extent of damage can only be determined by opening wall area. Signs of patching in several walls. Small cracks over doorways and windows – repair and monitor for future movement.
~			•	F. Ceilings and Floors Comments: Floor furnace with loose grill in front hall – trip hazard. Kitchen floor covering missing in several areas – trip hazard. Water stains and deterioration in several areas – repair. Significant bowing in dining area – repair. Significant bowing in front upstairs bedroom, possibly from weight of ceiling fant. Ceiling structure is 2x4 with no support over long span across front bedroom – repair. This appears to be a significant safety hazard. Floor around toilets showed signs of water and deterioration – repair. Signs of patching in several rooms.

l=In	I=Inspected			NI=Not Inspected NPNot Present R=Not Functioning or In Need of Repair				
I	NI	NP	R	Inspection Item				
~			~	G. Doors (interior and Exterior) Comments: Latches missing on several doors – repair. Sliding closet doors did not operate properly – repair. Glass mirror doors had no indication of being safety glass – safety hazard. Doors with glass inserts had no indication of being safety glass – safety hazard.				
~			•	 H. Windows Comments: Windows broken, missing, trim and sills rotted and/or missing allowing entry to the elements – repair/replace. Windows could not be opened, many missing ropes for counterweights and generally in very nonfunctional status. Flashings not visible above windows. Some screens missing/broken – replace. Window latches broken/missing – repair. Birds nesting in rotted sill at bottom of window on West wall – replace. 				
•		~		I. Fireplace/Chimney Comments: Apparent gas line in living room, protruding from floor where a decorative simulated fire place may have been.				
•			•	 J. Porches, Decks and Carports (Attached) Comments: Front porch roof leaking with deteriorated areas on, under and around, including some visible deterioration of structural components visible through holes in corners. Flashing for porch roof at house wall apparently leaking, and improperly installed. Support posts corroded at bottom and sinking into rotted top board – repair. Full extent of damage can only be determined by removing bottom covering. Front porch had cracks in cement floor – repair – after stabilizing foundation drainage. East side concrete steps missing handrail – safety hazard – and blocking vent opening – repair. Back deck cover corroded, posts not anchored, metal covering bent and support post missing in center of warped West side beam – repair. Back porch attached to back wall without flashing – repair. Back deck beginning to deteriorate at rear – repair. Raised part of deck missing screen to keep animals out. Gap between deck and back cement stoop trip hazard. 				
~			•	 K. Other Comments: Stair rail missing at bottom half of stairway. Upper rail ends not curved to wall – safety hazard. Large tree in front closer than 15 feet from porch and may be associated with one or more cracks in porch. Signs of previous animal activity in some cabinets and attic. 				
~			•	 II. ELECTRICAL SYSTEMS A. Service Entrance and Panels Comments: type of service: Overhead Main service conductors at weather head connected by temporary means – safety hazard. Tape wrapped connections at weather head at bottom of drip loop – safety hazard. 				

<u> =In</u>	I=Inspected			NI=Not Inspected NPNot Present R=Not Functioning or In Need or	f Repair
I	NI	NP	R	Inspection Item	
				Service wires closer than 8 feet from metal roof over back deck – s Oversized breakers for wire sizes – safety hazard. Unterminated wires in breaker box – safety hazard. Main service panel with no sign of bonding between neutral and pa hazard. Circuits not clearly labeled as to function – safety hazard. Panel cover missing screws – safety hazard. Open blocks in electrical panel – safety hazard. Unprotected ground stake with improper type of clamp not flush w safety hazard.	anel – safety
•			•	B. Branch Circuits - Connected Devices and Fixtures (Report a repair the lack of ground fault circuit protection where required.): Comments: House served by: Copper wire Exposed, unprotected, unterminated wires – EXTREME safety haz GFI protection absent – safety hazard. Cover plates missing, loose and broken outlets – safety hazard. Ungrounded outlets – safety hazard. Closet lights missing protective cover – safety hazard. Closet lights missing protective cover – safety hazard. No outlets for electrical service for dryer or kitchen range – repair. Insufficient number of outlets, especially in kitchen. Switches with function unknown. No service outlets for mechanical appliances in attic or outside. At least half of the visible outlets were of old two prong style.	
				III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS	
•			•	 A. Heating Equipment Type and Energy Source: central heat, gas, forced air, Comments: Exhaust flue positioned less than one inch from flamm – safety hazard. Custom metal box between flue and furnace showed signs of possi holes and no indication of being listed for such service. Unit not readily accessible for visible inspection of internals. Gas turned off so unit could not be operated. Suggest detailed inspection, and assessment by qualified heating te ascertain functionality and extent of repairs needed. Unit should be operated. 	ble overheating,
•			•	 B. Cooling Equipment: Type and Energy Source: electrical, split system, AC Comments: Filters dirty – replace. Outside unit missing. Primary condensate line apparently plugged form signs of water straide of house – repair. Primary condensate drain directed to outside near foundation. This directed to a proper trapped drain. Condensate line missing insulation and cap – repair. Condensate drip pan corroded – replace. Cooling system had stains and material buildup on and around air of suggesting poor insulation and seals – repair. Large amount of lint and dirt in ducts suggest likelihood of plugged possible dirty fan. entire unit should be thoroughly evaluated by 	should be coil box

l=In	spect	ed		NI=Not Inspected NPNot Present R=Not Functioning or In Need of Repair
	NI	NP	R	Inspection Item
				technician to determine functionality of all parts of system and feasibility of use with new outside unit. Suggest annual service by qualified AC technician to clean coil & condensate drain and check system operation.
~			•	C. Ducts and Vents Comments: No functional return duct for downstairs – repair. Duct insulation incomplete, broken/torn – repair. Ducts crushed/ deformed – repair. Ducts sagging, inadequately supported with wrong support material – repair.
				IV. PLUMBING SYSTEM
•			•	A. Water Supply System and Fixtures Comments: Water pressure measured as 0 psi. [Water was turned off, so fixtures could not be tested.] Hose bibs missing anti-siphon prevention – safety hazard. Several places where copper tube was connected directly to galvanized iron pipe with no dielectric isolation and heavily corroded joints – repair. Most lines and fixtures exhibited corroded connections – repair/replace. Toilets both loose on floor with signs of deterioration in flooring around them – repair. Signs of previous leaks under most fixtures. Tile surrounds need recaulk or regrouting or replacement. Water supply shutoff valve not visibly evident – repair. "P2903.9.1 Service valve. Each dwelling unit shall be provided with an accessible main shutoff valve near the entrance of the water service. The valve shall be of the full open type having a nominal restriction to flow, with provision for drainage such as a bleed orifice or installation of a separate drain valve. Additionally the water service shall be valved at the the curb or property line in accordance with local requirements."
•			~	B. Drains, Wastes, Vents Comments: Drain plugs all missing or not working – repair/replace. Signs of previous water under all sinks. Drain function could not be tested with water off. Drains appeared to be cast iron pipe. Suggest considering replacement with modern materials to avoid likely problems from a system past its prime. Vent cover corroded and missing – replace.
•			•	 C. Water Heating Equipment (Report as in need of repair those conditions specifically listed as recognized hazards by TREC rules.) Energy Source: gas – located in kitchen Comments: Pressure/temperature relief valve directed under house – safety hazard. Flue vent pipe in contact with several flammable materials in several places – safety hazard. Flue vent pipe disconnected from top of heater – safety hazard. Flue vent pipe connected with screws in adjacent area – safety hazard. Flue vent pipe sloped downward – safety hazard. Corroded connections – repair. Missing drip pan – repair. No attempt should be made to operate water heater until flue vent problems are corrected.

I=Inspected		N	II=Not Inspected	NPNot Present R=Not Functioning or In Need of Repair		
I	NI	NP	R		Inspection Item	
		~		V. APPLIANCES A. Dishwasher Comments:		
		•		B. Food Waste D Comments:	risposer	
•	Comments: Though discharge opening was present in wall, current vent was not outdoor discharge type. Controls difficult to access, and it did not work. No outdoor discharge. "M1502.1 General. Range hoods shall discharge to the outdoors through a single wall duct. The duct serving the hood shall have a smooth interior surface, shall be air tight and shall be equipped with a back draft damper. Ducts serving range hoods shall not terminate in an attic or crawl space or areas inside the building. Exception: Where installed in accordance with the manufacturer's installation instructions, and where mechanical or natural ventilation is otherwise provided, listed and labeled ductless range hoods shall not be required to discharge to the outdoors." [Italic emphasis added.]					
		~		D. Ranges/Ovens Comments:	s/Cooktops	
		•		E. Microwave Co Comments:	ooking Equipment	
		•		F. Trash Compac Comments:	ctor	
		•	•		naust Fans and/or Heaters arooms without openable windows are supposed to have a vent e.	
		~		H. Whole House Comments:	Vacuum Systems	
		•		I. Garage Door O Comments:	perators	
~				J. Door Bell and Comments:	Chimes	
•				K. Dryer Vents Comments		
		~		L. Other Built-in Comments:	Appliances	

I=Inspected			NI=Not Inspected NPNot Present R=Not Functioning or In Need of Repair		
I	NI	NP	R		Inspection Item
		•		VI. OPTIONAL SYSTEI A. Lawn Sprinklers Comments:	MS
		~		B. Swimming Pools Comments:	and Equipment
	~				g in back not inspected per client. Visual observation suggests al for health and safety reasons.
		~		D. Outdoor Cooking Energy Source: gas Comments:	
~			•	Gas line to furnace in Flex line to water her valve on water her Uncapped gas lines uhazard. DO NOT	ble gas lines visually inspected. n attic with flex connector longer than 3 feet – safety hazard. ater longer than three feet, extended through wall and lacking ater side of wall – safety hazard. Inconnected to appliances, some with the valve on – safety FURN ON GAS until these faults are corrected. furnace not adequately supported or protected – safety hazard
		•		Type of Pump: ☐ S Type of Storage Equi	Surface Submerged Supposed Bladder tank Other Ilhead less than 18 inches above grade.
		~		G. Septic Systems Comments	
		~		H. Security Systems Comments:	5
•			•	I. Fire Protection Eq Comments: Smok	uipment e alarms not present in each bedroom and adjacent hallway.

ADDITIONAL COMMENTS:

Safety related items should have highest action priority.

Foundation drainage should be corrected and moisture level under structure stabilized before trying to level any other part of structure.

Suggest turning off power until electrical system can be repaired to eliminate all obvious safety hazards.

Water should remain off until all obviously faulty fixtures and connections can be repaired to avoid accidental flooding from leaks and/or broken fittings.

This confidential report is provided exclusively for: You

Page 9 of 9

I=Inspected NI=Not Inspected NPNo		NI=Not Inspected	NPNot Present R=Not Functioning or In Need of Repair		
Ι	NI	NP	R		Inspection Item

Water heater should not be operated until installed properly. Suggest considering alternate locations for water heater.

Gas should remain off until all unused lines are capped and safety related repairs made.

Overall condition was, in the opinion of the inspector, very poor. Virtually all systems in need of serious repair/replacement. Several unsafe conditions were also present that should be corrected at the earliest possible time.

Stephen Ruback Professional Inspector