

List of Recalls and Replacement Parts for Child Restraints

November 25, 2015

The most recent recall is for certain 2016 model BMW sedans with a possible lower anchor issue. See pages 15-16. New seats have also been added. Safety seats discontinued or manufacturers out of business for 10 years or more are not included. For information on older seats or out-of-business manufacturers, call SafetyBeltSafe U.S.A.

How can you tell if your safety seat is safe?

Make sure that the expiration date stamped on the plastic has not passed and it has never been used in a crash. You can't be sure about the history of a used seat unless you got it from a friend or relative. You will need the detailed instruction booklet (it can be ordered from the manufacturer if it is missing) to check that the seat has all of its parts and to find out how to use it correctly. Check for possible damage, such as cracks in the plastic, frayed straps, stiff buckles or harness adjusters. If the safety seat passes all of these criteria, you still need to check for possible recalls.

What is a safety seat recall?

Just like cars and other products, a safety seat may be "recalled" because of a defect that could injure your child. Manufacturers are required to fix the problem free of charge. If your seat is recalled, be sure to get it fixed right away.

Does the safety seat have to be sent back?

Not usually. Most problems can be fixed by replacing a part that the manufacturer will send you for free. Sometimes, with an older seat or when the company is out of business, you will need to take it to a special recycling center (go to www.carseat.org/recycling_la.html for more info) or, if none is available in your area, destroy the seat to make sure it is not picked up by someone and used by another child. Break it with a sledgehammer, crush it, or take it completely apart and mark it "not for use as a safety seat" before throwing it away wrapped securely in a heavy trash bag.

Should I keep using a recalled seat?

Many defects are minor, but some are quite serious. All problems should be corrected as soon as possible. Unless you have another seat, you should go on using the recalled one while you are waiting for the repair kit. Using a recalled safety seat almost always is safer than letting your child ride in a safety belt only.

How to check your safety seat for recalls

1. Look up the name of the manufacturer.
2. Look up the name of your specific model. Important: the model name may not be found anywhere on the seat, and many safety seats have similar model names. Some rear-facing-only seats are sold as a part of a stroller system. Since stroller model names are not included on this list, it is necessary to determine the name of the corresponding rear-facing-only seat to be sure all recalls and warnings have been found. Some manufacturers have style names (i.e., Oshkosh, Disney characters, etc.) sewn on the fabric or used in promotional materials. These names are used for more than one product and cannot be used to determine whether or not the seat has a recall. If you are not sure of the exact name of your seat, check the Color Pictorial Guide to Child Restraints (you may order a hard copy or license to print from SafetyBeltSafe U.S.A.) or contact the manufacturer or SafetyBeltSafe U.S.A. to help you identify it.
3. If you are sure of the EXACT name of your seat, you are ready to look it up on the recall list. Every model certified by the manufacturer to meet U.S. safety standards and made within the last 10 years is on this list, either with a recall or under the "no recall" section at the end of each manufacturer's section.
4. If your model has a recall listed, you need to compare the date of manufacture of your particular seat with the dates affected by the recall. The date is computer-generated on a paper sticker attached to the side or the back of the seat. Disregard dates on tags attached to the fabric cover or pre-printed in the corner of certification or instruction labels. For some recalls, you also will need to check the model number, which is found on the same sticker as the date. If the date sticker is missing or the date is not clearly marked, assume that all possible recalls apply to your seat. Even if no recall applies, do not use a seat if it has passed its expiration date (specified by the manufacturer in the instruction booklet, usually 4 to 10 years from the date of manufacture), which usually is stamped into the plastic shell.

Special Features of the *SafetyBeltSafe* U.S.A. List of Recalls and Replacement Parts for Child Restraints

1. New recalls are added to this list as soon as they can be verified. Recall Update Service subscribers receive notification by e-mail. To verify that a printed copy of this list is current, go to www.carseat.org and click on Recalls (left frame) or call 310-222-6860.
2. Voluntary customer notification campaigns, special warnings, and additional replacement parts available from manufacturers are included on the list. Some of these are not widely announced and are provided for the benefit of parents and child restraint checkers. The bracketed phrase [Not publicized] indicates usage advice or repair kit availability that has been verified with but not announced by the manufacturer. If a child restraint with one of these problems or any defect which has not been recognized with an official recall is found, it is important to notify officials responsible for defect investigations. To report a defect, call the National Highway Traffic Safety Administration (NHTSA) at 888-327-4236 or 800-424-9393 or go to <http://www-odi.nhtsa.dot.gov/ivoq>.
3. Recall wording, including manufacturer contact information, has been clarified and updated. The "Problem" is described clearly and briefly. The wording under "Action Needed" is based on current information supplied by the manufacturer instead of the original recall notice, which may contain ambiguous or obsolete information.
4. Model names are listed alphabetically. For ease of use and accuracy, all recalls are grouped by the model name of the restraint. Model numbers are also listed, if provided by the manufacturer.
5. All child restraint models made in the past 10 years, with or without a recall, are listed (models without a recall are at the end of each manufacturer's section). If the model name is not found on the list, the child restraint should not be used.
6. When problems with instruction booklets are identified, corrections and updates are obtained from manufacturers and added to the list.

Child Restraint Manufacturer Recalls and Free Replacement Parts

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Angel Guard Products, Inc. (c/o Mercury Distributing, 7001 Wooster Pike, Medina, OH 44256 800-815-6330) www.angel-guard.com				
Angel Guard model with no recalls, replacement parts, or warnings: AngelRide Infant Car Bed				
Aprica 3 Glenlake Parkway, Atlanta, GA 30328, 888-927-7422 www.aprica.com				
Aprica	A30	7/1/11-4/30/12	May be difficult to release harness buckle, which could cause risk to child in emergency.	Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com
Aprica models with no recalls, replacement parts, or warnings: n/a				
Aria Child, Inc. 530 Harrison Ave., Boston MA 02118 888-569-7288 www.urbinibaby.com				
Aria Child models with no recalls, replacement parts, or warnings: Urbini Petal Omni/Touri				
Baby Trend 1607 S. Campus Ave. Ontario CA 91761 800-328-7363 www.babytrend.com				
Baby Trend	Rigid Latch-Loc 6439, 6448, 6481 and Latch-Loc Base 6400	5/14/07 to 4/1/08	LATCH connector metal locking parts can crack, allowing connectors on the base to release from vehicle anchors in a severe crash.	Call for replacement Flex-Loc Base in exchange for Rigid Latch-Loc Base. Until replaced, secure base or seat alone with vehicle belt.
Baby Trend	Trendz Fastback 3-in-1 (#FB60070; FB60408)	10/1/11 to 7/31/13	May be difficult to release harness buckle, which could cause risk to child in emergency.	Call 1-800-328-7363 for replacement buckle.
Baby Trend models with no recalls, replacement parts, or warnings: Baby Trend Booster, EZ Flex-Loc, EZ Flex-Loc 32, EZ-Loc, Euro Sport, Flex-Loc, Hybrid, Inertia, Secure Snap Gear 32.				
Bergeron Health Care, 15 South Second Street, Dolgeville, NY 13329, 800-371-2778, www.adaptivemall.com				
Bergeron model with no recalls, replacement parts, or warnings: Special Tomato				

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Britax Child Safety, 13501 So. Ridge Dr., Charlotte, NC 28273, 888-427-4829, www.britaxusa.com				
Britax	Advocate 70 CS	7/1/2010 to 8/31/2011	A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]	Call Britax for more information and replacement kit, if needed.
Britax	Advocate 70-G3 (E9LG81A, E9LG83N, E9LG83P, E9LG83X, E9LG83Y, E9LL21A, E9LL23P, E9LL23Y)	6/1/2012 to 8/31/2012	Material of HUGS chest pads is too soft, which could be a choking hazard.	Monitor child and call for replacement pads.
Britax	Advocate ClickTight (E1A025Q, E9LT95N, E9LT95Q, E9LT95Z)	8/1/2014 to 7/29/2015	Red harness adjustment button may remain in release position after harness is tightened, enabling shoulder straps to loosen.	Call Britax for repair kit that includes lubricant to apply once only, directly to harness adjustment button.
Britax	Boulevard (E9L57)	3/1/06 to 8/1/06	In some crash tests with the weighted 6-yr dummy (65 lbs.), the tether hook opened or broke. When it broke, the recline position changed, which is prohibited by FMVSS 213.	To comply with the federal standard, Britax has notified owners that top tether use should be discontinued when the child weighs more than 50 lb. Call Britax for add-on labels. Britax has informed SafetyBeltSafe U.S.A. that performance actually improved when the tether hook opened during crash tests.
Britax	Boulevard 70, Boulevard 70 CS	All made before 10/5/10	Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall]	Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present).
Britax	Boulevard 70, Boulevard 70 CS	7/1/2010 to 8/31/2011	A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]	Call Britax for more information and replacement kit, if needed.
Britax	Boulevard 70-G3 (E9LJ91A, E9LJ91M, E9LJ91S, E9LJ92E, E9LJ93P, E9LJ93S, E9LK91A)	6/1/2012 to 8/31/2012	Material of HUGS chest pads is too soft, which could be a choking hazard.	Monitor child and call for replacement pads.
Britax	Boulevard ClickTight (E1A015Q, E1A016A, E1A016H, E1A135Q, E9LT85Q, E9LT85S, E9LT86A, E9LT86F, E9LT86G, E9LT86H)	8/1/2014 to 7/29/2015	Red harness adjustment button may remain in release position after harness is tightened, enabling shoulder straps to loosen.	Call Britax for repair kit that includes lubricant to apply once only, directly to harness adjustment button.
Britax	Chaperone (E9L69N9, E9L69P2, E9L69P3, E9L69P5)	4/1/09 to 5/31/10	Chest clip may break when engaged, causing risk of laceration or choking on small piece.	Call for new chest clip.
Britax	Chaperone (E9L692J, E9L692K, E9L692L, E9L692M)	9/1/2010 to 4/30/11	Harness adjuster may detach from shell due to improperly installed rivet. If adjuster is detached, do not use seat until repaired.	Call to order repair kit.
Britax	Companion (E9L14)	10/31/03 to 6/6/04	Incorrectly assembled carrier may allow too much forward rotation in an impact due to improper seating of the carrier in the base.	Call to see if the carrier and base must be replaced. In the interim only use the carrier without the base.

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Britax	Companion (E9L14, E9L20, E9L80)	All made before 11/1/07	Instructions have been revised to specify use of inner crotch strap location for children under 11 lbs. and to change the maximum head height to one inch from top of restraint shell.	Call Britax or go to its Web site to receive revised instructions and labels.
Britax	Decathlon (E9L47)	2/12/05 to 7/31/07	If harness adjuster strap is pulled from the side, the plastic housing around the release button may come loose, allowing the adjuster to move out of position and making the harness difficult to tighten.	Call for repair kit consisting of push rivet fasteners to keep harness adjuster in position.
Britax	Frontier (model numbers starting with E9L54)	4/1/08 to 9/14/08 (black harness) 4/1/08 to 9/17/08 (beige harness)	When loosening harness by pulling on only one strap, straps may become detached from harness yoke (splitter plate) on back of seat, resulting in child not being restrained.	Call for repair kit with plastic pieces to cover harness yolk ends. Instructions state to always pull on both straps when loosening harness.
Britax	Husky	All	LATCH belt path may be used if lap-shoulder belt is too short for belt path shown in instructions (tether must be attached). Recline bar is not required if top tether is attached, regardless of type of lower installation used. [Not publicized]	
Britax	Husky	All	Use of the long belt path with a lap belt only may allow excessive forward head movement in a crash.	Call for new labels and instructions; use the short belt path with recline bar.
Britax	Husky	All through 7/23/04	The adjuster strap may slip, allowing the harness to loosen.	Do not use if harness can be loosened by pulling on straps without lifting release lever. Call for replacement adjuster strap with thicker weave pattern.
Britax	Marathon	All through 7/23/04	The adjuster strap may slip, allowing the harness to loosen.	Do not use if harness can be loosened by pulling on straps without lifting release lever. Call for new adjuster strap with thicker weave pattern.
Britax	Marathon (E9L06, E9W06, E906)	5/23/06 to 7/28/06	Tether hook may open in a crash, allowing possible head injury. Applicable only if child is over 50 lbs. and tether hook is stamped KGR01A.	Call for replacement tether hook.
Britax	Marathon 70	All made before 10/5/10	Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall]	Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present).
Britax	Marathon 70	7/1/2010 to 8/31/2011	A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]	Call Britax for more information and replacement kit, if needed.
Britax	Marathon ClickTight (E1A005R, E1A006B, E1A116L, E9LT71Q, E9LT75R, E9LT76B, E9LT76L, E9LT76N, E9LT76P, EXA116L)	8/1/2014 to 7/29/2015	Red harness adjustment button may remain in release position after harness is tightened, enabling shoulder straps to loosen.	Call Britax for repair kit that includes lubricant to apply once only, directly to harness adjustment button.

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Britax	Pavilion 70-G3 (E9LK31A, E9LK31Q, E9LK32D, E9LK32Z, E9LK33Q, E9LL11A, E9LL11Q, E9LL12D, E9LL12Z)	6/1/2012 to 8/31/2012	Material of HUGS chest pads is too soft, which could be a choking hazard.	Monitor child and call for replacement pads.
Britax	Regent (E9L3998)	12/18/06 to 1/18/07	Incorrect warning label on cover.	Call for replacement cover.
Britax	Regent (E9L39)	All made before 6/18/07	Manufacturer has modified the seat and instructions to enhance performance.	Call for kit with new instructions, label, longer LATCH strap, and adhesive slip-resistant strips. Use long belt path for children 22-40 lb., short path for 40-80 lb. Use recline bar for all installations.
Britax	Roadster	All	Preferred shoulder belt routing is <i>under</i> the armrest. (Instructions prior to 12/03 show routing over the armrest.) [Not publicized]	
Britax	Roundabout (161)	Many older seats have been recalled. Do not use if past expiration date or if date is unknown.		
Britax	Roundabout 55	All made before 10/5/10	Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall]	Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present).
Britax	Roundabout 55	7/1/2010 to 8/31/2011	A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]	Call Britax for more information and replacement kit, if needed.
Britax	Wizard	All through 7/23/04	The adjuster strap may slip, allowing the harness to loosen.	Do not use if harness can be loosened by pulling on straps without lifting release lever. Call for replacement adjuster strap with thicker weave pattern.
Britax models with no recalls, replacement parts, or warnings: Advocate, Advocate CS, Advocate 2013, B-Safe, B Safe 35, B Safe 35 Elite, Baby Safe, Bodyguard, Boulevard CS, Boulevard 2013, Cruiser, Diplomat, Expressway, Frontier 85, Frontier 85 SICT, Frontier 90, Highway, Highway 65, Marathon CS, Marathon 70 G3, Marathon 2013, Monarch, Parkway (all models), Pavilion 2013, Pinnacle 90, Pioneer 70, Roundabout 50, Roundabout 55 G 3, Roundabout 2013, Starriser.				
BubbleBum, 7380 Sand Lake Road, Suite 500, Orlando, FL 32819, 800-969-6586, www.bubblebum.us				
BubbleBum models with no recalls, replacement parts, or warnings: BubbleBum Booster				
Car Seat Specialty. See Team-Tex America				
Chicco, 1842 William Penn Way, Ste. 101, Lancaster, PA 17601, 877-424-4226, www.chiccousa.com				
Chicco	KeyFit, KeyFit 30, or Cortina Travel System (base only)	2/26/08 to 3/17/08	Some bases have a defect that can prevent achieving a tight fit when LATCH is used for installation.	Call to order new base. Use vehicle belt for installation until new base is received.
Chicco models with no recalls, replacement parts, or warnings: KeyFit 30 Magic, KeyFit Strada, KidFit Booster, NextFit, NextFit Zip				
Clek Inc., 12 Upjohn Road, Suite 1, Toronto, Ontario M3B 2V9, Canada 248-284-2462, clekinc.com				
Clek models with no recalls, replacement parts, or warnings: Fllo, Foonf, Olli, Oobr, Ozzi				
Columbia Medical, 13577 Larwin Circle, Santa Fe Springs, CA 90670 800-454-6612, www.columbiamedical.com				
Columbia models with no recalls, replacement parts, or warnings: #2000, #2500, Spirit (#2400)				
Combi USA, 3520 Westinghouse Blvd., Suite B, Charlotte, NC 28273, 800-992-6624, www.combiusa.com				
Combi	Avatar	11/12/03 to 5/7/04	LATCH strap, when used with seat rear-facing, could be severed in a crash.	Call for replacement part. Use vehicle belt when seat is facing rearward until replaced.

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Combi	Centre & Shuttle (#8065, 8074, 8086, 8087, 8520, 4400, 4515, 4520)	10/19/05 to 12/15/07	Based on testing at speeds higher than required by federal standard, safety seat shell could separate from base in frontal collision. Combi states no injuries have been reported.	Call to order retrofit kit. Until modification is completed, use seat without base.
Combi	Coccoro (#8220)	January 1, 2009 to December 31, 2012	Webbing (without seat) tore partially in static test because of embedded plastic button that keeps buckle tongues from sliding out of reach. Complete restraint system complies with all requirements.	Call 844-697-1690 for free harness replacement kit. Continue using seat until new harness is received.
Combi	Zeus 360 (#8836)	February 1, 2009 to May 31, 2012	Webbing (without seat) tore partially in static test because of embedded plastic button that keeps buckle tongues from sliding out of reach. Complete restraint system complies with all requirements.	Call 844-697-1690 for free harness replacement kit. Continue using seat until new harness is received.
Combi	Zeus Turn (#8815)	July 1, 2007 to March 31, 2009	Webbing (without seat) tore partially in static test because of embedded plastic button that keeps buckle tongues from sliding out of reach. Complete restraint system complies with all requirements.	Call 844-697-1690 for free harness replacement kit. Continue using seat until new harness is received.
Combi models with no recalls, replacement parts, or warnings: Apogee, Connection, Dakota, Everest, HighRide, Kobuk, Kobuk Air-Thru, McKinley, Navette 22, Saratoga, Shuttle 33, Shuttle 35, Tyro, Tyro II, Victoria, Yorktown.				
Compass. See Tomy International.				
Convaid, 2830 California St., Torrance, CA 90503 888-266-8243, www.convaid.com				
Convaid models with no recalls, replacement parts, or warnings: Carrot, Carrot 3, Convaid Special Needs Car Seat				
Cosco. See Dorel Juvenile Group.				
Cybex c/o Regal Lager, 1100 Cobb Place Blvd., Kennesaw, Georgia 30144, 800-593-5522, www.regallager.com				
Cybex	Solution X-fix booster	2/1/10 to 2/28/10	Incorrect label states that unoccupied booster may be attached with LATCH only. Vehicle belt must be attached.	Call manufacturer for new label.
Cybex models with no recalls, replacement parts, or warnings: Aton, Aton 2, Aton Q, Solution M Fix, Solution Q Fix, Solution Q2 Fix, X Fix Q				
Diono LLC, 418 Valley Ave. NW, Suite 100, Puyallup, WA 98371, 888-336-7909, www.diono.com				
Diono or Sunshine Kids models with no recalls, replacement parts, or warnings: Cambria, Monterey, Olympia, Pacifica, all Radian models (65, 65SL, 80, 80SL, XT, XTSL, R100, R120, RXT), Rainier, Santa Fe, Snug Seat Pilot, Solana.				
Dorel Juvenile Group, 2525 State St., Columbus, IN 47201, 800-544-1108, www.djgusa.com				
Note: Dorel is the parent company for Cosco, Eddie Bauer, Maxi-Cosi, Safety 1st, Alpha Elite , and Alpha Sport brands. Some models are marketed with multiple names.				
Dorel	Some infant seats sold with travel systems (rear adjust only).	1/6/08 to 4/6/09 "Made in China" on label.	Handle may detach as screws loosen, allowing baby to fall out of seat.	Call for repair kit. Do not use handle until repaired. Does not apply to all model numbers; check with Dorel.
Dorel	3-In-1	See Alpha Omega.		
Dorel	3 Phase (22-453, 22-452)	11/1/03 to 12/31/05	Adjuster strap may slip in a crash, allowing the harness to loosen.	Call to order kit with replacement harness adjuster strap.
Dorel	Adjustable Highback Booster	See Prospect.		
Dorel	All in One	See Alpha Omega.		

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Dorel	Alpha Luxe	See Alpha Omega Elite.		
Dorel	Alpha Omega (22150, -52, -59, -72, -77, -78, -85, 22412, -59, -69)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call to get lubricant for harness adjuster pivot pins.
Dorel	Alpha Omega or 3-in-1	Many older seats have been recalled. Do not use if past expiration date or if date is unknown.		
Dorel	Alpha Omega (22-150, 22-151) or 3-In-1 (22-770)	10/1/05 to 12/31/05	Child's finger may get stuck in small square hole in shell (near curved area on left side near edge of seat pad)	Call to order repair kit (black labels to cover openings)
Dorel	Alpha Omega or 3 in 1 (22-150, 22-180, 22-269, 22-151, 22-750, 22-770)	11/1/03 to 12/31/05	Adjuster strap may slip in a crash, allowing the harness to loosen.	Call or go to Dorel Web site to order kit with replacement harness adjuster strap.
Dorel	Alpha Omega Elite (22148-49, 22154-55, -58, -88, -95, 22456, -59, -62, -65, 22755, -58, -59, -90, -99)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call to get lubricant for harness adjuster pivot pins.
Dorel	Alpha Omega Elite or Deluxe 3 in 1 (22-155, 22-455, 22-755, 22-756, 22-757)	11/1/03 to 12/31/05	Adjuster strap may slip in a crash, allowing the harness to loosen.	Call to order kit with replacement harness adjuster strap.
Dorel	Alpha Omega Elite (22187, 22465, CC033, CC046) or Deluxe 3 in 1 (22790, CC046)	7/20/10 to 5/18/11	Labels with arrows for rear-facing belt path are incorrect, which could result in belt being placed in forward-facing belt path.	Call 877/675-2355 for a kit with modified labels and installation instructions.
Dorel	Arriva	Many older seats have been recalled. Do not use if past expiration date or if date is unknown.		
Dorel	Avenue (22439, 22449)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call to get lubricant for harness adjuster pivot pins.
Dorel	Comfort Infant (22-331, 22-332, 22-630, 22-631)	All made before 2/28/06	Base is very hard to install securely. Call for replacement base. [Not publicized]	
Dorel	Comfort Infant (22-331, 22-332, 22-630, 22-631)	7/26/05 to 2/28/06	Screws in handle can loosen, posing a choking hazard. Does not affect crash performance.	Call for screw replacement kit.
Dorel	Comfy Carry (IC123FSM)	5/1/11 to 4/30/12	Some seats were sold without detachable base containing the required LATCH system.	Call for base with LATCH system.
Dorel	Complete Air LX (CC050), Complete Air SE (CC051)	7/20/10 to 5/18/11	Labels with arrows for rear-facing belt path are incorrect, which could result in belt being placed in forward-facing belt path.	Call 877/675-2355 for a kit with modified labels and installation instructions.
Dorel	Deluxe 3 in 1		See Alpha Omega Elite	
Dorel	Deluxe Infant (22-625)	8/19/03 to 10/20/04	Strap ends can slip through adjusters, causing gradual loosening of harness.	Call for clips to attach to ends of harness.
Dorel	Deluxe Infant	See recall at top of Dorel section.		
Dorel	Deluxe Convertible	See Enspira		
Dorel	Deluxe 3-in-1	See Alpha Omega Elite.		

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Dorel	Designer 22 (22-300, 22-325, 22-625 with codes ending in GB1B)	8/19/03 to 10/20/04	Strap ends can slip through adjusters, causing gradual loosening of harness.	Call for clips to attach to harness strap ends.
Dorel	Designer 22	See recall at top of Dorel section.		
Dorel	Dream Ride (22-001-FSM)	12/1/03 to 4/28/04	When used in rear-facing mode, seat may rotate downward too far in a crash.	Use only as side-facing car bed. Call Dorel for warning sticker and replacement seat, if rear- facing seat is needed.
Dorel	Dream Ride, Dream Ride Ultra	Many older seats have been recalled. Do not use if past expiration date or if date is unknown.		
Dorel	Echelon	See Alpha Omega Elite.		
Dorel	Eddie Bauer	See specific model name.		
Dorel	Enspira (22452-53, 22740-41, 22458)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call to get lubricant for harness adjuster pivot pins.
Dorel	Enspira or Deluxe Convertible (22-450, 22-451, 22-740)	11/1/03 to 12/31/05	Adjuster strap may slip in a crash, allowing the harness to loosen.	Call or go to Dorel Web site to order kit with replacement harness adjuster strap.
Dorel	Enspira Overhead Shield or Enspira Versa-Fit (22-480, 22-481)	11/1/03 to 12/31/05	Adjuster strap may slip in a crash, allowing the harness to loosen.	Call or go to Dorel Web site to order kit with replacement harness adjuster strap.
Dorel	First Ride	See recall at top of Dorel section.		
Dorel	High Back Booster (generic)	Note: Dorel identifies various models as “High Back Boosters,” including several combination seats (used as child seat with harness or as booster after removing harness; with or without armrest; with front or rear harness adjuster) as well as boosters only (no harness included).		
Dorel	High Rise (22-297, 22-298, 22-299)	10/1/03 to 10/31/03	Label states booster is for use by children <i>under</i> one year of age; it should say <i>over</i> one year.	Call for replacement label.
Dorel	Intera (22-460)	11/1/03 to 12/31/05	Adjuster strap may slip in a crash, allowing the harness to loosen.	Call or go to Dorel Web site to order kit with replacement harness adjuster strap.
Dorel	Maxi-Cosi Mico (22356, 22371-72)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call for lubricant for harness adjuster pivot pins.
Dorel	Maxi-Cosi Mico (22-371,22-372) or base only (22-515)	All made before 6/28/08	Shell may not attach securely to base or may be difficult to detach.	Call for kit to replace springs in base. Use without base until repaired.
Dorel	Maxi-Cosi Priori (22476, 22486)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call for lubricant for harness adjuster pivot pins.
Dorel	Olympian	See Touriva		
Dorel	onBoard (22077- 78, 22356)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call for lubricant for harness adjuster pivot pins.
Dorel	onBoard 35 (IC124FSM)	5/1/11 to 4/30/12	Some seats were sold without detachable base containing the required LATCH system.	Call for base with LATCH system.
Dorel	Prospect (22580, 22880)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call for lubricant for harness adjuster pivot pins.
Dorel	Regal Ride	See Touriva.		
Dorel	Safety 1st	See specific model name.		

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Dorel	Scenera (22120-22128, 22160, 22162, 93120)	All made before 3/24/08	Harness webbing may be damaged if it slides over pointed guides on bottom of plastic shell. Keep webbing behind guides.	If damaged, call Dorel for replacement harness and instructions for keeping webbing in correct position. [Not publicized]
Dorel	Starter	See recall at top of Dorel section.		
Dorel	SureFit (22657, 22346, IC072)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call for lubricant for harness adjuster pivot pins.
Dorel	Surveyor	See Vantage Point.		
Dorel	Three Car Seats in One	See Alpha Omega.		
Dorel	TLC	Many older seats have been recalled. Do not use if past expiration date or if date is unknown.		
Dorel	Touriva, 5-point harness, T-shield, or overhead shield	Many older seats have been recalled. Do not use if past expiration date or if date is unknown.		
Dorel	Touriva or Regal Ride, 5-point harness (22100TTD, 22100TIP, 2111FSM2, 2130WAL, 2139MON)	9/28/04 to 9/20/07	Elastic straps that secure cover to shell may come loose, allowing child to wrap them around parts of body.	Call or visit Dorel Web site to order repair kit.
Dorel	Turnabout	See Arriva.		
Dorel	Uptown (22475)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call for lubricant for harness adjuster pivot pins.
Dorel	Vantage, Vantage Point (22546-47, -53, -54, -60, -61, -64, -67, -74)	5/1/08 to 4/30/09	Harness may gradually loosen during normal use, which could increase risk to child in crash.	Call for lubricant for harness adjuster pivot pins.
Dorel models with no recalls, replacement parts, or warnings: Able65, Advance 70 Air+, Advance SE 65 Air +, Alpha Elite 65, Ambassador, Apex 65, Apt 40 RF, APT 50, Aquos 65, Boost A Pak, Boost Air Protect, Chart Air 65, Comfort High Back Booster, Comfort Ride, Commuter, Complete Voyager, Deluxe Backed BPB, Deluxe Harness 65, Deluxe Highback 65, Designer, Destination, Dream Ride SE, EasyFit 65, Elite 80 Air+, Elite 100 Air +, enRoute, Essential Air, Go Hybrid, Grand Explorer, Grow and Go, Guide 65, High Rider, Incognito, Light 'N Comfy, Maxi-Cosi Cosi35, Maxi-Cosi Mico AP/Mico Nxt, Maxi-Cosi Mico Maxi 30, Maxi-Cosi Prezi, Maxi-Cosi Pria 70 (all models), Maxi-Cosi Pria 85, Maxi-Cosi Rodi (all models) Maxi-Cosi RodiFix, Maxi-Cosi Vello 65, onBoard 35 Air (all models), onSide Air Convertible, Portable Car Seat, Pronto, Protek, Rightway, Rumi Air, Scenera 40RF, Scenera Next, Scenera Versa-Fit OHB, Sport, Stack It!, Store 'N Go, Summit, Summit 65, Summit Deluxe, Top Side Booster, Tote 'n Go, Travel Vest, Traveler, Vantage, Ventura, Vista, XRS 65.				
Dream On Me, 170 Circle Drive North, Piscataway NJ 08854, 732-748-1300, www.dreamonme.com				
Dream On Me models with no recalls, replacement parts, or warnings: Mia Moda Certo (see also recall under Mia Moda)				
Easycarseat (Inflatable booster available online). According to NHTSA, the manufacturer states that all of the boosters sold in the U.S. were withdrawn. Contact GOBOOSTER for more information.				
Eddie Bauer. See Dorel Juvenile Group.				
Evenflo, 225 Byers Rd Miamisburg, OH 45342 , 800-233-5921, www.evenflo.com				
Evenflo	Big Kid Booster (30911173AD, 3091967AD, 30911118AD, 30911120D)	Unknown. Shipped 8/6/12 to 9/18/12	Registration card and instruction manual are missing. Sticker on backrest: "Display Only. Not intended for sale."	Call for missing card and manual. If seat has been distributed by program, notify recipient.
Evenflo	Chase, Chase LX, DLX, Chase Select (#306xxxx, 329xxxx)	8/23/11 to 3/3/14	May be difficult to release harness buckle, which could cause risk to child in emergency.	Call 800-490-7591 or go to www.buckle.evenflo.com for replacement buckle.
Evenflo	Comfort Touch	Refer to specific model name. Comfort Touch is name of style/fabric.		

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Evenflo	Discovery with 3- or 5-pt harness (#390, 391, 534, 552)	4/27/05 to 1/29/08	Safety seat shell could separate from base in high-impact side collision.	Call to order dual-hook fastener strap. Until modification is completed, use seat without base.
Evenflo	Discovery (3021769Z, 3021854Z)	2/4/08 only	Some seats were made without complete assembly of red release handle located on the back. Under certain conditions, the shell could separate from its base, possibly resulting in serious injury.	Call for a replacement safety seat. Until new seat is received, use without base.
Evenflo	Embrace (#317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599)	All made before 4/8/06	When used as carrier, handle can unexpectedly release, causing seat rotation and allowing infant to fall out.	Call for repair kit. Do not use carry handle until repaired.
Evenflo	Embrace 35	12/2011-5/2013. CHECK COLUMNS AT RIGHT FOR MODEL #'s	May be difficult to release harness buckle, which could cause risk to child in emergency. Model #'s 30711365, 31511040, 31511323, 31511400, 3151198, 3151953, 31521138, 46811205, 46811237, 48111200, 48111215, SEE COLUMN AT RIGHT FOR ADDITIONAL MODEL #s.	Call 800-490-7591 or go to www.embracebuckle.evenflo.com for replacement buckle. Additional model numbers: 48111215A, 48111218, 48111234, 48111235, 48111235A, 48111462, 48411391, 48411391D, 48411392, 48411504, 48411504D, 52911307A, 52921040, 55311138, 55311238, 55311292
Evenflo	Express (#329xxx)	10/31/11 to 3/3/14	See Chase	
Evenflo	First Choice (3604098)	1/16/09 to 9/29/09	Missing labels regarding contact information and aircraft certification.	Call to order labels.
Evenflo	Fresh Air	Refer to specific model name. Fresh Air is name of style/fabric.		
Evenflo	Maestro, Maestro Performance (#310xxxx)	8/22/11 to 10/17/13	See Chase	
Evenflo	Maestro (#3101198, 3101980, 31011048, 31011049, 31011059)	12/17/09 to 4/26/10	Plastic shell near harness adjuster may crack in a crash.	Call Evenflo for reinforcement bracket. Do not use seat with harness until repaired; booster use for children over 40 lbs.
Evenflo	Momentum 65, 65 LX, 65 DLX (#385xxxx)	3/4/13 to 8/26/13	See Chase	
Evenflo	OshKosh	Refer to specific model name. OshKosh is name of style/fabric.		
Evenflo	Scout	See Champion		
Evenflo	Secure Kid, Secure Kid LX, DLX, 100/300/400 (#308xxxx)	12/13/11 to 3/3/14	See Chase	
Evenflo	SureRide DLX (#371xxxx)	6/20/12 to 10/17/13	See Chase	
Evenflo	Symphony 65, 65 E3, LX, DLX (#345xxxx, #346xxxx)	10/2/12 to 8/26/13	See Chase	
Evenflo	Titan 65 (#371xxxx)	6/20/12 to 10/17/13	See Chase	

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Evenflo	Triumph (beginning with #264, 359, 389)	9/6/01 to 10/31/05	If cloth cover is pulled back, child could break off piece of foam liner and choke on it.	Call to order protective sleeve.
Evenflo models with no recalls, replacement parts, or warnings: Amp, Bolero, Comet, Confidence, Embrace 35 Advanced (w/SensorSafe), Evolve, Generations, Generations 65, Lite Max, Nurture, Orion, PortAbout, Right Fit (all models), SecureRide 35, Serenade, Sightseer (highback booster), Titan Elite, Titan Sport, Tot Taxi, Traditions, Transitions, Tribute Sport, Triumph Advance 50, Triumph Advance 65, Vanguard, Victory, Vision.				
ExoMotion, 309 South Cloverdale Street, Unit B 12, Seattle WA 98108, 866-870-2122, www.exomotion.com				
Distributor for Recaro Monza Reha, Recaro ProSport Reha (no recalls)				
E-Z-ON Products, 605 Commerce Way West, Jupiter, FL 33458, 800-323-6598, www.ezonpro.com				
E-Z-On models with no recalls, replacement parts, or warnings: Vests and Harnesses				
Fisher-Price, 636 Girard Ave., East Aurora, NY 14052, 800-432-5437, www.fisher-price.com				
Fisher-Price models with no recalls, replacement parts, or warnings: Safe Voyage Convertible, Safe Voyage Deluxe Convertible, Safe Voyage Booster, Safe Voyage Infant.				
GOBOOSTER models with no recalls, replacement parts, or warnings: GOBOOSTER				
Goodbaby USA 530 Harrison Ave. Boston MA 02118 844-543-2020 GBchildusa.com				
Goodbaby USA models with no recalls, replacement parts or warnings: Asana 35, Asana 35AP				
Graco Children's Products, 150 Oaklands Blvd, Exton, PA 19341, 800-345-4109 www.gracobaby.com.				
Graco	Argos 70, Argos 70 Elite	5/1/11 to 7/31/13	May be difficult to release harness buckle, which could cause risk to child in emergency.	Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com
Graco	CarGo (#8D02, 8D03)	1/9/07 to 3/3/08	Incorrect phone number for NHTSA on sticker.	Call Graco for correct sticker.
Graco	Classic Ride 50	10/1/11 to 9/30/13; see Argos 70		
Graco	ComfortSport	10/1/10 to 9/30/13; see Argos 70		
Graco	ComfortSport with 5-pt harness (8433, 8629-39, 8C00-04)	1/2/07 to 7/31/07	The LATCH strap may be incorrectly routed over instead of under the harness straps, allowing excessive rotation of rear-facing seat in a crash.	Call Graco or view drawing on Web site and correct strap routing before installing with LATCH.
Graco	ComfortSport with 5-pt harness (#8C04FRR, 8C04FRR2)	11/1/06 to 10/8/07	Body pillow partially covers airbag warning label on seat cover.	Remove pillow, which is an optional comfort feature.
Graco	CozyCline	1/1/06 to 4/30/10; see Argos 70		
Graco	Head Wise 70 w/Safety Surround	1/1/12 to 7/31/13 and 8/3/13; see Argos 70		
Graco	Infant Carrier or LiteRider	See SnugRide	Graco	Infant Carrier or LiteRider
Graco	My Ride 65, My Ride 65 with Safety Surround	4/1/09 to 7/31/13, and 9/30/13; see Argos 70		
Graco	My Ride 70	5/1/12-7/31/13; See Argos 70		
Graco	My Size 70	1/1/12 to 7/31/13, and 8/3/13; see Argos 70		
Graco	Nautilus 3-in-1, Nautilus Elite, Nautilus Plus	10/1/07 to 7/31/13 and 8/19/13; see Argos 70		
Graco	Platinum CarGo (#8689, 8D01, 8D04, 8D05, 8D10)	1/9/07 to 3/3/08	Incorrect phone number for NHTSA on sticker.	Call Graco for correct sticker.
Graco	Ready Ride	10/1/10 to 9/30/13	See Argos 70	
Graco	Size4Me 70	1/1/12 to 7/31/13 and 8/3/13; see Argos 70		

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Graco	SnugRide stand-alone models (not sold with stroller) made in USA	3/01/02 to 3/08/03	Metal "U-bars" used to attach carrier to base may be missing from bottom of carrier, allowing carrier to detach from base in a sudden stop or crash.	Use carrier without base until checked and/or replaced. Go to www.gracobaby.com or call for inspection details. If bars are missing, ask for replacement seat.
Graco	SnugRide (#8609, 8616, 8643, 8645, 8646) Does not apply if part of travel system.	8/1/06 to 6/30/07	Backing of seat pad could pull away from seams, possibly allowing child to break off a piece of foam and choke on it.	Call Graco or go to their Web site to order kit with replacement cover.
Graco	SnugRide, SnugRide Classic Connect	3/1/11 to 5/31/13	May be difficult to release harness buckle, which could cause risk to child in emergency.	Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com
Graco	SnugRide 30, SnugRide Classic Connect 30	7/1/10 to 1/31/13	See SnugRide, SnugRide Classic Connect	Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com
Graco	SnugRide 35, SnugRide Classic Connect 35	5/1/11 to 1/31/13	See SnugRide, SnugRide Classic Connect	Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com
Graco	SnugRide Click Connect 40	6/1/12 to 12/31/12	See SnugRide, SnugRide Classic Connect	Call 877-766-7470 for replacement buckle, or visit GracoBuckleRecall.com
Graco	Treasured CarGo (#8686)	1/9/07 to 3/3/08	Incorrect phone number for NHTSA on sticker.	Call Graco for correct sticker.
Graco	Ultra CarGo (#8487)	1/9/07 to 3/3/08	Incorrect phone number for NHTSA on sticker.	Call Graco for correct sticker.
Graco models with no recalls, replacement parts, or warnings. 4Ever, Affix, Affix w/Safety Surround, AirBooster, Argos 65, Argos 80 Elite, Assura, Atlas 65, CarGo Express, Cherish Car Bed, Colorz, Connex, Contender 65, Fit4Me 65, Head Wise 65, Infant Safe Seat, Milestone, My CarGo, MySize 65, Size4Me 65, SnugRide 32, SnugRide Click Connect 30, SnugRide Click Connect 35, Toddler Safe Seat, Turbo Booster (all), Tranzitions.				
Harmony Juvenile Products, 1600 53rd Street, North Bergen, NJ 07047, 877-306-1001, www.harmonyjuvenile.com				
Harmony models with no recalls, replacement parts, or warnings: Baby Armor, Carpooler, Cruz, Defender 360, Dreamtime Comfort, Folding Travel Booster, LiteRider, Olympian, Transit, Transit Deluxe, V6 Highback, Youth Booster.				
Hauck Fun for Kids, 212 A Wilkinson Rd., Brampton, Ont., L6T 4M4 Canada 905 455 5888				
Hauck Fun for Kids models with no recalls, replacement parts, or warnings: ProSafe 35				
IMMI (Also See SafeGuard) 18881 IMMI Way Westfield, Indiana 46074 317-896-9531 www.imminet.com				
IMMI Models with no recalls, replacement parts or warnings: Go Combination Child Seat				
Jané USA, P.O. Box 410007, San Francisco, CA 94141, 415-824-1237, www.janeusa.com				
Jané USA models with no recalls, replacement parts, or warnings: Indy, Indy Plus, Montecarlo R1, Team, Team Plus.				
Jeffco Fibres, 451 Quarry St. Fall River, MA 02722 508-673-1001, www.jeffcofibres.com (out of safety seat field)				
Jeffco or LaRoche models with no recalls, replacement parts, or warnings: Grizzly Bear, Polar Bear, Teddy Bear				
J J Cole - See Tomy				
Jupiter Industries, 1399 Kennedy Rd., #22, Scarborough, Ontario M1P2L6 Canada, 800-465-5795, 416-285-7525, www.jupiterindustries.com				
Jupiter models with no recalls, replacement parts, or warnings: Komfort Kruiser.				
Kiddy, 2420 Wild Iris Lane, Dacula, GA, 30019, 678-377-3309, www.kiddyusa.com				
Kiddy models with no recalls, replacement parts, or warnings: Cruiserfix Pro, Evolution Pro, World Plus				
KidsEmbrace, 4830 Rusina Rd., Suite B, Colorado Springs, CO 80907, 866-947-3287, www.kidsembrace.com				
Kids ii 333 Piedmont Rd. NE, Ste. 1800, Atlanta GA 30305 770-551-0442 www.kidsii.com				
Kids ii models with no recalls, replacement parts, or warnings: Ingenuity InTrust 35				

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Learning Curve. See Tomy International.				
Lenox Juvenile Group, 100 SW 52nd Ave, Ocala, FL 34474				
Lenox models with no recalls, replacement parts, or warnings: Tattle Tale Convertible, Tattle Tale Toddler/Booster				
LilFan 17401 Tiller Ct., Ste. A, Westfield IN 46074 317-804-9160 www.lilfan.com				
LilFan models with no recalls, replacement parts, or warnings: Box Seat, Club Seat				
Lilly Gold 5468 Maple Ridge Ct., Minnetonka MN 55343 800-829-1625 www.lillygold.com				
Lilly Gold	Sit'n'Stroll (#4002)	5/5/08	Center adjuster webbing does not comply with required breaking strength.	Call for repair kit and instructions to replace webbing.
Little Tikes 2180 Barlow Rd. Hudson OH 44326 800-321-0183 www.littletikes.com				
Little Tikes products with no recalls, warnings or replacement parts: Highback Booster, Backless Booster				
Magna Aftermarket America. See Clek.				
Maxi-Cosi. See Dorel.				
Mercedes-Benz USA, Accessories, P.O. Box 350, Montvale, NJ 07645, www.mbusa.com				
Mercedes-Benz	Topsafe	3/1/03 to 11/30/03	LATCH attachments may fail in a crash, releasing the safety seat.	Go to dealer for refund (Recall Campaign #2004 120005). Use vehicle belt for installation until seat is replaced.
Mercedes models with no recalls, replacement parts, or warnings: Mercedes Child Booster, Duo, Kid.				
Merritt Manufacturing, P. O. Box 17152, Indianapolis, IN 46217, 317-409-0148, www.eztether.com				
Merritt Manufacturing models with no recalls, replacement parts, or warnings: Churchill, Hope Car Bed, Jefferson, Roosevelt				
Mia Moda Inc., 170 Circle Drive North Piscataway, NJ 08854, 866-642-6632 www.miamodainc.com				
Mia Moda (See also Dream On Me)	Viva, Viva Supreme (#5000-5081)	All (discontinued 4-30-09)	(1) Splitter plate has sharp edges which can cut harness. (2) Base could crack in a crash.	Do not use. Go to www.vivacarseatrecall.com or call Lerado Group USA (877-546-8437) for refund.
Nania. See Team Tex America.				
Nuna Baby Essentials Inc., 70 Thousand Oaks Blvd., Morgantown, PA 19543, 855-686-2872 www.nuna.eu/USA/index				
Nuna model with no recalls, replacement parts, or warnings: Pipa				
Orbit Baby Inc., 5437 Central Avenue, Suite 10, Newark, CA 94560, 877-672-2229, www.orbitbaby.com				
Orbit Baby	Original Car Seat Base	All before 2/1/08	Original base sold with Infant Car Seat is not compatible with Toddler Car Seat.	Call or go to Web site for upgrade.
Orbit Baby	G2 Car Seat Base (ORB822000, Batch #A0840, A0860, A0880)	3/20/13 to 7/20/13	StrongArm knob may detach or spin without tightening base.	Call to order repair kit. Use seat without base until base is repaired.
Orbit Baby Inc. models with no recalls, replacements parts, or warnings: Infant/Infant G2/Infant G3, Orbit Toddler/Toddler G2/Toddler G3 (see above for information about bases)				
Peg-Perego U.S.A., 3625 Independence Dr., Fort Wayne, IN 46808, 800-671-1701, www.perego.com				
Peg Perego	Primo Viaggio SIP 30-30	7/1/07 to 3/15/08	Plastic housing on harness adjuster may have sharp edge that scratches child's feet.	Call to order replacement adjuster cover.
Peg Perego	Primo Viaggio	All models with stroller base that has front bar	Stroller use: To prevent possibility of baby's fall due to incorrect placement of seat on stroller, make sure that front bar is installed on stroller and that seat is latched firmly to stroller with two hooks. Test by yanking seat toward front of stroller.	
Peg Perego model with no recalls, replacement parts, or warnings: Performance Coupe, Primo Viaggio 4-35, Primo Viaggio SIP ES 30-30, Primo Viaggio SIP 5-70, Primo Viaggio Convertible				
Porsche Cars of North America. Contact Britax.				
Porsche models with no recalls, replacement parts, or warnings: Baby Seat, Junior Seat G1, Junior Seat Plus G2, G3.				

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
ProRider 7818 S 212th St Ste. 106, Kent, WA 98032 800-414-5560 www.prorider.com				
ProRider model with no recalls, replacement parts, or warnings: CNS Booster, ProRider Booster				
Recaro Child Safety Systems North America, 1600 Harmon Rd., Auburn Hills, MI 48326, 888-973-2276 www.recaro-cs.com				
Recaro	Como or Signo	All made before 12/18/07	Looped ends of harness may become disconnected from harness connector when child is placed in or removed from seat.	Call for kit with two rubber caps to prevent harness loops from slipping off by closing gaps.
Recaro	Como or Signo (model numbers start with 330 or 331)	11/1/07 to 2/16/09	If metal frame around harness release lever is gold, adjuster may be defective, allowing front adjuster strap to slip so harness is loose on child. If metal frame is silver, adjuster is not defective.	Check adjuster by tightening harness, then pulling on shoulder straps to see if harness loosens. Call or go to recarokids.com for instructions to test adjuster and to request replacement seat if necessary.
Recaro	Performance RIDE, all models beginning with 333.01	1/15/13 to 6/9/15	Tether may detach from car seat during crash.	Retrofit kit will be provided by Recaro. Customers may also call 1-866-628-4750 to request retrofit kit.
Recaro	ProRIDE, all models beginning with 332.01	4/9/10 to 6/9/15	Tether may detach from car seat during crash.	Retrofit kit will be provided by Recaro. Customers may also call 1-866-628-4750 to request retrofit kit.
Recaro	ProSport (model numbers start with 385)	6/16/10 to 1/31/13	Excess head excursion if restraint is installed with lower anchors and not tethered.	Call mfr. for label & revised instructions; discontinue use of lower anchors when child reaches 40 lbs.
Recaro models with no recalls, replacement parts, or warnings: Como G2, Euro, Performance Booster, Performance Coupe, Performance Crossover, Performance Sport, ProBooster, Signo G2, Start, Vivo, Vivo Lite, Young Sport, Young Style. See also Exomotion.				
Safe Traffic System Inc., 10201 Pacific Ave. Franklin Park IL 847-233-0365 , www.safetrafficsystem.com				
Safe Traffic System models with no recalls, replacement parts, or warnings: Ride Safer Travel Vests				
SafeGuard, 18881 US 31 North, P.O. Box 408, Westfield, IN 46074, 800-586-7839, www.safeguardseat.com				
SafeGuard models with no recalls, replacement parts, or warnings: SafeGuard, SafeGuard Go.				
Safety Angel/Safe Start, P.O. Box 740151, Boynton Beach, FL 33474, 561-732-1233, www.safetyangel.com				
Safety Angel model with no recall: Ride Ryte				
Safety 1st. See Dorel Juvenile Group.				
Safety Baby. See Team Tex America.				
Sammons Preston Rolyan, 1000 Remington Blvd, Bolingbrook, IL 60440, 800-323-5547, www.sammonspreston.com				
Sammons Preston Rolyan models with no recalls, replacement parts, or warnings: Tumble Forms Carrie Seats				
Simple Parenting 168 E Main St. Prospect Park NJ 07508 862-240-1755 www.happykidssmartparents.com				
Simple Parenting products with no recalls, warnings or replacement parts: Doona				
Snug Seat. Box 1739, Matthews, NC 28106, 800-336-7684, www.snugseat.com				
Snug Seat	Gorilla tether kit FW-50250-12-ZY	7/26/02 to 1/15/03	A washer is not resistant to salt spray.	Call Snug Seat for replacement washer and instructions.
Snug Seat	Traveller Plus	All through 7/23/04	The 1.5" adjuster strap may slip, allowing the harness to loosen. (Original models with 1" adjuster straps sold by Britax are not affected.)	Do not use if harness can be loosened by pulling on straps without lifting release lever. Call Britax for replacement adjuster strap with thicker weave pattern.
Snug Seat models with no recalls, replacement parts, or warnings: Hippo, Pilot, SS1000, Snug Seat Car Bed, Traveler Plus EL, Wee Go.				

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
Snuggli, 225 Byers Rd Miamisburg, OH 45342, 1-800-374-3603, www.snuggli.com				
Snuggli	All-in-One (#346xxxx)	10/2/12 to 8/26/13	May be difficult to release harness buckle, which could cause risk to child in emergency.	Call 800-490-7591 (Evenflo) or go to www.buckle.evenflo.com for replacement buckle.
Snuggli	Booster (#308xxxx)	12/13/11 to 3/3/14	See All-in-One	
Summer Infant, 1275 Park East Drive, Woonsocket, RI 02895, 800-268-6237, www.summerinfant.com				
Summer Infant models with no recalls, replacement parts, or warnings: Prodigy				
Team-Tex America (formerly Car Seat Specialty), P. O. Box 3194, Rock Hill, SC 29732, 877-912-1313				
Team Tex	Baby Ride (374099,374199)	8/31/06 to 10/23/06; 12/18/08	Belt routing label with “horizontal reference line” is incorrectly placed on child restraint.	Call for correct label and placement instructions.
Team-Tex models with no recalls, replacement parts, or warnings: Beline, Dream, Dreamway SP, HighRide				
Teutonia USA, 150 Oaklands Boulevard, Exton, PA 19341, 877-838-8664, www.teutoniausa.com				
Teutonia models with no recalls, replacement parts, or warnings: T-Tario 32, T-Tario 35				
Tomy International, 1111 W. 22nd Street, Suite 320, Oak Brook, IL 60523, 1-800-704-8697, www.tomy.com (previously Learning Curve)				
Learning Curve	Infant Car Seat I 420 (fabric codes ARD, FUO, MAR)	5/07/06 to 5/15/06	Metal slide on end of crotch strap may not be installed correctly, which could cause crack in shell during crash.	Check that slide lies flat against shell in the correct location. Call for assistance.
Tomy, Learning Curve, and Compass models with no recalls, replacement parts, or warnings: I 410, Via (all models), Compass Folding Adjustable Boosters (all models), all True Fit convertible models				
TriplePlay Products See Lilly Gold				
UPPAbaby, 60 Sharp Street, Hingham, MA 02043, 781-413-3000 www.uppababy.com				
UPPAbaby models with no recalls, replacement parts, or warnings: Mesa				
Urbini – See Aria Child				
Volvo Cars of North America, 7 Volvo Dr., Rockleigh NJ 07647 800-458-1552 www.volvocars.com				
Volvo models with no recalls, replacement parts, or warnings: Child Booster or Child Cushion and Backrest				

BMW of North America is recalling 7,162 2016 BMW 5 Series sedans to fix a problem with the child-restraint lower anchor system. The 2016 BMW 5 Series models are listed below. The affected vehicles have an inboard lower anchor for child restraints on the left rear seat that may have been bent downwards, preventing the child seat from fully engaging both lower anchors, thus, increasing a child's risk of injury in a crash. The month and year of manufacture can be found on the VIN sticker on the inside driver door panel. Caregivers installing a restraint in this seating position should use the safety belt instead, until the lower anchor is inspected/repared by BMW. This recall is expected to be announced on 12/24/15; however, owners need not wait to contact BMW.

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
BMW of North America, LLC	528i Sedan	8/15/15- 9/14/15	See paragraph above.	Owners should contact BMW Customer Service at (800)-525- 7417.
BMW of North America, LLC	528i xDrive Sedan	7/20/15- 9/11/15	See paragraph above.	Owners should contact BMW Customer Service at (800)-525- 7417.
BMW of North America, LLC	535i Sedan	7/20/15- 9/8/15	See paragraph above.	Owners should contact BMW Customer Service at (800)-525- 7417.

MFR.	MODEL NAME (MODEL #)	DATES APPLICABLE	PROBLEM	ACTION REQUIRED
BMW of North America, LLC	535i xDrive Sedan	7/20/15-9/9/15	See paragraph on preceding page.	Owners should contact BMW Customer Service at (800)-525-7417.
BMW of North America, LLC	535d xDrive Sedan	7/21/15-9/3/15	See paragraph on preceding page.	Owners should contact BMW Customer Service at (800)-525-7417.
BMW of North America, LLC	550i Sedan	7/20/15-9/3/15	See paragraph on preceding page.	Owners should contact BMW Customer Service at (800)-525-7417.
BMW of North America, LLC	550i xDrive Sedan	7/20/15-9/3/15	See paragraph on preceding page.	Owners should contact BMW Customer Service at (800)-525-7417.
BMW of North America, LLC	535d Sedan	7/20/15-9/8/15	See paragraph on preceding page.	Owners should contact BMW Customer Service at (800)-525-7417.
BMW of North America, LLC	M5 Sedan	7/21/15-9/11/15	See paragraph on preceding page.	Owners should contact BMW Customer Service at (800)-525-7417.