

Frymaster[®]

A **WELBIT** Company

Bulletin ABDE-17-98



Service Bulletin

Bulletin: ABDE-17-98

Date: 06/18/98

SUBJECT: Check for Leaks

When you repair any Frymaster fryer, including model MJ45, please take a moment to check for leaks around the probe, hi-limit, and power shower plug. Even a very small leak, over time, can eventually create a large oil or shortening buildup on the outside of the combustion chamber front. A significant buildup in this area could lead to flashing of the built-up shortening. This could cause damage to the temperature sensitive components in the control box located immediately above.

If tightening the component does not eliminate the leak, remove the component, reapply Loctite 567 pipe thread sealant, and reinstall the component.

8700 Line Avenue
ZIP 71106

P.O. Box 51000
ZIP 71135

Shreveport, LA
FAX 318-862-2394

318-865-1711
Hotline 800-551-8633

WebSite - <http://www.frymaster.com/service>
E-mail - service@frymaster.com