
Converted to White hypertion With FILE NOTATIONS Checked by Chief Entered in NID File Copy NID to Field Office Ento od On S.R. Sheet -----Approval Letter Location Map Pinned ------Disapproval Letter Card Indexed I W R for State or Fee Land -----COMPLETION BATA: Date Well Consideral 4-22-6/ Logation Inspected Water drykeeting Well OW No converted State of Fee Land GW..... OS ...... PA..... LOGS FILED Diller's Log 5-15-61 Electric Logs (No. ) E...... GR. GR-N....... Micro. L Lat...... Mi-L...... Sonic...... Othersberry at Bond \* This well une converted to a custer infection cuell as of Lanuary 1963

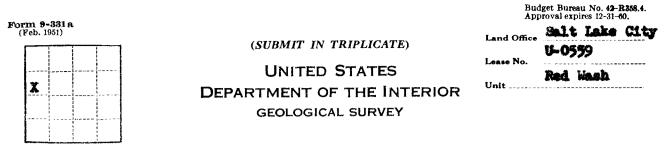

# SUNDRY NOTICES AND REPORTS ON WELLS

		February 8	1061
(INDICATE ABOVE BY CHECK MAR	KNAT	URE OF REPORT, NOTICE, OR OTHER DATA)	
NOTICE OF INTENTION TO ABANDON WELL			
NOTICE OF INTENTION TO PULL OR ALTER CASING			
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	i		
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	 	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO DRILL	X	SUBSEQUENT REPORT OF WATER SHUT-OFF	

<b>(146)</b> Vell No. <b>12-21A</b> is loca	ated <b>1980</b> ft. 1	rom. $\begin{bmatrix} N \\ S \end{bmatrix}$ line	and <b>660</b> ft. from	<b>8</b> <b>W</b> line of sec. <b>21</b>
SH 1/4 NW 1/4 21	178	R22E	SLBM	
(1/4 Sec. and Sec. No.)	(Twp.)	(Range)	(Meridian)	
Red Wash	Uinte	eh	UH	
(Field)	(Co	unty or Subdivision)	(St	ate or Territory)
Kelly The elevation of the denie	<b>Bushing</b> <b>Line</b> above se	a level is _500	0 ft. (estimated	
	DE	TAILS OF W	ORK	J •

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cemanting points, and all other important proposed work)

It is proposed to drill a well at the above location to produce oil from the lower Green River formation. Cement 10-3/4" casing at 215" Cament 7" casing below lowermost productive interval with sufficient cement to fill to 4000". Top Green River 2600" "H" Point 4910" "K" Point 5495"

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company California Oil Company, Mestern Division

Address **P. O. Box 455** 

Vermal

Utah

USGS-3, OGCCC-1, Gulf-1, Cantkins-1, LCS III-1, File-1

By C. V. irton

Title District Superintendent

		Bud App	iget Bureau No. 42-R358.4. proval expires 12-31-60.
Form 9-331a. (Feb. 1951)	(SUBMIT IN TRIPLICATE)	Land Office	Salt Lake City U-0559
X	UNITED STATES DEPARTMENT OF THE INTERIOR GEOLOGICAL SURVEY	Unit	Red Wash

# SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL. NOTICE OF INTENTION TO CHANGE PLAN NOTICE OF INTENTION TO TEST WATER NOTICE OF INTENTION TO RE-DRILL OR NOTICE OF INTENTION TO SHOOT OR AC NOTICE OF INTENTION TO PULL OR ALT NOTICE OF INTENTION TO ABANDON WE	IS SHUT-OFF REPAIR WELL IDIZE ER CASING		UBSEQUENT REPORT OF UBSEQUENT REPORT OF	SHOOTING OR AC ALTERING CASING RE-DRILLING OR ABANDONMENT	CIDIZING G REPAIR	
(INDICATE /	BOVE BY CHECK M	ARK NATURE	OF REPORT, NOTICE, O	R OTHER DATA)		
				February 8	3	. 19 <sup>61</sup>
(146) Well No. 12-21A is located	1980 ft. fr	om $\begin{bmatrix} N \\ S \end{bmatrix}$	line and660	ft. from	line of s	ec. 21
SW 1/4 NW 1/4 21 (% Sec. and Sec. No.)						
(1/4 Sec. and Sec. No.)	(Twp.)	(Range)	(Meri	dian)		
Red Wash	Uintał	ı		Utah		
(Field)	(Coun	ty or Subdiv	vision)	(State or	Territory)	
Kelly Bus The elevation of the <b>despised</b>	sning					
	DET	AILS O	F WORK			

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)


I understan	d that this plan of work must receive a	oproval in writing	by the Geological	al Survey before operations may be commenced.
Company _	California Oil Compan	y, Western	Division	
Address	<b>P. 0.</b> Box 455			An II
	Vernal		Ву	C. V. Chatterton 2/0/a/
	Utah		Title	District Superinterdent
	, O&GCC-l, Gulf-l, Caù I-l, File-l	lkins-1,		GP0 86204

Form 9-	<b>X</b>	22B							
							S. Land Off rial Number		
		┼╌┼╌┾╼				Ĺw			
				CANKON		Continued	*.		
-			I 🙀 🦾	الإيراد كالجها	U	NITED STAT	ES		1. 1
		2	<del>7</del>		DEPARTM	ENT OF THE	INTERIO	OR	
			8		GEO	LOGICAL SUR	VEY		
					•		-		
			<b></b>		2				
				LO	G OF C	OIL OR C	GAS V	VELL	4
LOC	CATE WEL	LCORRECT	LY						
Compa	ny <b>Cali</b>	fornia Oi	1 Co., We	estern M	Y. Addres	Box 455,	Vernal,	Uteh	
		•				Red Wash			
Well N	0.12-21	Sec. 21	т. <b>75</b> г	228. Mer	idian <b>Salt</b>	Lake Co	ounty UL	n tah	
Locatio	on <b>1980</b>	_ ft. (S.) of		nd <b>660</b> ft.	. {E. } of	Line of .Sec ti.	on 21	Elevat	tion <b>5029</b>
						record of the			
			l from all av	vailable rec	ords.		PA	T?:	1
					gned R.L			<i>,,,</i> ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	
		9, 1961				Title	triaion.	Superin	tendent
	i		bruary 28	<b>.</b> , 19	61 Finish	at above date. ed drilling	April 9		, 19. <b>6</b>
Comm	enced dri	lling <b>Fe</b>	bruary 28 Ol	I, 19 IL OR GA (D	<b>61</b> Finish S SANDS O Denote gas by G)	ed drilling R ZONES			
Comme No. 1,	enced dri from	5492	bruary 28 01	L, 19 IL OR GA (D	<b>61</b> Finish S SANDS O Denote gas by G) No. 43	ed drilling r zones from5546	#	<b>k</b>	
Comm( No. 1, No. 2,	enced dri f <b>rom</b>	lling <b>P</b> 54,92 5526	bruary 28 01 101 101	L, 19 IL OR GA ( <i>L</i>	<b>61</b> Finish <b>S SANDS O</b> Denote gas by G) No. 4 <sub>3</sub> No. 5,	ed drilling R ZONES from	<b>±</b>	<b>k</b>	
Comm( No. 1, No. 2,	enced dri from	lling <b>P</b> 54,92 5526	bruary 28 Ol 101 102 102	L, 19 IL OR GA ( <i>L</i>	<b>61</b> Finish <b>S SANDS O</b> Denote gas by G) No. 4 <sub>3</sub> No. 5, No. 6,	ed drilling <b>R ZONES</b> <b>from</b>	<b>±</b>	<b>k</b>	
Comm No. 1, No. 2, No. 3,	enced dri fram fram	lling <b>70</b> 5492 5526 5534	bruary 28 Ol 101 102 102	I, 19 IL OR GA (D (D (D) (D) (D) (D) (D) (D) (D) (D) (	<b>61</b> Finish S SANDS O Denote gas by G) No. 4 No. 5, No. 6, NT WATER	ed drilling <b>R ZONES</b> <b>from</b>	<b>±</b> 1 to to	<b>k</b> D	
Comm No. 1, No. 2, No. 3, No. 1,	enced dri from tann from	lling <b>70</b> 5492 5526 5534	bruary 28 01 100 100 100 100	I. OR GA (L II OR GA (L IMPORTA	<b>61</b> Finish S <b>SANDS O</b> Denote gas by G) No. 4 No. 5, No. 6, <b>NT WATER</b> No. 3,	ed drilling <b>R ZONES</b> <b>from</b>	<b>t</b> a ta ta	<b>k</b>	
Comm No. 1, No. 2, No. 3, No. 1,	enced dri from tann from	lling <b>70</b> 5492 5526 5534	bruary 28 Ol 101 102 103 103 103 103 103 103 103 103 103 103	I, 19 IL OR GA (D	<b>61</b> Finish S <b>SANDS O</b> Denote gas by G) No. 4 No. 5, No. 6, <b>NT WATER</b> No. 3,	ed drilling <b>R ZONES</b> <b>from</b>	<b>t</b> a ta ta ta	<b>k</b>	
Commo No. 1, No. 2, No. 3, No. 1, No. 2,	from from	lling	bruary 25 Ol 	I, 19 IL OR GA (D	<b>61</b> Finish S SANDS O Denote gas by G) No. 4 No. 5, No. 6, NT WATER No. 3, No. 4,	ed drilling <b>R ZONES</b> <b>from</b>	<b>i</b> i to to to to <b></b> to	<b>k</b>	
Commo No. 1, No. 2, No. 3, No. 1, No. 2, <u>Size</u> casing	from from from from weight per foot	lling	bruary 28 Ol 	IL OR GA (L) IMPORTA CAS	<b>61</b> Finish         S SANDS O         Denote gas by G         No. 4g         No. 5,         No. 6,         NT WATER         No. 3,         No. 4,         ING RECOR         Kind of shoe	ed drilling <b>R ZONES</b> from	±0 to to to <b></b> to <b></b> to <b></b> to	k	<u>et at</u>
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Size casing	from from from from from	lling	bruary 25 Ol 50x 50x 50x 10x 10 10 10 10 10 10 10 10 10 10 10 10 10	IL OR GA (D IL OR GA (D IMPORTA CAS Amount	S SANDS O         Senote gas by G         No. 4g         No. 5,         No. 6,         NT WATER         No. 3,         No. 4,         ING RECOR         Kind of shoe         L. Baken, Grad	ed drilling R ZONES from	±i to to to to to 	tehes cr	<u>at at</u>
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Size casing	from from from from from	lling	bruary 25 Ol 50x 50x 50x 10x 10 10 10 10 10 10 10 10 10 10 10 10 10	IL OR GA (D IL OR GA (D IMPORTA CAS Amount	S SANDS O         Senote gas by G         No. 4g         No. 5,         No. 6,         NT WATER         No. 3,         No. 4,         ING RECOR         Kind of shoe         L. Baken, Grad	ed drilling <b>R ZONES</b> from		tehes cr	<u>at at</u>
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Size casing	from from from from from	lling	bruary 28 Ol 55 55 55 55 55 55 55 55 55 55 55 55 55	IL OR GA (L) (L) (L) (L) (L) (L) (L) (L) (L) (L)	S SANDS O         Senote gas by G         No. 4g         No. 5,         No. 6,         NT WATER         No. 3,         No. 4,         ING RECOR         Kind of shoe         L. Baken, Grad	ed drilling R ZONES from		s of redrift s and if as of punipu of punipu <b>gas</b>	ng, togett snd num ig or bailin af sf
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Size casing	from from from from from	lling	bruary 28 Ol 55 55 55 55 55 55 55 55 55 55 55 55 55	IL OR GA (L) (L) (L) (L) (L) (L) (L) (L) (L) (L)	<b>61</b> Finish         S SANDS O         Denote gas by G         No. 4,         No. 5,         No. 6,         NT WATER         No. 3,         No. 4,         ING RECOR         Kind of shoe         Nil Biscul 198         It the well 198         Set uit Charter         No. 4,         ING RECOR         Kind of shoe         Nil Biscul 198         It the well 198         Set uit Charter         It of shoe         It the well 198         Set uit Charter         It of shoe	ed drilling R ZONES from		s covernament and if and of pusition of punipu zne zne corpute zne corpute zne zne zne zne zne zne zne zne zne zn	ng, togett snd num ig or bailin af sf
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Size casing	from from from from from	lling	Image: system         Image: system           Image: system         Image: system <t< td=""><td>IL OR GA (L) (L) (L) (L) (L) (L) (L) (L) (L) (L)</td><td>S SANDS O         Denote gas by G         No. 4,         No. 5,         No. 6,         NT WATER         No. 3,         ING RECOR         Kind of shoe         IL the Moli particular         IL the Moli particular</td><td>AS WELL R ZONES made in the casin been dynamited, g trom <b>D Citw</b> from <b>Cott and builed from</b> <b>Cott and builed trom</b> <b>Cott and builed trom <b>Cott and bui</b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></td><td></td><td>s covernament and if and of pusition of punipu zne zne corpute zne corpute zne zne zne zne zne zne zne zne zne zn</td><td>ng, togett snd num ig or bailin af sf</td></t<>	IL OR GA (L) (L) (L) (L) (L) (L) (L) (L) (L) (L)	S SANDS O         Denote gas by G         No. 4,         No. 5,         No. 6,         NT WATER         No. 3,         ING RECOR         Kind of shoe         IL the Moli particular	AS WELL R ZONES made in the casin been dynamited, g trom <b>D Citw</b> from <b>Cott and builed from</b> <b>Cott and builed trom</b> <b>Cott and builed trom <b>Cott and bui</b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b></b>		s covernament and if and of pusition of punipu zne zne corpute zne corpute zne zne zne zne zne zne zne zne zne zn	ng, togett snd num ig or bailin af sf
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Sisc casing Apole Apole Apole Sisc	from from from from from	Iling	Image: system         Image: system           Image: system         Image: system <t< td=""><td>IL OR GA (L) IL OR GA (L) IMPORTA CAS CAS Amount L) IMPORTA CAS CAS</td><td>S SANDS O         Denote gas by G         No. 4,         No. 5,         No. 6,         NT WATER         No. 3,         ING RECOR         Kind of shoe         IL the Moli particular         IL the Moli particular</td><td>AS WELL Please state in de rade in the casin peen dynamited, g the sed, position been dynamited, g the sed, position from Cont and builed from Cont and builed from Co</td><td></td><td>s covernament and if and of pusition of punipu zne zne corpution z corpution corpution corpution corpution corpution corpution corpution corpution corpution corpution corpution</td><td>eriatine office ing, loge(f y-cusing a snd num ig of bailin af st</td></t<>	IL OR GA (L) IL OR GA (L) IMPORTA CAS CAS Amount L) IMPORTA CAS CAS	S SANDS O         Denote gas by G         No. 4,         No. 5,         No. 6,         NT WATER         No. 3,         ING RECOR         Kind of shoe         IL the Moli particular	AS WELL Please state in de rade in the casin peen dynamited, g the sed, position been dynamited, g the sed, position from Cont and builed from Cont and builed from Co		s covernament and if and of pusition of punipu zne zne corpution z corpution corpution corpution corpution corpution corpution corpution corpution corpution corpution corpution	eriatine office ing, loge(f y-cusing a snd num ig of bailin af st
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Size casing Capotaz Argonaz Argonaz Argonaz Argonaz	enced dri from from from from from weight per foot	Sly92 Sly92 SS26 SS34 Threads per inch Station (pc Molg W) Station (pc Molg W) Statio	bruary 28 Ol 	IL OR GA (L) IMPORTA CAS Amount LUISA TI IPGIG MG CONDIGIC PIEL COSA OI DING ANI ement	<b>61</b> Finish <b>S</b> SANDS O         Denote gas by G         No. 4,         No. 5,         No. 6,         NT WATER         No. 3,         No. 4,         ING RECOR         Kind of shoe         11, tps Ac[] ps         12, UP SUBJECT         (12, 0), tps         (12, 0), tps         NO. 10,         Method used	ed drilling R ZONES from		uonut ol un s. covrenseer s. of redrift s. di re	Iq nseq
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Sisc casing Apole Apole Apole Sisc	from from from from from from from from	Sly92           5526           5534           Threads per Inch           Ling E.e. MCL (1 in the Mell (1	Image: Second state	ILOR GA (L) IMPORTA CAS Amount LOBX OI DING ANI ement	Kind of shoe	ed drilling R ZONES from		<pre>mount of mu mount of mu m</pre>	nd nsed
Commo No. 1, No. 2, No. 3, No. 1, No. 2, Sisc casing Apole Apole Apole Sisc	enced dri from from from from from weight per foot	Sly92           5526           5534           Threads per Inch           Ling E.e. MCL (1 in the Mell (1	Image: Second	IL OR GA (L) IL OR GA (L) IMPORTA CAS Amount L (J) IMPORTA CAS IMPORTA CAS IMPORTA CAS IMPORTA	<ul> <li>Finish</li> <li>S SANDS O</li> <li>Denote gas by G</li> <li>No. 4,</li> <li>No. 5,</li> <li>No. 6,</li> <li>NT WATER</li> <li>No. 3,</li> <li>No. 4,</li> <li>ING RECOR</li> <li>Kind of shoe</li> <li>Hispiten, G</li> <li>Hispiten, G</li></ul>	ed drilling R ZONES from		<pre>x</pre>	Ind rased

• .

ţ.

Adaptere	Material			Size				
Adapters-Material			SHO	DOTING R	ECORD			
Size	Shell used	Explos	ive used	Quantity	Date	Depth shot	Depth clea	ned out
		-						
	·····			1				
			• f	TOOLS US	SED feet	and from	feet to	) feet
Rotary too	ls were used f	from	<b>[ace</b> 166	et to - <b></b>	foot	and from	feet to	feet
Cable tools	were used fro	om	fee	et to	Lecu,	and from		a tea an tea tea tea
i n			ele ele orgónite Na	Pi	, it to prod	ucing	zi] 22	
			J		harrals of	t fluid of which	12 80PD	s oil;%
The p	roduction for	• the first 2	4 hours we	18 <b>JUP</b>	Darrers of	Gravity, °Bé	25.5	
emulsion; <sup>2</sup>	9 26 44C	; and	% sediment	<b>t.</b>		Gravity, De		
If gas	well, cu. ft.	per 24 hour	S	Ga	llons gaso	oline per 1,000 c	u. 10. 01 gas	
Rock	pressure, lbs.	. per sq. in	•					
	1			EMPLOY	EES			, Drille
			, Drill	er	-			Drille
			, Drill	er				,
			FO	RMATION	RECORI			
FROM		ro	TOTAL I	FEET		FORMA		
						and sand		
(	0 2800	)	2800					
280	0 570	4	2904		Sand as	nd shale		
		-						
/								
								Stor Alex
						FORA	ATION	
т. нё с	M	<b>TO</b>		P REET	RDI			18-48094-
EBU								
E.B.C.		1	FORMAT	TION RE	CORD-	-Continued		

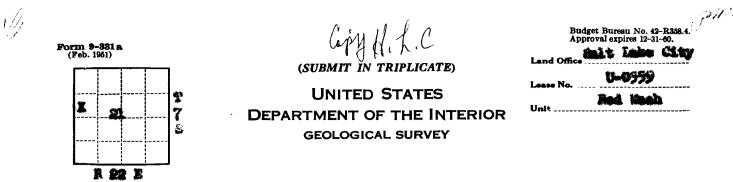

# SUNDRY NOTICES AND REPORTS ON WELLS

<b>(12-21</b> A)		Ve	real, Utab	August 16	, 19 <b></b>
	(INDICATE ABOVE BY CHEC)	K MARK NATU	IRE OF REPORT, NOTICE, OR O	THER DATA)	
	PULL OR ALTER CASING         ABANDON WELL		SUPPLEMENTARY WELL HIST		
	SHOOT OR ACIDIZE	1 <b>1</b>	SUBSEQUENT REPORT OF A	-	
	RE-DRILL OR REPAIR WELL.		SUBSEQUENT REPORT OF RE		
	) CHANGE PLANS	l l	SUBSEQUENT REPORT OF SH SUBSEQUENT REPORT OF AL		
			SUBSEQUENT REPORT OF W	ALER SHUT-OFF	

The elevation of the **descriptions** above sea level is \_\_\_\_\_\_ ft.

#### DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

### It is proposed to convert subject well to vater injection as follows:


- 1. Am redicactive tracer interface curvey.
- 2. Block squeeze as warrented with incor cement.
- 3. Perforate intervals 5952-5566, 5546-5549, 5532-5536, 5522-5527 and 5490-5494' with 2 jets per foot.
- 4. Addies above perforations.
- 5. Non injection string.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Compa	ny 🧰	Liforni	ه ملا ه		, vestera	Division	Original S R. W. PA	igned by
Addres	s <b>P.</b>	G. Box	455				<u>к</u> , уу, ра	TERSOIR
		mal, O	<b></b>			Ву	R. W. PATTER	
						Title	Field Augeriate	
Vaue,	وز مکلا.	Quart,	SLC-1,	Gulf,	Deswer-1	, Coulkins-1;	RLG-1; File-1	GP0 862040



Budget Bureau No. 42-R358.4.

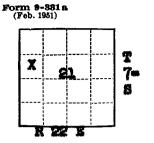

1.

(SUBMIT IN TRIPLICATE)

# UNITED STATES DEPARTMENT OF THE INTERIOR GEOLOGICAL SURVEY

Land Offic		112	1810	<u>C14</u>
Lease No.		1-0	559	
1-1+	Red	Viel	nia.	

# SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO CHANGE PLANS.       SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.         NOTICE OF INTENTION TO TEST WATER SHUT-OFF.       SUBSEQUENT REPORT OF ALTERING CASING.         NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.       SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.		to Water Injection
NOTICE OF INTENTION TO CHANGE PLANS       SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING         NOTICE OF INTENTION TO TEST WATER SHUT-OFF       SUBSEQUENT REPORT OF ALTERING CASING         NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL       SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR         NOTICE OF INTENTION TO SHOOT OR ACIDIZE       SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR         NOTICE OF INTENTION TO SHOOT OR ACIDIZE       SUBSEQUENT REPORT OF ABANDONMENT	TICE OF INTENTION TO ABANDON WELL	
NOTICE OF INTENTION TO CHANGE PLANS	TICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO CHANGE PLANS	TICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO CHANGE PLANS SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	TICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
	TICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO DRILL	TICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
	TICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

				Verne	1, Utah	Novent	er 20	1963
Well No.	(12-21A) 146	is located	<b>.980</b> ft. fr	om_ $\left\{ \begin{matrix} \mathbf{N} \\ \mathbf{S} \end{matrix} \right\}$ line a	nd <b>660</b>	ft. from ${\mathbf{W} \atop {\mathbf{W}}}$ lin	e of sec.	<b>EI</b>
	HW 3/4		78	228	SLE	M		
	Sec. and Sec. No <b>d. Wash</b>	).)	(Twp.) Uinte	(Range) <b>h</b>	(Merid	ian) Utah		
The eleva		lly Bushir Astrickita	<b>us</b> bove sea	ity or Subdivision) level is		(State or Terri		
(State names	of and expect	ed depths to obje	ctive sands; show	sizes, weights, and all other important	lengths of prop	osed casings; indicate	mudding job	s, cement-
549 4. Set 5. Raa	2 (J <sub>p</sub> ). Bakër M injecti	odel "F" j on tubing	packers at and start	5556, 5510 ed injectir	, 5480'. g water e	(34, 5525' (1 14 2400 BPD (		) the pei
	and that this ;	plan of work mus	t receive approva		Geological Surve	y before operations m	nay be comme	enced.
Company		OCILIE VIA	outpany;	Western Div		• / m 1 t		
Address .	P. 0.	Box 455			-	ginti Signed by W. PATTERSON		
	Yeru	1, Utah			By R.	V. PATTEREO	f	
					Title Unit	. Aperinten	Lent.	

PROPERTY: Section 21A

#### HISTORY OF OIL OR GAS WELL

Kerr-McGee Oil Industries, Inc. moved in and rigged up. Spudded at 6:00 P.M., February 28, 1961. Drilled 15" hole surface to 210'.

March 1, 1961 Cemented 10-3/4" casing at 205' with 170 sax common cement. Drilled 9" hole 210' to 980'.

March 2, 1961 to March 16, 1961 Drilled 9" hole 980' to 5639'.

March 17, 1961

Drilled 9" hole 5639' to 5704'.

Ran Schlumberger Induction ES and recorded from 5701' to 205'. Microcaliper and recorded from 5706' to 2000'. TGR 2800', H 4930', I 5103', J 5378', JE 5483', K 5519' (-490'), KA 5556', KB 5616', KD 5698'.

	o runs with	SIGGURIT Rembte Rute
Depth	Rec.	Description
57051	1/2"	Ss, lt gry, al s & p, v fn-fn gr, rnded, fri, good por & perm, NSOFC.
5701.	3/4"	SAA, w/some wh clay, cem, fri, poor por & perm, NSOFC.
5678 1	3/4 <sup>n</sup>	Ss, lt gry, v fn gr, silty, much wh clay, cem, tight, NSOFC.
56731	1-1/2"	Ss, it gry, fn gr, subraded, mod fri, mottled w/wh clay cem, mod tight, mottled dull bra fluor & dk bra dead oil sta, slow it blue streaming cut.
56631	None	
56651	3/4"	Ss, wh, lt gry, v fn gr, subraded, much wh clay cem, tight, NSOFC.
5548 •	1/2"	Ss, clr qtz, fn gr, ang, mod hard, much blk hydrocarbon (?) residue, dull brn fluor, stream 1t blue-yell cut, slow to fast cut.

5546: 1" Ss, dk gry, v fn gr, silty, subrnded, mod hard, well cem, mod tight, dk brn oil stn, dull brn fluor, stream it blueyell cut.

5535: 1" Ss, lt gry, v fn gr, subrnded, mod fri, fair por & perm, even dk brn oil stn, even golden fluor, stream lt blue-wh cut. 5532: 1/2" SAA.

5525' None 5523: 1-1/2" Ss, lt gry, v fn gr, subrnded, mod fri, much wh clay cem, mottled w/wh clayey shale, even dk brn oil stn & gold fluor on Ss, stream 1t blue-yell cut. 5521' 3/4" SAA, mostly sh as above.

5506: 3/4" Ss, lt gry, v fn gr, subrnded, mod fri, much wh clay cem, mod tight, highly mottled w/wh clayey shale, even lt brn oil stn & even gold fluor on Ss, stream lt blue-wh cut.

Page 2

WELL NO: 12-21A (146) PROPERTY: Section 21A RED WASH FIELD Depth Rec. Description 54931 None 54901 1/2" Ss as above, few thin lam sh as above, even gold fluor, even It brn oil stn, stream It blue-wh cut. 53851 1/4" Ss, 1t gry, fn gr, ang, mod hard, fair por & pern, some weak (flushed?) It brn oil stn & It orange-gold fluor, wk slow It yell stream cut. 3/4" 53071 Ss, 1t gry, fn gr, subrnded, ostracodal, hard, tight, much wh clay cem, NSOFC. 52731 None March 18, 1961 DST #1 interval 5522-5549'. Set packers at 5517, 5522 and 5549'. Opened tool at 2:05 A.M. for 2 min initial flow, 45 min ICIP, 1 hr flow test and 1 hr FCIP. No gas to surface. Had a light, slightly heading blow of air at an est rate of 1 to 2 M/D. Recovered 152'. Top 50' oil, bottom 102' gassy, slightly oily (5birm midt (DOF

TOP) CUTU MOO	0					
Pressures	IH	ICIP	IF	FF	FCIP	FH
Тор	2846	1428	30	76	1087	2846

DST #2 interval 5659-5667'. Set packers at 5654, 5659 and 5667'. Opened tool at 7:13 P.M. for 2 min initial flow test, 45 min ICIP, 1 hr flow test and 45 min FCIP. No gas to surface. Had a light blow of air est 2-3 M/D, steadily declining to est less than 1/2 4/D rate at end of 1 hr test. Rec 110', top 20' gassy mud with a scum of oil, bottom 90' thin mud grading to muddy water with flecks oil. TO TO TPUI \*\*\*\* TATE 1 10 1.16

LLABSULAR	70	TOTL		1° 1°	FOIL	F 11
Bottom	2913	2338	30	70	2236	2913

#### March 19, 1961

Top

2609

2238

DST #3 interval 5486-5510'. Set packers at 5481', 5486' and 5510'. Opened tool at 2:30 A.H. for 2 min initial flow, 45 min ICIP, 1 hr flow test and 45 min FCIP. No gas to surface. Had a light blow est 3-4 4/D rate, declining to almost dead in 1 hr. Rec 60' slightly gasay mud. FCIP FH Pressures ICIP IF FF IH 521 2720 630 15 20 2720 Top

DST #4A interval 5262-5704'. Set packers at 5257, 5262 and 5286'. Opened tool at 9:20 A.M. for 2 min initial flow, 45 min ICIP, 2 hr flow test and 45 min FCIP. No gas to surface. Had a steadily increasing blow of air to a max rate of 1.8 H/D in 35 min. Next 35 min had a steadily decreasing, slightly heading blow of air to a rate too small to measure. Last 50 min of test had a barely perceptible heading blow of air. Rec 4590' rise. Top 1500' slightly gassy mid, bottom 3090' gassy thin salt water contaminated mud grading to gassy, fluffy, muddy water. FH FCIP FF IH ICIP IF Pressures 2609 2000 2203 275

DST #4 interval 5262-5301'. 2 hrs NGTS. Rec 640', top 455' gassy mud, bottom 185' gassy muddy water testing 0.3 ohmmeters at 85° F.

PROPERTY: Section 21A

RED WASH FIELD

March 20, 1961 DST #5 interval 5262-5301'. Set packers at 5257, 5262 and 5301'. Opened tool at 11:37 P.M. (3-19-61) for 3 min initial flow, 45 min ICIP, 2 hr flow test, 45 min FCIP. No gas to surface. Had a weak steady blow of air for 2 hr test. Rec 640'. Top 455' fluffy gas cut mud w/occasional fleck of oil, bottom 185' gassy salt water. FCIP FH IF FF IH ICIP Pressures 2720 73 2004 2720 2210 39 Top Cemented 7", 23#, J=55 casing at 5704' with 400 sacks API Class A cement. March 21, 1961 Ran Schlumberger gamma collar log from 5658-4000". Schlumberger pick-up 5661'. Ran Schl cement bond log 5658-3000'. Good to excellent bond, top cement 4000°. Hung 2-1/2" tubing in annulus frac spool above BOPE, tog collar on bottom. 178 jts 2-1/2" UE 6.5# tubing landed at 5632.49". Rig released 11:00 P.M., March 21, 1961. April 6, 1961 R&R Well Service moved on location and rigged up. April 7, 1961 Spotted 400 gallons inhibited Hcl and Hf acid at 5507".

McGullough shot triple frac notch cutter at 5546, 5534, 5526'. Attoupted to break down notches with up to 3500 psi, no success. Shot triple frac notch cutter at 5492°.

April 8, 1961

Ran Baker retrievable bridge plug and Retrieve-A-Matic full bore packer on 2-1/2" tubing. Set BP at 5570", FB packer at 5540". Spotted 200 gals acid at tool, attempted to break down notch 5546" with up to 6000 psi, no success. Pulled FB packer to 5510", attempted to break down notches 5546, 5534, 5526" with no success to 5500 psi. Spotted 400 gallons acid. Broke down notches above at 5000 psi to 600 psi. Pumped in at 2200 psi and 5 BPM. Inst. shut in 600 psi.

Set full bore at 5400', bridge plug at 5510'. Spotted 200 gals acid. Pressure tested BP to 3500 psi, held OK. Broke down notch at 5492' w/5000 psi to 3500 psi at 6.5 BPM. Inst. shut in 1100 psi.

Pulled B.P. and full bore out of hole.

Sand-oil frac'd perf'd intervals 5492-5546' with 24,000 gallons BF #5, 24,000# 20-40 sand, 1200# 12-16 aluminum pellets and 1200#Adomite. Pumped in 4000 gals BF and Adomite pad, 8000 gallons BF with 2#/gal sand, 4000 gallons with 0.3#/ gal aluminum. Max pressure 3200 psi at 23 BPM start, declining to 2300 psi at 36 BPM end of flush. Flushed with 216 bbls lease waste water. Inst. shut in 1000 psi, average rate 30-1/2 BPM. Used two HT 400's (2000 hyd HP) and one 85 BPM blender. Total pumping time 26 mins. WELL NO: 12-21A (146)

 $\boldsymbol{\omega}$ 

PROPERTY: Section 21A

RED WASH FIELD

April 9, 1961 Ran tubing. Tubing detail: 1 - 2-1/2" perf. G. A. 1 - 2-1/2" sub J-55 1 PSN 174 jte 2-1/2" J-55 K.B.D.

31.35 8.06 0.95 5506.42 12.50 5559.28

Ran rods and pump. Rod detail: 1 pump top-3-cup No. 134 64 x 3/4" x 25' Plain 69 x 3/4" x 25' W.H. 86 x 7/8" x 25' W.H. 1 - 2' x 7/8" sub. Plain 1 - 22' P.R. - 1-1/2"

	Form 9-331 // (May 1963) DEPART	NITED STATES NT OF THE INTE	SUBMIT IN TETELIC (Other inscrut) is RIOR verse side)	on re-l-	Form approved. Budget Bureau No. 42-Rates. LEASE DESIGNATION AND SEBIAL 50.
L		OLOGICAL SURVEY	$\checkmark$		U-0559
	in the sheet from the menous	LES AND REPORTS	ig back to a different reservoir.		5. IF INDIAN, ALLOTTEE OR TEIBE NAME
•			SALY Lot. Chin,	UTAN 7	. UNIT AGREEMENT NAME
•	WELL WELL OTHER W	ater Injection			Red Wash
	2. NAME OF OPERATOR Chevron Oil Company - Wes	tern Division	·		Unit
	3. ADDRESS OF OPERATOR				. WELL NO.
:	P. O. Box 599 Denve	r, Colorado 8020	1		146 (12-21A) 0. FIELD AND POOL, OB WILDCAT
•	4. LOCATION OF WELL (Report location clessee also space 17 below.)	arly and in accordance with a	any State requirements.*		Red Wash
	At surface	•			1. SEC., T., R., M., OR BLE. AND
	1980' FNL & 660' FWL	· · ·			SURVEY OR AREA
					5 21, T7S, R22E, SLBM
·	14. PERMIT NO.	15. ELEVATIONS (Show whethe		'	12. COUNTY OF PARISH 13. STATE
		KB 502	9'	!	<u>Uintah   Utah</u>
	16. Check Apr	propriate Box To Indicate	e Nature of Notice, Repor	t, or Oth	ner Data
	NOTICE OF INTENT	ION TO:		Ubsequen	T REPORT OF:
	TEST WATER SEUT-OFF	JLL OR ALTER CASING	WATER SHUT-OFP		REPAIRING WELL
		ULTIPLE COMPLETE	FRACTURE TREATMEN	r	ALTERING CASING
	SHOOT OR ACIDIZE	BANDON*	BHOOTING ON ACIDIZI	NG	ction Profile X
		HANGE PLANS	(NOTE · Report	results of	multiple completion on Well
	(Other) Alter Injection 17. DESCRIBE PROFOSED OF COMPLETED OFER		Completion or I	dates in	cluding estimated date of starting an
	17. DESCRIBE PROPOSED OR COMPLETED OPEN proposed work, If well is direction nent to this work.) *	ally drilled, give subsurface	locations and measured and true	vertical	depths for all markers and zones perti
	The following work has be	en completed.			
	1. Milled Model F pkr @		556'.		· · · · · · · · · · · · · · · · · · ·
	2. Cleaned out to PBTD @				
	<ol> <li>Set Baker CIBP @ 5560</li> <li>Perforated the follow</li> </ol>	ving intervals w/?	iets/ft: 5537-31'	. 5526	-18': 5495-86': and
	5397-80'.	ing meer varo w/-		,	
	5. Broke down the follow	ving intervals:	•		
	Interval	Rate	Press IS		
	5518-37	5 BPM	2500 120		
	5486-95	5 BPM 6 BPM	27002002200100		
•	5380-97 6. Pressure tested CIBP				· · · · · · · · · · · · · · · · · · ·
÷	7. Land tbg @ 5433' w/Lo	okset pkr @ 5431'.			
	-				· · · · · · · · · · · · · · · · · · ·
•	Injection Prior to Workow	ver: 865 BPD @		1	· · · · · · · · · · · · · · · · · · ·
•	Injection After Workover		1150 (tbg) 1100 (csg)	•	
		JIU BWED (	- 1100 (C3B)		가는 작품은 전자가 해당한 문자들이다. 이 이 제공에 유민이 모양 물건이 있는
	Work Started 8-2	5-73			
		5-73			
			•		이 이 전 전 가슴 것 같다. 한 가슴 밥이 같이 물건이 있는 것 같은 것 같은 것 같아.
	18. I hereby certify that the foregoing is	true and correct	J. W. GREER		
	Uriginal Sign	ed by	Distaton Data Sun	t.	DATE 10-16-73
	SIGNED J. W. GREE	K			4070
	(This space for Federal or State offic ACCEPTED WOR	e use)	STRUCT ENGINEER		OCT 1 9 19/3
	JAPPANER RY CLL VC	TITLE .	CUTCHENT BOTHER BUILD		_ DATE
	CONDITIONS OF APPROVAL, IF A	<b>NT :</b>			· · · · · · · · · · · · · · · · · · ·
	•	•			۰ •

. :

.

1.1

\*See Instructions on Reverse Side

. .

Form 9-331 (May 1963)	W- UN	ITED STATES		SUBMIT IN TRIPLICA (Other instructions on verse side)	TE•	Form approve Budget Bureau	<u>u No. 42–R</u>
×		LOGICAL SURV		verse side)		SE DESIGNATION .	AND SERIAL
						+-0559 NDIAN, ALLOTTEE	OR TEIBE N
		to drill or to deepen of N FOR PERMIT-" for		WELLS to a different reservoir. als.)			
1.					7. UNP	T AGREEMENT NAS	ME -
OIL GAS WELL	OTHER	Water Inj	ection			Red Wash	
2. NAME OF OPERATOR	A T				S. FAR	M OR LEASE NAM	E
Chevron U.S. 3. ADDRESS OF OPERATOR	A. Inc.				9. WEL	L NO.	
P. O. Box 59	99. Denver.	Colorado 80	201		1	46 (12-21	A)
4. LOCATION OF WELL (Re See also space 17 below	port location clearly	y and in accordance w	with any State	e requirements.*		LD AND POOL, OR	
At surface						Red Wash	
1980' FNL &	660' (SW/4	NW/4)			11. SE	C., T., R., M., OR B Survey or Area	LK. AND
					s	521, T7S,	R22E SL
14. PERMIT NO.	15	. ELEVATIONS (Show w	hether DF, RT, G	ir, etc.)		UNTY OR PARISH	
		KB 5029			Uir	ntah	UTAH
16.	Check Appro	priate Box To Indi	icate Natur	e of Notice, Report, o	or Other D	ata	
NO	TICE OF INTENTION	-	····· · · ·		SEQUENT REP		
		OR ALTER CASING		WATER SHUT-OFF		REPAIRING W	
TEST WATER SHUT-O <b>ff</b> Fracture treat	[ <b></b> ]	IPLE COMPLETE		FRACTURE TREATMENT		ALTERING CA	
SHOOT OR ACIDIZE	X ABANI			SHOOTING OR ACIDIZING		ABANDONMEN	T.
REPAIR WELL	CHAN	GE PLANS		(Other)		-	
(Other)				(Note: Report real Completion or Rec	ompletion Re	port and Log for	m.)
It is proposed squeeze if nece 1. MIR & RU	well is directionally to clean ou essary, acid J POOH with	drilled, give subsurf it well to 5, lize well and tubing stron	ace locations 560', pr replace g and pa		ing for ows:	leaks and	and zones
It is proposed squeeze if nece 1. MIR & RU 2. GIH with 3. GIH w/RE and ceme 4. Move RBE 5. Acidize. 6. POOH w/F 7. RIH w/PI 8. Place A	well is directionally to clean ou essary, acid I POOH with bit, casin BP and Packer and Packer See attac BP and Packer See attac BP and Packer Lastic lined PROVED BC	drilled, give subsurf it well to 5, lize well and tubing stron ig scraper, we r. Set above if necessar to straddle hed. er tubing and tubing and	ace locations 560', pr replace g and pa ork stri e top pe y. interva packer. VOF	and measured and true ve essure test cas tubing as foll cker. ng and clean ou rferations. Pre ls 5380 - 5548' Set packer abo 3 - USGS 2 - State 3 - Partners	ing for ows: t to 5,5 ssure te	ieaks and 660 POOH. est casing D/V/s Sas	D D D D D D D D D D D D D D D D D D D
It is proposed squeeze if nece 1. MIR & RU 2. GIH with 3. GIH w/RE and ceme 4. Move RBE 5. Acidize. 6. POOH w/F 7. RIH w/PI 8. Place A DA BY No addit	well is directionally to clean ou essary, acid POOH with bit, casin P and Packer and Packer See attac BP and Packer See attac BP and Packer BP and Packer CBP CAS, AND	drilled, give subsurf at well to 5, lize well and tubing stron ag scraper, we ar. Set above if necessar; to straddle ched. ar tubing and <b>THE DIVISION</b> D MINING C	ace locations 560', pr replace g and pa ork stri e top pe y. interva packer. 4 OF 27	and measured and true ve essure test cas tubing as foll cker. ng and clean ou rferations. Pre ls 5380 - 5548' Set packer abo 3 - USGS 2 - State 3 - Partners 1 - JCB N. additional su disturbances req	<pre>trical depths ing for ows: t to 5,5 ssure te . ve 5,360 1 - DLD 1 - Sec 1 - Fil rface uired</pre>	ieaks and 660 POOH. est casing D/V/s Sas	DI III RECEIVE
It is proposed squeeze if nece 1. MIR & RU 2. GIH with 3. GIH w/RE and ceme 4. Move RBE 5. Acidize. 6. POOH w/F 7. RIH w/PI 8. Place A DA BY No addit	well is directionally to clean ou essary, acid POOH with bit, casin P and Packer and Packer See attac BP and Packer See attac BP and Packer BP and Packer CBP and CBP and CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP CBP	drilled, give subsurfat at well to 5, lize well and tubing stron ag scraper, we ar. Set above if necessary to straddle thed. ar tubing and <b>THE DIVISION</b> D MINING C S S S S S S S S S S S S S S S S S S S	ace locations 560', pr replace g and pa ork stri e top pe y. interva packer. OF 27 	and measured and true ve essure test cas tubing as foll cker. ng and clean ou rferations. Pre ls 5380 - 5548' Set packer abo 3 - USGS 2 - State 3 - Partners 1 - JCB N. additional su disturbances req for this setivit	<pre>rtical depths ing for ows: t to 5,5 ssure te . ve 5,360 l - DLD l - Sec l - Fil rface uired</pre>	leaks and 660 POOH. est casing 0/V/s e4s	and zones cement
It is proposed squeeze if nece 1. MIR & RU 2. GIH with 3. GIH w/RE and ceme 4. Move RBF 5. Acidize. 6. POOH w/F 7. RIH w/PI 8. Place Ad DA BY No addit required 18. I hereby certify that to SIGNED	well is directionally to clean ou essary, acid POOH with bit, casin BP and Packer and Packer See attac BP and Packer See attac BP and Packer See attac BP and Packer CBP and Packer See attac BP and Packer See attac CBP and Packer See attac BP and Packer See attac See attac BP and Packer See attac See attac BP and Packer See attac See att	drilled, give subsurf at well to 5, lize well and tubing stron ag scraper, we ar. Set above if necessar to straddle thed. ar tubing and <b>THE DIVISION</b> D MINING C and tubing and tubing a	ace locations 560', pr replace g and pa ork stri e top pe y. interva packer. OF 27 	and measured and true ve essure test cas tubing as foll cker. ng and clean ou rferations. Pre ls 5380 - 5548' Set packer abo 3 - USGS 2 - State 3 - Partners 1 - JCB N. additional su disturbances req	<pre>rtical depths ing for ows: t to 5,5 ssure te . ve 5,360 l - DLD l - Sec l - Fil rface uired</pre>	ieaks and 660 POOH. est casing D/V/s Sas	and zones cement
It is proposed squeeze if nece 1. MIR & RU 2. GIH with 3. GIH w/RE and ceme 4. Move RBE 5. Acidize. 6. POOH w/F 7. RIH w/PI 8. Place Ad 01 DA BY No addit required 18. I hereby certify that to SIGNED	well is directionally to clean ou essary, acid POOH with bit, casin BP and Packer and Packer See attac BP and Packer See attac BP and Packer See attac BP and Packer CBP and Packer See attac BP and Packer See attac CBP and Packer See attac BP and Packer See attac See attac BP and Packer See attac See attac BP and Packer See attac See att	drilled, give subsurfat at well to 5, lize well and tubing stron ag scraper, we ar. Set above if necessary to straddle thed. are tubing and <b>THE DIVISION</b> D MINING C	ace locations 560', pr replace g and pa ork stri e top pe y. interva packer. Y OF ??? ces	and measured and true ve essure test cas tubing as foll cker. ng and clean ou rferations. Pre ls 5380 - 5548' Set packer abo 3 - USGS 2 - State 3 - Partners 1 - JCB N. additional su disturbances req for this setivit	<pre>t to 5,5 ssure te . ve 5,360 1 - DLD 1 - Sec 1 - Fil rface juired</pre>	60 POOH. St casing <i>Divis</i> <i>Convision</i> <i>Divis</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Convision</i> <i>Conv</i>	and zones cement
It is proposed squeeze if nece 1. MIR & RU 2. GIH with 3. GIH w/RE and ceme 4. Move RBF 5. Acidize. 6. POOH w/F 7. RIH w/PI 8. Place Ad DA BY No addit required 18. I hereby certify that to SIGNED	well is directionally to clean ou essary, acid POOH with bit, casin P and Packer and Packer See attac BP and Packer See attac See attac	drilled, give subsurfat at well to 5, lize well and tubing stron ag scraper, we ar. Set above if necessary to straddle thed. er tubing and <b>THE DIVISION</b> D MINING 	ace locations 560', pr replace g and pa ork stri e top pe y. interva packer. Y OF ??? ces	and measured and true ve essure test cas tubing as foll cker. ng and clean ou rferations. Pre ls 5380 - 5548' Set packer abo 3 - USGS 2 - State 3 - Partners 1 - JCB N. additional su disturbances req for this setivit	<pre>t to 5,5 ssure te . ve 5,360 1 - DLD 1 - Sec 1 - Fil rface juired</pre>	leaks and 660 POOH. est casing 0/V/s e4s	and zones cement

WELL	NAME :	RWU #146	(12-21A)	

Red Wash

ł

FIELD:

### PROPOSED TREATMENT PROCEDURE

é it

- 1. Objective: Increase injection rate.
- 2. Size and type of treatment: 2,200 gallons 15% HCL
- 3. Intervals to be treated: 5,547-48, 5531-37, 5518-26, 5486-95, 5380-97
- 4. Treatment down casing or tubing: work string
- 5. Method of localizing its effects: Straddle perfs. with retrievable Bridge Plug and Packer.
- 6. Disposal of treating fluid: Spent acid to be swabbed back.
- 7. Name of company to do work: Dowell, Halliburton or Western

8. Anticipated additional surface disturbances: None

9. Estimated work date: December 1, 1977

10. Present status, current production and producing interval: Injecting

Date	BOPD	MCFD	BWPD

10/77

204 Down Tubing 22 Down Casing - Tubing Annulus

or <b>m 9-331</b> May 1963)					
aug 1000;		NITED STATES	SUBMIT IN TRIPLICA	TE• For re- Bud	m approved. get Bureau No. 42-R142
		NT OF THE INTER	IOR verse side)	D. LEANS DES	AUGNATION AND SEBIAL NO.
		DLOGICAL SURVEY			ALLOTTEE OR TRIBE NAME
SU	NDRY NOTICI	ES AND REPORTS	ON WELLS		
(Do not use th	Use "APPLICATIO	to drill or to deepen or plug ON FOR PERMIT-" for such p	proposals PLO		<u>_</u>
			IN THE INE	7. UNIT AGE	SMENT NAME
OIL GAS WELL	, C OTESR	Water Injection	JUN 26 1978	Red W	
NAME OF OPERATOR			DIVISION	B. FAEM OF	
	ron U.S.A. Ir	.C.	GAS & MINING	7 9. WELL NO.	
ADDRESS OF OPERAT		aa 00001	VOL A	146 6	
P. O	Box 599, De (Report location clear	enver, CO 80201 by and in accordance with any	Staterongirements		D POOL, OR WILDCAT
See also space 17 b At surface	pelow.)		0/18/12	Red W	ash
1980	' FNL & 660'	(SWZ NWZ)		11. SBC., T., SULVE	B., M., OR BLK. AND T or Arra
					<b></b>
4. PERMIT NO.		15. BLEVATIONS (Show whether D	F, RT, GR, etc.)	12. COUNTY	TTS, R22E, SI
		КВ 5029		Uintah	UT
B.			Nature of Notice, Report,		
).		-		BANQUENT REPORT O	<b>#</b> ;
	<b></b>	<b></b>	WATER SHUT-OFF		BPAIRING WBLL
THAT WATER ANUT	· · · · · · · · · · · · · · · · · · ·	L OR ALTER CASING	FRACTURE TREATMENT		LTBRING CARING
FRACTURE TREAT		NDON*	SHOOTING OR ACIDISING	X	RANDONMBNT*
REPAIR WELL		NOB PLANS	(Other)		
(Other)	<u> </u>		Completion or Me	multa of multiple completion Report a	nd the form?
Well was 1. MIR & 2. GIH w 3. GIH w	cleaned out a RU. POOH w	and acidized as fo th tubing string Ing scraper, work ter. Set above to		ut to 5560'.	POOH.
17			•		
4. Move 5. Acidi	ed for cement RBP and packe Lze. See atta	er to straddle int ached.	ervals 5380-5548'.		
4. Move 5. Acidi	ed for cement RBP and pack lze. See atta w/RBP and pack	er to straddle int ached. cker.	ervals 5380-5548'.	52601	
4. Move 5. Acidi 6. POOH 7. RIH w	ed for cement RBP and packo lze. See atta w/RBP and packo y/plastic line	er to straddle int ached. cker. ed tubing and pack		ove 5360'.	
4. Move 5. Acidi 6. POOH 7. RIH w	ed for cement RBP and packo lze. See atta w/RBP and packo y/plastic line	er to straddle int ached. cker.	ervals 5380-5548'.	ove 5360'.	
4. Move 5. Acidi 6. POOH 7. RIH w	ed for cement RBP and packo lze. See atta w/RBP and packo y/plastic line	er to straddle int ached. cker. ed tubing and pack	ervals 5380-5548'.	ove 5360'.	3-USGS
4. Move 5. Acidi 6. POOH 7. RIH w	ed for cement RBP and packo lze. See atta w/RBP and packo y/plastic line	er to straddle int ached. cker. ed tubing and pack	ervals 5380-5548'.	ove 5360'.	2-State
4. Move 5. Acidi 6. POOH 7. RIH w	ed for cement RBP and packo lze. See atta w/RBP and packo y/plastic line	er to straddle int ached. cker. ed tubing and pack	ervals 5380-5548'.	ove 5360'.	2-State 3-Partners
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place	eed for cemen RBP and pack lze. See atta w/RBP and pack y/plastic line well on injo	er to straddle int ached. cker. ed tubing and pack action service.	ervals 5380-5548'.	ove 5360'.	2-State 3-Partners 1-JCB
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place	ed for cement RBP and packed lze. See atta w/RBP and pack y/plastic line well on inje	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'.	ove 5360'.	2-State 3-Partners 1-JCB 1-DLD
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi	ed for cement RBP and packo lze. See atta w/RBP and packo /plastic line well on injo itional surfac bances require	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'.	ove 5360'.	2-State 3-Partners 1-JCB 1-DLD 1-Sec 723
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No add	ed for cement RBP and packed lze. See atta w/RBP and pack y/plastic line well on inje	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'.	ove 5360'.	2-State 3-Partners 1-JCB 1-DLD
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for th	ed for cement RBP and packa lze. See atta w/RBP and packa /plastic line well on inje itional surfact bances require is activity.	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'.	ove 5360'.	2-State 3-Partners 1-JCB 1-DLD 1-Sec 723
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for th	ed for cement RBP and packo lze. See atta w/RBP and packo s/plastic line well on injo itional surfact bances require is activity.	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'. er. Set packer abo J. J. Johnson		2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for th	ed for cement RBP and packa lze. See atta w/RBP and packa /plastic line well on inje itional surfact bances require is activity.	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'.		2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No add distur for the signed cortery and signed cortery and signed cortery and signed and signed cortery and signed and signed cortery and signed and signed cortery and signed and signed and signed cortery and signed and	ed for cement RBP and packo lze. See atta w/RBP and packo s/plastic line well on injo itional surfact bances require is activity.	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'. er. Set packer abo J. J. Johnson	tant PATH	2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File June 21, 197
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for ti For ti For ti (This space for Fi APPROVED BT	eed for cemen RBP and packa keed for cemen RBP and packa w/RBP and packa y/plastic line well on injon itional surface bances require is activity we the foregoing to fail where of the conservation we have a state office	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'. er. Set packer abo J. J. Johnson		2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File June 21, 197
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for times Figure for Figure for F	eed for cement RBP and packo lze. See atta w/RBP and packo /plastic line well on injo itional surfact bances require is activity.	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'. er. Set packer abo J. J. Johnson	tant PATH	2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File June 21, 197
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for times Figure for Figure for F	eed for cemen RBP and packa keed for cemen RBP and packa w/RBP and packa y/plastic line well on injon itional surface bances require is activity we the foregoing to fail where of the conservation we have a state office	er to straddle int ached. cker. ed tubing and pack ection service.	ervals 5380-5548'. er. Set packer abo J. J. Johnson	tant PATH	2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File June 21, 197
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for ti For ti For ti (This space for Fi APPROVED BT	eed for cemen RBP and packa keed for cemen RBP and packa w/RBP and packa y/plastic line well on injon itional surface bances require is activity we the foregoing to fail where of the conservation we have a state office	er to straddle int ached. cker. ed tubing and pack action service.	ervals 5380-5548'. er. Set packer abo J. J. Johnson Engineering Assis	tant PATH	2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File June 21, 197
4. Move 5. Acidi 6. POOH 7. RIH w 8. Place No addi distur for ti. 5. Acidi 7. RIH w 8. Place	eed for cemen RBP and packa keed for cemen RBP and packa w/RBP and packa y/plastic line well on injon itional surface bances require is activity we the foregoing to fail where of the conservation we have a state office	er to straddle int ached. cker. ed tubing and pack action service.	ervals 5380-5548'. er. Set packer abo J. J. Johnson	tant PATH	2-State 3-Partners 1-JCB 1-DLD 1-Sec 723 1-File June 21, 197

.•

FIE	ELD NAME	Red Wash	· · · · · · · · · · · · · · · · · · ·		
		COMPLETED	TREATMENT PROCE	DURE	
1.	Size and t	ype of treatmen	t: 2350 gals	15% HC1.	
2.	Intervals	treated: 5547-48	3, 5531-37, 5518	-26, 5486-95, 5380-97	
3.	Treatment	down casing or	tubing. Work	String	
4.	Methods us	ed to localize (		le perfs with retrievable plug and packer.	
5.	Disposal o	f treating fluid	d: Spent acid s	wabbed back.	
6.	-	hich well was c		5550 3 Days	
7.	•	bailing and clo	y 4, 1978	5 Days	
8.	Date of wor				
9.		o performed worl			-
10.	Production	interval: 53	380-5548	• .	
11.	Status and	production befo	ore treatment:		
	Date	BOPD	MCFD	BWPD	
	10/77		•	204 Down tubing 22 Down casing tubin	ng annulus
]					

12. Status and production after treatment:

Date	BOPD	MCFD	BWPD	
6/19/78			576 Injection	115#

### STATE OF UTAH DIVISION OF OIL, GAS, AND MINING ROOM 4241 STATE OFFICE BUILDING SALT LAKE CITY, UTAH 84114 (801) 533-5771 (RULE I-5)

FORM NO. DOGM-UIC-1

Chevron U.S.A. Inc.

÷

#### IN THE MATTER OF THE APPLICATION OF

CAUSE NO.

ADDRESS <u>P. 0. Box 599</u> <u>Denver, CO</u> <u>ZIP 80201</u> INDIVIDUAL <u>PARTNERSHIP</u><u>CORPORTATION X</u> FOR ADMINISTRATIVE APPROVAL TO DISPOSE OR INJECT FLUID INTO THE <u>...RWU.No. 146</u>...... WELL SEC. <u>21</u><u>TWP. 7S</u><u>RANGE 22E</u> <u>Uintab</u><u>COUNTY, UTAH</u>

ENHANCED RECOVERY INJ. WELL DISPOSAL WELL .

#### APPLICATION

Comes now the applicant and shows the Division the following: 1. That Rule 1 -5 (b) 6 authorizes administrative approval of enhanced recovery injections or disposal operations.

2. That the applicant submits the following information.

Lease Name	Well No.		Field		County	٦
U-0559	1	46 (12-21	A) Red V	lash	Uintah	_
ocation of Enhanced Recovery njection or Disposal Well $\_SW^{\frac{1}{2}}$ . It		Sec		twp75_	Rgo22E	=
New Well To Be Drilled Yes 🔲 Ne 🔯	Old We	II To Be Convert Yes 🔲 N	led le [3]	Casing Test Ye	• St No D Date 3/1/61	
Depth-Base Lowest Known Iresh Water Within ½ Mile _2700_	Does In Oil-Ger	jection Zone Co Fresh Water W	ntain Iithin ½ Mile Y	ES 29 NO 0	State What oil & gas	
ocotion of Fresh Water finite	om the	Green River	Geologic Nam and Depth of	Severe (a)	Applicable	
Jeelogic Name of njection Zene Green Rive	er		Depth of Inject Interval	3 <u>80 </u> , <u>5548</u>		
Ten of the Perforated Interval:		See of Fresh 1 2700	Water:	c. Intervening Th	ickness (a minus b) 2680	_
s the intervening thickness sufficient without additional data?		h water will be	res No	>		_
ithelogy of Intervening Zones Sa	nd-shale	)				
The Nomes and Addresses of These T Bureau of Land Managem	Maximu Whom Copi ent, Sta	im= 3000 t iss of This Appli ate of IIts	ication and Att		JUL 2 2	
400 University Club B	uilding					
136 East South Temple					DIVISION	IDF
Salt Lake City, Utah	84111		<u></u>	DJERO,	OIL, GAS &	
itate of <u>Colorado</u>	. <u></u>	)		A 1	Applicant	
County of Denver and Bofore me, the undersigned with	erity, on this	day personally	appeared	R.H. ELLI		
Before me, the undersigned buth nown to me to be the person whose sutherized to make the above report (			ove instrument of the facts stat		uly swern en eath states, that ne is a said report is true and correct.	3417
Suscribed and swern to befor SEAL	e me this Expres	19 day of	July.	ais (	. Thampson	
My commission appires <u>AD (</u> Denver, CO	Olorado DL	d	N	stary Public in and fo		

(OVER)

1. Attach qualitative and quantitative analysis of fresh water from 2 or more producing wells within 1 mile of injection well showing location of wells and date samples were taken, or statement as to why samples were not submitted.

2. Attach qualitative and quantitative analysis of representative sample of water to be injected.

3. Attach plat showing subject well and all known oil and gas wells, abandoned, drilling and dry holes within ½ mile, together and with name of operator.

4. Attach Drillers Log (Form DOGM-UIC-2). (Appropriate Surety must be on file with Conservation Division.)

5. Attach Electric or Radioactivity Log of Subject well (if released).

6. Attach schematic drawing of subsurface facilities including; Size, setting depth, amount of cement used measured or calculated tops of cement surface, intermediate (if any) and production casings; size and setting depth of tubing; type and setting depth of packer; geologic name of injection zone showing top and bottom of injection interval.

7. The original and 6 copies of application, and one complete set of attachments shall be mailed to the Division.

8. Deliver 1 copy of application to landowner on whose land injection well is located and to each operator of a producing leasehold within ½ mile of injection well.

9. Affidavit of mailing or delivery shall be filed not later than five days after the application is filed.

10. Notice that an application has been filed shall be published by the Division in a newspaper of general circulation in the county in which the well is located. The Division shall file proof of publication before the application is approved. The notice shall include name and address of applicant, location of proposed injection or disposal well, injection zone, injection pressure and volume. If no written objection is received within 15 days from date of publication the application will be approved administratively.

11. A well shall not be used for injection or disposal unless completed machine accounting Form DOGM-UIC-3b is filed September 1st, each year.

12. Approval of this application, if granted, is valid only as long as there is no substantial change in the operations set forth in the application. A substantial operation change requires the approval of a new application.

13. If there is less intervening thickness required by Rule 1-5 (b) 4 attach sworn evidence and data.

NAME OF STRI	ING SIZE	SETTING DEPTH	SACKS CEMENT	TOP OF CEMENT	TOP DETERMINED BY
Surface	10-3/4"	205	170	surface	returns
Intermediate					
Production	7"	5704	400	± 4000	calculated
Tubico		5360	Non Baker FH Hyd	ne - Type - Depth of Trostatic pack	Tubing Packer er @ 5347'
Total Depth 5704	Geologic Name - In Green River		oth - Top of Inj. li		- Base of Inj. Interval

### CASING AND TUBING DATA

÷ Fl	SURFACE	TUBING PACKER		PRODUCTION CASING
SKETCH - SUB-SURFACE FACILITY			•	<b></b>
		$\bowtie$		
SKETC				-

CHECKLIST FOR INJECTION WELL APPLICATION AND FILE REVIEW

Well No. 12-214 (146) hinton Operator: T 75 R 225 Sec. 21 API# 43-047-1649. County: 1 New Well \_\_\_\_ Conversion \_\_\_\_\_ Disposal Well \_\_\_\_ Enhanced Recovery Well \_\_\_\_ NO YES UIC Forms Completed Plat including Surface Owners, Leaseholders, and wells of available record Schematic Diagram Fracture Information Pressure and Rate Control Adequate Geologic Information Fluid Source TDS No Yes Analysis of Injection Fluid 2166 TDS No Yes Analysis of Water in Formation to be injected into Depth 2700 Known USDW in area 3 Prod. Z P&A Number of wells in area of review Water 🖉 Inj. NA Yes Aquifer Exemption No Yes Mechanical Integrity Test Type Freces Date 8-31-84 57021 4000 mm Comments:

Reviewed by:

Form Ulk	-2-			ys after drilli AL RESOURC			COUNTY LEASE NO.
API NO 4	DE	5458 CO CO CO CO CO FA TO FA DR DA	ISION OF OIL Room 4243 Sta Solt Lake C UNTY <u>UIN</u> MPANY OPE FICE ADDRES WN RM NAME ILLING STAR ITE OF FIRST	, GAS, AND M one Office Build iny, Utoh B4114 tah sec. 2 RATING _Ch sP. Denver Red Wash TED 2/28	INING I TW EVTON U. O. BOX STATE 961 DRILL 4/22/6	P. <u>75</u> 599 zip <u>CO</u> zil no. <u>14</u> ing finishe	RGE. <u>22E</u>
Lacona and O	8 Wed Correctly						om wl of % sec.
TYPE COMPLETION         Single Zene       X         Multiple Zene       Order Ne.         Comingled       Order Ne.         LOCATION EXCEPTION       Order Ne.							
		From	OIL OR	GAS ZONES	Nome	 Fre	om To
Green R	iver	4500	5600				
			CASING	G & CEMENT			
	Cesi	ng Set		Csg. Test	le la companya de la comp	Cement	
Size	Wgt	Grade	Feet	Psi	Sax	Fillup	Тер
10-3/4"	40.5#	J-55	205	*	170		surface
.7''	23#	<u>.I-55</u>	5704	2000	400		4000 .
	1 1			1	1		1

COMPLETION & TEST DATA DI PRODUCTIVO FORMATION

1

2

3

			the second s
FORMATION	Green River		
SPACING & SPACING ORDER NO.	80-acre spacin	g	
CLASSIFICATION (Oil; Gas; Dry; Inj. Well)	Enhanced recovery		
PERFORATED	5380-97	5492	5524 <sup>1</sup> 3
•	5486-95	5525	5533 <sup>1</sup> 3
INTERVALS	5518-26	5534	5547 <sup>1</sup> 3
	5531-37	5548	
ACIDIZED? Yes	All perforated	intervals	<u> </u>
FRACTURE TREATED? <sup>NO</sup>			
NITIAL TEST DATA			
Date	4/22/61		
Oil. bbl./day	17		

• • •		
Date	4	

Date	4/22/61			
Oil. bbl./dey	11			
Oil Gravity	25.5			
Gas. Cu. Ft./day	80	Mcf	G	CI
Gas-Oil Ratie Cu. Ft./Bbl.	7273			
Water-Bbl./day	294			(
Pumping or Flowing	pumping			
CHOKE SIZE				
FLOW TUBING PRESSURE				·

A record of the formations drilled through, and portinent remarks are presented on the severse.

(use reverse side)

I, the undersigned, being first duly sworn upon eath, state that this well record is true, correct and comple according to the records of this office and to the best of my knowledge and belief.

Telephone (303) 691-7457987. R.H. Elliott - Ares Prod Supt. My commission expires July 57 1987. R.H. Elliott - Ares Prod Supt. Name and title of representative of company My Pusiness address is: \_,19\_83 19 July Subscribed antorado Bbille me this . day of ..... \*Denverted 80222/1/61, but our records do not show a value


for the pressure test. Loin & Thim plan PLAT SHOWING LOCATION OF THE CALIFORNIA OIL COMPANY WELL IN THE  $SW_4^1$  OF THE  $NW_4^1$  SECTION 21, TOWNSHIP 7 SOUTH, RANGE 22 EAST, SALT LAKE BASE AND MERIDIAN.

Scale of plat 1" = 400 feet.

SW4 of NW4 Sec 21 Vell Loc 12-21A Elev on Con. cellu orto 5016.7 CUFTS 655'E

I, Leon P. Christensen, of Vernal, Utah do hereby certify that this plat correctly shows the location of the well shown hereon as surveyed by me on January 23, 1961, that elevations were run on February 12, 1961. Well is located at a point 663 feet North and 655 feet East of the West quarter corner, Section 21, Township 7 South, Range 22 East, Salt Lake Meridian.

veyor

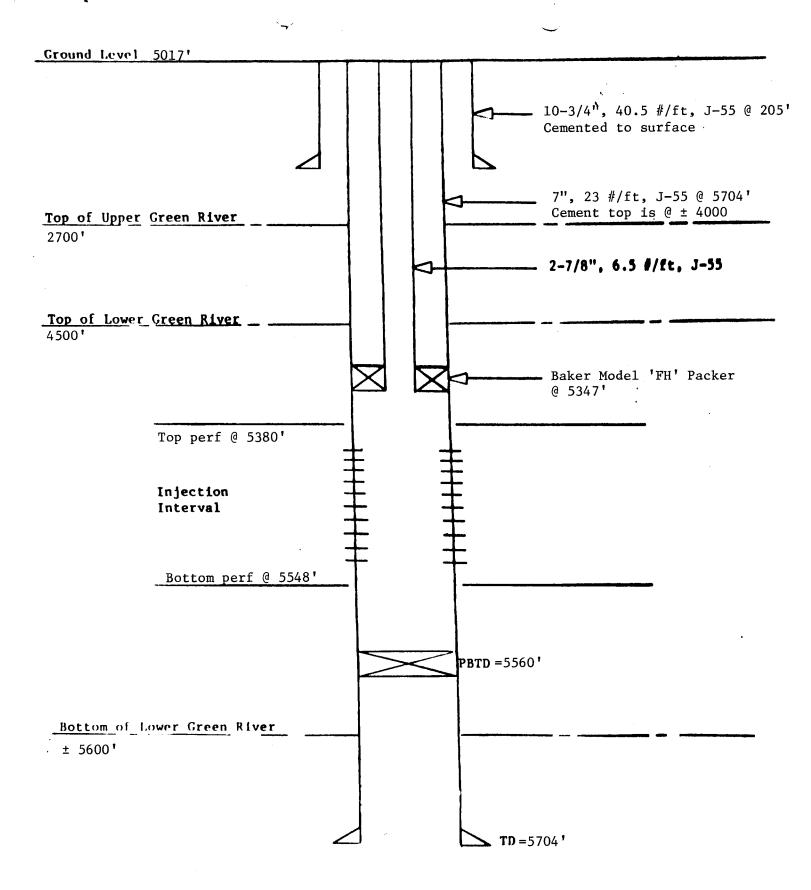

Red Wash Unit 146 (12-21A) Wellbore Schematic

#### CBL DESCRIPTIONS

### Injection Well RWU No. 146 (12-21A)

`~v

The CBL indicates the cement top is at  $\pm$  4000'. The cement bond from 4000' to 5000' is of poor quality. Generally, from 5000' to 5560' the bonding is fair. Poorly bonded sections exist from 5100' to 5130' and 5340' to 5380'. The injection interval is from 5380' to 5548'.

#### Offset Producers RWU No. 73 (32-21A) - SI

A cement bond log is not available for No. 73 (32-21A). The cement top is calculated to be at 3880' from the first stage and 400' from the second stage of the cement job. The DV tool is at 2209'. The production interval is 1980'-2036' in the Uinta Formation.

#### RWU No. 86 (23-21A)

The cement bond in No. 86 is generally of fair quality from the cement top at 3950' to TD. Good and poor sections are indicated throughout the cemented interval. Perforations exist within the gross interval 5955'-6125'.

Form 3160-5 UNI (June 1990) DEPARTMEN BUREAU OF SUNDRY NOTICES Do not use this form for proposals to drill or Use "APPLICATION FO	FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993 5. Lease Designation and Serial No. U - 0559 6. If Indian, Allottee or Tribe Name	
SUBMI	7. If Unit or CA, Agreement Designation RED WASH	
1. Type of Well Oil Gas Well Well X Other With	8. Well Name and No. 146 (12-21A)	
2. Name of Operator CHEVRON U.S.A. PRODUCTION CO.	9. API Well No. 43-047-16492	
3. Address and Telephone No. P.O. BOX 599, DENVER, CO. 80201 (3	10. Field and Pool, or Exploratory Area RED WASH - GRN. RIVER	
4. Location of Well (Footage, Sec., T., R., M., or Survey Descr 1980 (N)- 603 FSL, 660 FWL, SEC. 21, T7S, R228	11. County or Parish, State UINTAH, UTAH	
12. CHECK APPROPRIATE BOX	(s) TO INDICATE NATURE OF NOTICE, REPO	ORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTI	ON
Notice of Intent	Abandonment Recompletion	Change of Plans New Construction
Subsequent Report	Plugging Back Casing Repair	Non-Routine Fracturing
Final Abandonment Notice	Altering Casing	Conversion to Injection
		(Note) Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

THIS WELL IS SHUT-IN WHILE UPGRADING WELL TEST FACILITIES. WE WILL RE-EVALUATE STATUS AFTER WELL TEST FACILITIES UPGRADES HAVE BEEN COMPLETED.

3 - BLM 3 - STATE 1 - JTC 1 - WELL FILE 1 - JLW	APR 0 9 1992			
	DIVISION OF ., GAS & MINING			
14. I hereby certify that the foregoing is Signed	atsin	Title PERMIT SPECIALIST	Date3/30/5	)2
(This space for Federal or State office us Approved by: Conditions of approval, if any:	se)		Date	
Title 18 U.S.C. Section 1001, makes it	a crime for any person knowingly an	d willfully to make to any department or agency of	the United States any false, fictit	ious or fraudulent statements or

representations as to any matter within its jurisdiction.



Chevron U.S.A. Inc. P.O. Box 455, Vernal, UT 84078 • Phone (801) 789-2442

FEBRUARY 15, 1993

ANNUAL REPORT OF SHUT-IN WELLS WONSITS VALLEY STATE/FEDERAL UNIT

UINTAH COUNTY, UTAH

### BUREAU OF LAND MANAGEMENT 170 SOUTH 500 EAST VERNAL, UT 84078

#### **GENTLEMEN:**

Enclosed, please find the annual report of shut-in wells in Red Wash Unit. If you have any questions, please call the above address.

Sincerely,

J.T. CONLEY AREA OPERATIONS SUPERVISOR

sdm Enclosures

cc:

State of Utah Department of Natural Resources Division of Oil, Gas and Mining 355 West North Temple 3 Triad Center, Suite 350 Salt Lake City, UT 84180-1203

FEB 1 8 1993

DIVISION OF OIL GAS & MINING **Chevron** U.S.A. Inc. P.O. Box 455, Vernal, UT 84078 • Phone (801) 789-2442

FEBRUARY 15, 1993

ANNUAL REPORT OF SHUT-IN WELLS RED WASH-UNIT

UINTAH-COUNTY, UTAH

BUREAU OF LAND MANAGEMENT 170 SOUTH 500 EAST VERNAL, UT 84078

#### GENTLEMEN:

Enclosed, please find the annual report of shut-in wells in Red Wash Unit. If you have any questions, please call the above address.

Sincerely,

J.T. CONLEY

AREA OPERATIONS SUPERVISOR

sdm Enclosures

cc:

State of Utah Department of Natural Resources Division of Oil, Gas and Mining 355 West North Temple 3 Triad Center, Suite 350 Salt Lake City, UT 84180-1203

Buttram Energies, Inc. 6303 Waterford Boulevard, Suite 220 Oklahoma City, OK 73116



• • • •

DIVISION OF OIL GAS & MINING

£.

Chevron

$\smile$		V
(June 1990) DEPARTMEN BUREAU OF SUNDRY NOTICES Do not use this form for proposals to drill or	TED STATES NT OF THE INTERIOR LAND MANAGEMENT AND REPORTS ON WELLS to deepen or reentry to a different reservoir. OR PERMIT—" for such proposals	FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993 5. Lesse Designation and Serial No. U-0559 6. If Indian, Allottee or Tribe Name
SUBMIT	IN TRIPLICATE	7. If Unit or CA, Agreement Designation
Type of Well Oil Gas Well Well Other      Name of Operator Chevron U.S.A. Inc.		Red Wash Unit           8. Well Name and No.           RWU #146 (12-21A)           9. API Well No.
3. Address and Telephone No.		43-047-16492
P.O. Box 455, Vernal, Utah 84078 (80 4. Location of Well (Footage, Sec., T., R., M., or Survey Descript		10. Field and Pool, or Exploratory Area Red Wash-Grn. River
663' FSL, 665' FWL, S21-T7S-R22E 1980' FNL 0		11. County or Parish, State Uintah, Utah
12. CHECK APPROPRIATE BOX(	s) TO INDICATE NATURE OF NOTICE, REPO	ORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION	ON
<ul> <li>Notice of Intent</li> <li>Subsequent Report</li> <li>Final Abandonment Notice</li> </ul>	Abandonment Recompletion Plugging Back Casing Repair Altering Casing Other	Change of Plans New Construction Non-Routime Fracturing Water Shut-Off Conversion to Injection Dispose Water (Note) Report results of subligie completion on Well Completion or Recompletion Report and Leg form.)
subsurface locations and measured and true vertical depths for all	rtinent details, and give pertinent dates, including estimated date of starting markers and zones pertinent to this work.) 1992. We plan to re-evaluate this shut-in injection well du	
14. I hereby certify that the structure and correct	Tite Peterleum Encine	Dete 2/15/93

(This space for Federal or State office use)

Signed State Manager

Approved by: \_ Conditions of approval, if any:

•

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Title

Date

· · · · · · · · · · · · · · · · · · ·		
		at the second
Form 3160-5 UN (June 1990) DEPARTME BUREAU OF	FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993	
	AND REPORTS ON WELLS	5. Lease Designation and Serial No. U-0559
	r to deepen or reentry to a different reservoir. DR PERMIT—" for such proposals	6. If Indian, Allottee or Tribe Name
SUBMIT	T IN TRIPLICATE	7. If Unit or CA, Agreement Designation Red Wash Unit
1. Type of Well		
		8. Well Name and No. RWU #146 (12-21A)
2. Name of Operator Chevron U.S.A. Inc.		9. API Well No.
3. Address and Telephone No. P.O. Box 455, Vernal, Utah 84078 (80	01) 789-2442	43-047-16492 10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Descrip		Red Wash-Grn. River
'663', FSL, 866' FWL, SEC. 21, T7S, R 1980 FNL (140'	22E	11. County or Parish, State Uintah, Utah
12. CHECK APPROPRIATE BOX	s) TO INDICATE NATURE OF NOTICE, REPOR	T, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION	
X Notice of Intent	Abandonment	Change of Plans
Subsequent Report	Plugging Back	New Construction Non-Routine Fracturing
Final Abandonment Notice	Casing Repair Altering Casing	Water Shut-Off Conversion to Injection
	Other	Dispose Water
	1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.1.	(Note) Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
13. Describe Proposed or Completed Operations (Clearly state all pe subsurface locations and measured and true vertical depths for all	rtinent details, and give pertinent dates, including estimated date of starting any markers and zones pertinent to this work.)	proposed work. If well is directionally drilled, give
We propose to P&A the subject well per the attack	bed procedure.	
	RECE	NED
	JG (	2 1993
		ONOF
··· • *#*	8-3-93 A C"L GAS	
	Matthew	
14. I hereby certify that the foregoing is the and porror		

Title

\_Title \_

1+

Date

Date

07/30/93

 $\overline{c}^{+}$  de

(This space for Federal or State office use) Federal Approval of this Action is Necessary

Approved by: \_\_\_\_\_\_ Conditions of approval, if any:

٠

.

Signe

RED WASH UNIT UINTAH COUNTY, UTAH

มากระ เมษาส์ เมื่อเหติส์ เมษาการ 🗢 ನನ್ನು

 $\underbrace{}_{}$ 

### RWU #146 (12-21A) PLUGGING PROCEDURE

MIRU. ND WH AND NU BOPE. 1.

1.4.4

(a) (a)

- RELEASE BAKER FH PACKER AT 5341' AND TOH. 2.
- CLEAN OUT TO ~5350'. SET CIBP AT 5300' AND DUMP BAIL 35' OF 3. CEMENT ON TOP. DISPLACE WELLBORE TO ~2700' WITH 9.2 PPG BRINE.
- OIL SHALE INTERVAL WHICH BLM NORMALLY REQUIRES TO BE ISOLATED 4. DOES NOT APPEAR TO EXIST AT THIS LOCATION. NEXT PLUG IS TO CAP THE TOP OF THE GREEN RIVER FORMATION AT 2800'. PERFORATE AT 2900' AND SET CICR AT 2800'. SQUEEZE ~55 SX. CLASS H CEMENT BELOW CICR AND SPOT ~25 SX. CLASS H CEMENT ON TOP OF CICR. CIRCULATE CLEAN AND DISPLACE WELLBORE WITH 9.2 PPG BRINE.
- PERFORATE AT 300' AND ESTABLISH CIRCULATION DOWN 7" CASING AND 5. UP 7" X 10-3/4" ANNULUS. CEMENT CASING AND ANNULUS FROM 300' TO SURFACE USING ~165 SX. CLASS H CEMENT.
- CUT OFF WELLHEAD AND INSTALL DRY HOLE MARKER. 6.
- NOTIFY OPERATIONS TO REHABILITATE LOCATION PER BLM GUIDELINES. 7.

The second of the second second second

RED WASH UNIT PO BOX 455	NAME AND ADDRESS OF OWNER/CPERATOR CHEVRON USA PRODUCTION CO PO BOX 455				
VERNAL UT 84078		VERNAL UT	84078		
	STATE COUNTY			PERMIT NUMBER	
LICATE WELL AND OUTLINE UNIT ON SECTION PLAT - 540 ACRES	UT UINTAH			UT02436	
	SURFACE LOCATION DESCRIP			TOWNSHIP 75 RANGE 2	25
	SW WERE NW WE			TOWNSHIP 75 RANGE 2	
			SI LINES OF UU	ANTER SECTION AND UNICLING UNI	•
	Surface 663 Location	S	Section		
	665 EAM W				
	TYPE OF AUTHOR			WELL ACTIVITY	
	E Individual Permit				
· · · · · · · · · · · · · · · · · · ·	C Area Permit		₩ CLASS	1	
	3Rui.			Disposal Icea Recovery	
· · · · · · · · · · · · · · · · · · ·	Number of Wells		_ ∃Hvdro	carbon Storage	
				II.	
	:		•	#1/6/10 014)	
÷	Lease Name RED WASI	H UNIT	Well Num	#146(12-21A) er	
LASING AND TUBING RECORD	AFTER PLUGGING	METHOD	O OF EMPLACEN	IENT OF CEMENT PLUGS	
	······	🖾 The Ba	alance Method		
E DE WTILE, FT TO BE PUT IN WELL (FD.)		E The Ou	ump Gailer Me	thod	
<u>3/4 40.5 N/A</u>	205 15	🛄 The Tv	wo-Flug Metho	D	
<u>23 N/A</u>	5704 9	Cther		•	
		#2 PLUG #3		PLUG #5   PLUG #6   PLU	¢ 17
CEMENTING TO PLUG AND ABANDON DAT.			PLUG #4	FLUGING I FLUGING I FLU	
CEMENTING TO PLUG AND ABANDON DAT.		7 7	PLUG #4		
		7 7			
s of mote or Pipe in which Plug Will Be Placed linch and to Sottom of Tuping or Drill Pipe (11.) as of Cement To Be used leach divor	esi - 5300 290 7.3 7	7 7 00 300 5 165			
s of mote or Pipe in which Plua Will Be Placed linch state dottom of Tubing or Orill Pipe (π.) iss of Cement To Be used teach blug) (η volume To Be Pumped (cu. π.)	es)	7 7 00 300 5 165 9 175			
s of mole or Ploe in which Plua Will Be Placed linch sta to Sottom of Tuping or Drill Ploe (π.) ixs of Cement To Be used leach blua: (ny volume To Be Pumped (cu, π.) spiszed Top of Plua (π.)	esi - 5300 290 7.3 7	7 7 00 300 5 165 9 175			
s of note or Ploe in which Plua Will Be Placed linch state Sottom of Tubine or Orill Ploe (π.) iss of Cement To Be used teach blua) (or volume To Be Pumped (cu, π.) surated Top of Plug (π.) estired Top of Plug (π.)	esi	7 7 00 300 5 165 9 175 00 SURF			
e of mote on Place in which Plua Will Be Placea linch state Sottom of Tuping on Drill Place (π.) iss of Cement To Be rused (each plua) (η volume To Be Pumpea (cu. π.) stuared Top of Plua (π.) stured Top of Plua (π.) asged π.) mv Wt. (Lb./ Gel.)	esi	7 7 00 300 5 165 9 175 00 SURF 5.4 16.4			
s of mote on Place in which Place Will Be Placed linch state 5 Sottom of Tubing on Drill Place (π.) (xs of Cement To Be lused leach blud) (xy volume To Be Pumbed (cu, π.) suisted Top of Plud (π.) suisted Top of Plud (π.) suisted Top of Plud (π.) stured Top of Plud (π.) rw VM. (Lb./ Gal.) s Cement on Other Material (Class (ii)	esi	7 7 00 300 5 165 9 175 00 SURF 5.4 + 16.4 H	1		
s of mote on Place in which Place Will Be Placed linch state 5 Sottom of Tubing on Drill Place (π.) (xs of Cement To Be lused leach blud) (xy volume To Be Pumbed (cu, π.) suisted Top of Plud (π.) suisted Top of Plud (π.) suisted Top of Plud (π.) stured Top of Plud (π.) rw VM. (Lb./ Gal.) s Cement on Other Material (Class (ii)	esi	7 7 00 300 5 165 9 175 00 SURF 5.4 + 16.4 H	1		
s of mote on Plos in which Plus Will Be Places linch state 5 Sottom of Tubine on Drill Plos (π.) (th volume To Be Pumped (cu, π.) (th volume To Be Pumped (cu, π.)) (th volume To Be Pumped (cu, m.)) (th volume To Be Pumped (cu, m.)) (th volume To B	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	1	VARIED /// anv	
s of mole on Ploe in which Plua Will Be Plazad linch sta to Sottom of Tupine or Drill Ploe (π.) its of Cement To Be used teach olivo) (th volume To Be Pumped (cu, π.) sturated Top of Plua (π.) stured Top of Plua (π.	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	1	VARIED /// anv	
s of mole on Ploe in which Plua Will Be Plazad linch sta to Sottom of Tupine or Drill Ploe (π.) its of Cement To Be used teach olivo) (th volume To Be Pumped (cu, π.) sturated Top of Plua (π.) stured Top of Plua (π.	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	1	VARIED /// anv	
s of mole on Ploe in which Plua Will Be Plazad linch sta to Sottom of Tupine or Drill Ploe (π.) its of Cement To Be used teach olivo) (th volume To Be Pumped (cu, π.) sturated Top of Plua (π.) stured Top of Plua (π.	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	LASING WILL BE	VARIED /// anvi 	
s c - note or Plos in which Plus Will Be Places linch sta to Sottom of Tubins or Drill Plos (π.) its of Cement To Be russed leach blue) (ny volume To Be Pumbes (cu. π.) stured Top of Plus (π.) stured Top of Plus (π.) rrv VN. (Lb./Gal.) s Cement or Other Material (Class (ii) 	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	LASING WILL BE	VARIED /// anv	
s c) note or Plots in which Plus Will Be Places linch th to Sottom of Tubine or Orill Plots (π.) tts of Cement To Be runded reach blub) (** volume To Be Pumbed (cu, π.) turated Top of Plus (π.) stured Top of Plus (π.) try Wt. (Lb./ Gal.) s Cement or Other Material (Class (ii)) CST ALL OPEN HOLE AND/ From SEE ATTACHED SCHEMATIC.	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	LASING WILL BE	VARIED /// anvi 	
s c - note or Plos in which Plus Will Be Places linch sta to Sottom of Tubins or Drill Plos (π.) its of Cement To Be russed leach blue) (ny volume To Be Pumbes (cu. π.) stured Top of Plus (π.) stured Top of Plus (π.) rrv VN. (Lb./Gal.) s Cement or Other Material (Class (ii) 	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	LASING WILL BE	VARIED /// anvi 	
s c) note or Plots in which Plus Will Be Places linch th to Sottom of Tubine or Orill Plots (π.) tts of Cement To Be runded reach blub) (** volume To Be Pumbed (cu, π.) turated Top of Plus (π.) stured Top of Plus (π.) try Wt. (Lb./ Gal.) s Cement or Other Material (Class (ii)) CST ALL OPEN HOLE AND/ From SEE ATTACHED SCHEMATIC.	esi	7 7 00 300 5 165 9 175 90 SURF 5.4 + 16.4 HERVALS WHERE C	LASING WILL BE	VARIED /// anvi 	
s c) note or Plots in which Plus Will Be Places linch th to Sottom of Tubine or Orill Plots (π.) tts of Cement To Be runded reach blub) (** volume To Be Pumbed (cu, π.) turated Top of Plus (π.) stured Top of Plus (π.) try Wt. (Lb./ Gal.) s Cement or Other Material (Class (ii)) CST ALL OPEN HOLE AND/ From SEE ATTACHED SCHEMATIC.	esi	7 7 00 300 5 165 9 175 00 SURF 5.4 16.4 HTERVALS WHERE C From	LASING WILL BE	VARIED /// anvi 	
s c - note or Pipe in which Plus Will Be Places linch stat to Sottom of Tubine or Drill Pipe (m.) tas of Cement To Be runded (each blue) (ny volume To Be Pumbed (cu. n.) stated Top of Plue (m.) stured Top of Plue (m.) rw vM. (Lb./Gal.) s Cement or Other Material (Class (ii) CTALL OPEN HOLE AND/ From SEE ATTACHED SCHEMATIC. S25000	CERTIFICAT	7 7 00 300 5 165 9 175 00 SURF 5.4 16.4 H ITERVALS WHERE C From	LASING WILL BE	VARIED (// anv)	
s c) note or Plots in which Plus Will Be Places linch th to Sottom of Tubine or Orill Plots (π.) tts of Cement To Be runded reach blub) (** volume To Be Pumbed (cu, π.) turated Top of Plus (π.) stured Top of Plus (π.) try Wt. (Lb./ Gal.) s Cement or Other Material (Class (ii)) CST ALL OPEN HOLE AND/ From SEE ATTACHED SCHEMATIC.	esi	7 7 20 300 5 165 9 175 20 SURF 5.4 16.4 HTERVALS WHERE C From From ION xamined and a	ASING WILL BE	VARIED /// envi	

J.T. CONLEY RED WASH AREA TEAM LEADER

DATE SIGNED 7-13-93

....

. .

.\_...

UNITED STATE INVIRONMENTAL PROTECTION SENCY



REGION VIII 999 18th STREET - SUITE 500 DENVER, COLORADO 80202-2466

# SEP 3 1993

8WM-DW Ref:

CERTIFIED MAIL RETURN RECEIPT REQUESTED SEP 0 9 1993

DIVISION OF OIL. GAS & MINING

Mr. John T. Conley Chevron U.S.A. Production Company P. O. Box 455 Vernal, UT 84078

> RE: UNDERGROUND INJECTION CONTROL (UIC) Approval of P & A Plans Red Wash Unit (RWU) Uintah County, Utah

Dear Mr. Conley:

In accordance with the telephone conversation between your Mr. Steve McPherson and Chuck Williams of this office, we have reviewed and hereby approve the revised plugging and abandonment plans as submitted, dated July 22, 1993, for the following wells:

RED WASH FIELD

EPA PERMIT NO.

RWU #98 (21-22A) RWU #22 (41-18C) RWU #105 (32-29A) RWU #117 (14-21A) RWU #146\*(12-21A) UT2000-02359 UT2000-02427 UT2000-02431 UT2000-02432 UT2000-02436 J. 75, R. 22E, 5-21 UT2000-02436 J. 75, R. 22E, 5-21

16492

Within sixty (60) days from the date of plugging and abandonment operations, please submit EPA Form 7520-13, Plugging Record, (copy enclosed), for each well, showing the details as to how each well was actually plugged.

Please direct all correspondence to the <u>ATTENTION: CHUCK</u> <u>WILLIAMS, CITING MAIL CODE 8WM-DW</u>. Thank you for your continued cooperation.

Sincerely, Directd Dodson. er Management Division

Enclosure

			FORM APPROVED
orm 3160-5		INITED STATES	Budget Bureau No. 1004-0135
ine 1990)		MENT OF THE INTERIOR	Expires: March 31, 1993
	BUREAU C	OF LAND MANAGEMENT	5. Lease Designation and Serial No.
			U-0559
		ES AND REPORTS ON WELLS	
o not use this form for pr	-	leepen or reentry to a different reservoir	6. If indian, Allottee or Tribe Name
	Use "APPLICATION	N FOR PERMIT" for such proposals	
			7. If Unit or CA, Agreement Designation
Type of Well	SUBMITI	N TRIPLICATE	RED WASH UNIT
Oil Gas			
	Other		B. Well Name and No.
Well Well X			RWU #146 (12-21A)
Name of Operator			
CHEVRON U.S.A. PRODU	CTION COMPANY		9. API Well No.
Address and Telephone No.	····		43-047-16492 10. Field and Pool, or Exploratory Area
P. O. BOX 455, VERNAL, U			
Location of Well (Footage, Sec., T., R.,	M., or Survey Description)		RED WASH-GRN. RIVER
			11. County or Parish, State
663' FSL, 665' FWL, SEC. 2	21, T7S/R22E		UINTAH, UTAH
CHECK	APPROPRIATE BOX	(s) TO INDICATE NATURE OF NOTICE, 1	REPORT, OR OTHER DATA
TYPE OF SUBM	ISSION	TYPE OF A	ACTION
Notice of Intent		Abandonment	Change of Plans
		Recompletion	New Construction
X Subsequent Report		Plugging Back	Non-Routine Fracturing
		Casing Repair	Water Shut-Off
Final Abandonment Not	tice	Altering Casing	Conversion to Injection
استي			
		X Other 6 MOS. EXTENSION (P&A)	Dispose Water
			(Note) Report results of multiple completion on Well
			(Note) Report results of intractive completion of the
			Completion or Recompletion Report and Log form.)
). Describe Proposed or Completed Open	ations (Clearly state all pertinent detail	is, and give pertinent dates, including estimated date of starting any propose rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.)
<ul> <li>Describe Proposed or Completed Open give subsurface locations and measured</li> <li>We request a 6 mos. extension</li> </ul>	d and true vertical depths for all marke	rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.) d work. If well is directionally drilled,
give subsurface locations and measured	d and true vertical depths for all marke	rs and zones pertinent to this work)	Completion or Recompletion Report and Log form.) d work. If well is directionally drilled,
give subsurface locations and measured	d and true vertical depths for all marke	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.) d work. If well is directionally drilled,
give subsurface locations and measured	d and true vertical depths for all marke	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.)
give subsurface locations and measured	d and true vertical depths for all marke	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.)
give subsurface locations and measured We request a 6 mos. extension	d and true vertical depths for all marke on on our proposal to P&A 2 17- MMA	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.)
give subsurface locations and measured We request a 6 mos. extension	d and true vertical depths for all marke on on our proposal to P&A 2 17- MMA	ns and zones pertinent to this work) the subject well.	Completion or Recompletion Report and Log form.) d work. If well is directionally drilled,
give subsurface locations and measured We request a 6 mos. extension	d and true vertical depths for all marke on on our proposal to P&A 2 17- MMA	rs and zones pertinent to this work) the subject well. FEB   F FEB   F ULLE	Completion or Recompletion Report and Log form.)
give subsurface locations and measured We request a 6 mos. extension	d and true vertical depths for all marke on on our proposal to P&A 2 17- MMA	rs and zones pertinent to this work) the subject well. FEB   F FEB   F ULLE	Completion or Recompletion Report and Log form.)
give subsurface locations and measured We request a 6 mos. extension	d and true vertical depths for all marke on on our proposal to P&A 2 17- MMA	rs and zones pertinent to this work) the subject well. FEB   F FEB   F ULLE	Completion or Recompletion Report and Log form.)
give subsurface locations and measured We request a 6 mos. extension () () () () () () () () () () () () ()	d and true vertical depths for all marke on on our proposal to P&A 2 17- MMA	rs and zones pertinent to this work) the subject well.  FEB   F  FEB   F  Title Operations Assistant	Completion or Recompletion Report and Log form.) d work: If well is directionally drilled, Date 02/14/94

.

Form 3160-5	UNITED STATES	FORM APPROVED
	EPARTMENT OF THE INTERIOR	Budget Bureau No. 1004-0135
-	UREAU OF LAND MANAGEMENT	Expires: March 31, 1993
D.	5. Lease Designation and Serial No.	
CUMBD	Y NOTICES AND REPORTS ON WELLS	U-0559
	rill or to deepen or reentry to a different reservoir	
	ICATION FOR PERMIT* for such proposals	6. If Indian, Allottee or Tribe Name
S	7. If Unit or CA, Agreement Designation	
1. Type of Well	UBMIT IN TRIPLICATE	RED WASH UNIT
Oil Gas	REARMER	
Well Well X Other	MEGENNEU	B. Well Name and No.
		RWU #146 (12-21A)
2. Name of Operator	JL 1 5 1994	9. API Well No.
CHEVRON U.S.A. PRODUCTION COMP		43-047-16492
<ol> <li>Address and Telephone No.</li> <li>11002 EAST 17500 SOUTH, VERNAL, UT</li> </ol>	THE REAL PROPERTY AND A DESCRIPTION OF A	10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description		RED WASH-GRN. RIVER
4. LOCATION OF WEIL (FOOLIGE, DED., 1., N., M., OF DATES) Detroit	,,,	11. County or Parish, State
663' FSL, 665' FWL, SEC. 21, T75/R22E		UINTAH, UTAH
000° FSL, 003° FWL, SEC. 21, 173/R22E		
12. CHECK APPROPRIA	ATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT	, OR OTHER DATA
	TYPE OF ACTION	
TYPE OF SUBMISSION		Change of Plans
Notice of Intent	X Abandonment	Citaline of Fairs
	Recompletion	New Construction
		Non-Routine Fracturing
X Subsequent Report	Plugging Back	
	Casing Repair	Water Shut-Off
		Conversion to Injection
Final Abandonment Notice	Altering Casing	
	Other	Dispose Water
		lote) Report results of multiple completion on Well
		ompletion or Recompletion Report and Log form.)
<ol> <li>Describe Proposed or Completed Operations (Clearly state a give subsurface locations and measured and true vertical dep</li> </ol>	il pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well the for all markets and more pertinent to this work)	is directionally drilled,
Subject injector was P&A'd between 7/7/94	and 7/12/94 as follows:	
1. MIRU. Tested casing to 500 PSI; good.		
2. Perforated at 5334' using 4 JSPF.		
3. RIH with bit and scraper to 5325'. Circ 4. POOH with bit and scraper and set CIB	uated web clean. P at 5290'. Tested casing to 500 PSI; good. Dump bailed 35' cement on top.	
5. Perforated at 3850' using 4 JSPF. RIH	with 7" CICR to 5232'.	- the last CICD string

- 6. Set CICR at 3608'. Tested casing to 500 PSI; good. Tested tubing to 1500 PSI; good. Pumped 90 sx. Class H Cement below CICR, stung out and spotted 10 sx on top.
- 7. Perforated at 2900' using 4 JSPF. RIH with 7" CICR to 2565'. Tested casing to 500 PSI; good. Pumped 125 sz. Class H Cement
- below CICR and spotted 10 sx. on top. 8. Perforated at 255' using 4 JSPF. Established circulation down casing and up annulus. Pumped 150 sx. Class H Cement to surface, hole stood fuil.
- 9. Cut off wellhead, installed P&A marker and notified Operations to reclaim location.

· \* 🕳

...

All voids between cement plugs were filled with 9.2 ppg brine. P&A operations were witnessed by Bill Owens with the BLM.

14. I hereby certify that the foregoing is true and confect.	Sh Tid	Operations Assistant	Date	07/13/94	
(This space for Federal or State office use)	$\forall$ —				
Approved by:	Tit	•	Date		
Conditions of approval, if any					
Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.					

`*					
Form 3160-5					
9 (June 1990)		T OF THE INTERIOR AND MANAGEMENT		Budget Bureau No. 1004-0135 Expires: March 31, 1993	
	DORLAO OF L		5. Lease	Designation and Serial No.	
SUN	DRY NOTICES A	AND REPORTS ON WELLS			
Do not use this form for proposals to	drill or to deepen	or reentry to a different reservoir			
Use "A	<b>APPLICATION FO</b>	R PERMIT" for such proposals	6. If Ind	lian, Allottee or Tribe Name	
				N/A it or CA, Agreement Designation	
1. Type of Well	SUBMIT IN TH	RIPLICATE		RED WASH UNIT	
Oil Gas				I-SEC NO 761	
Weti Weli X Other	MULTIPLE WELLS S	SEE ATTACHED LIST	8. Well	Name and No.	
2. Name of Operator CHEVRON U.S.A. INC.			9. APL	Well No.	
3. Address and Telephone No	·				
11002 E. 17500 S. VERNAL, UT 84078-8	1526	(8	01) 781-4300 10. Fiel	d and Pool, or Exploratory Area	
4. Location of Well (Footage, Sec., T., R., M., or Survey	Description)			RED WASII - GREEN RIVER	
			11. Cou	inty or Parish, State	
				UINTAH, UTAH	
		TO INDICATE NATURE OF NOT	ICE PEPOPT OP OT		
	JERIATE BOA(S)				
TYPE OF SUBMISSION	<u> </u>		PE OF ACTION	·····	
Notice of Intent		Abandonment	Chan	ge of Plans	
		Recompletion	New	Construction	
Subsequent Report		Plugging Back	Non-	Routine Fracturing	
X					
		Casing Repair	Wate	r Shut-Off	
Final Abandonment Notice		Altering Casing	Conv	rersion to Injection	
		X Other CHANGE OF OPERAT	OR Disp	ose Water	
				t results of multiple completion on Well r Recompletion Report and Log form.)	
13. Describe Proposed or Completed Operations (Clearly			any proposed work. If well is directic	maily drilled,	
give subsurface locations and measured and true vertice	cal depths for all markers and a	zones pertiment to this work)			
As of January 1, 2000 Chevron U.S.A. Il The Unit Number is I-SEC NO 761 effec		or of the Red Wash Unit.			
The Unit Number is 1-SEC NO 701 chec	are October 51, 1950.				
The successor operator under the Unit A Shenandoah Energy Inc.	igreement will be				
475 17th Street, Suite 1000					
Denver, CO 80202	J	``			
Agreed and accepted to this 29 <sup>th</sup> day of	December, 1999		REC	CEIVED	
Shenandoah Energy Inc,	•		••••		
BY: AN: HULS	X		DEC	3 0 1999	
Mitchell L. Solich	$\sim$				
President			DIVISION OF	OIL, GAS & MINING	
14. I hereby certify that the foregoing is true and correct.	1120.46		Date	12/29/99	
Signed A. E. Wacker Q E	. Wacky	Title Assistant Secretary		14/47/77	
(This space for Federal or State office use)					
Approved by:		Title	Date		
Conditions of approval, if any				· · · · · · · · · · · · · · · · · · ·	
Title 18 U.S.C. Section 1001, makes it a crime for any per	on knowingly and willfully to	make to any department or agency of the United States	any false, fictitious or fraudulent states	nents or	
representations as to any matter within its jurisdiction.				· · · · · · · · · · · · · · · · · · ·	
		*See instruction on Reverse Side			



# United States Department of the Interior

BUREAU OF LAND MANAGEMENT Utah State Office P.O. Box 45155 Salt Lake City, UT 84145-0155

RECEIVED

FEB 0 7 2000

DIVISION OF OIL, GAS AND MINING

February 4, 2000

IN REPLY REFER TO UT-931

Shenandoah Energy Inc. Attn: Rae Cusimano 475 17<sup>th</sup> Street, Suite 1000 Denver, Colorado 80202

Re: Red Wash Unit Uintah County, Utah

Gentlemen:

On December 30, 1999, we received an indenture whereby Chevron U.S.A. Inc. resigned as Unit Operator and Shenandoah Energy Inc. was designated as Successor Unit Operator for the Red Wash Unit, Uintah County, Utah.

This indenture was executed by all required parties and the signatory parties have complied with Sections 5 and 6 of the unit agreement. The instrument is hereby approved effective February 4, 2000. In approving this designation, the Authorized Officer neither warrants nor certifies that the designated party has obtained all required approval that would entitle it to conduct operations under the Red Wash Unit Agreement.

Your statewide (Utah) oil and gas bond No. 0969 will be used to cover all operations within the Red Wash Unit.

It is requested that you notify all interested parties of the change in unit operator. Copies of the approved instruments are being distributed to the appropriate federal offices, with one copy returned herewith.

Sincerely,

/s/ Robert A. Henricks

Robert A. Henricks Chief, Branch of Fluid Minerals

Enclosure

cc: Chevron U.S.A. Inc.

bcc: Field Manager - Vernal (w/enclosure) Minerals Adjudication Group U-932 File - Red Wash Unit (w/enclosure) MMS - Data Management Division Agr. Sec. Chron Fluid Chron UT931:TAThompson:tt:2/4/00 Page No. 02/04/00 2

• • •

۰.



### Well Status Report Utah State Office Bureau of Land Management

Lease	Api Number Well Name	QTR	Section Township	Range	Well Statu	us Operator
UTU0116	4304715258 144 (21-18B) RED	JAS NENW	18 T 7S	R23E	ТА	CHEVRON U S A INCORPORATED
UTU081	4304715259 145 (24-13B) RED		13 T 7S	R23E		CHEVRON U S A INCORPORATED
UTU0559	4304716492 146 (12-21A) RED		<u>21 T 7s</u>	RZZE		CHEVRON U S A INCORPORATED
UTU081	4304715260 147 (22-22B) RED		22 T 7S	R23E		CHEVRON U S A INCORPORATED
UTU081	4304715261 148 (13-22B) RED		22 T 7S	R23E		CHEVRON U S A INCORPORATED
-UTU0571				RZZE		CHEVRON US A INCORPORATED
UTU02148	4304715145 15 (32-17C) RED W		17 T 7S	R24E	PGW	CHEVRON U S A INCORPORATED
UTU081	4304715263 150 (31-22B) RED		22 T 7S		TA	CHEVRON U S A INCORPORATED
UTU081	4304715264 151 (42-14B) RED		14 T 7S	R23E		CHEVRON U S A INCORPORATED
<del>UTU02148</del>	4304716493-152- (41-17C) RED 1		<del>17 T 78</del>	-R24E-		CHEVRON U S A INCORPORATED
UTU02025	4304715265 153 (14-29B) RED I		29 T 7S	R23E		CHEVRON U S A INCORPORATED
STATE	4304716494 154 (41-32B) RED			-R23E-		CHEVRON USA INC
_UTU0571				R22E		CHEVRON U.S.A. INCORPORATED
UTU081	4304715267 156 (23-15B) RED		15 T 7S	R23E	WIW	CHEVRON U S A INCORPORATED
UTU02025	4304715268 158 (32-30B) RED I		30 T 7S	R23E	POW	CHEVRON U S A INCORPORATED
-UTU0571				R22E		CHEVRON U S A INCORPORATED
UTU02030	4304716475 16 (43-28B) RED W		28 T 7S	R23E	TA	CHEVRON U S A INCORPORATED
UTU081	4304715270 160 (32-15B) RED 1		15 T 7S	R23E	POW	CHEVRON U S A INCORPORATED
UTU02030	4304715271 161 (14-20B) RED I		20 T 7S	R23E	TA	CHEVRON U S A INCORPORATED
UTU02030	4304715272 162 (12-20B) RED		20 T 75		TA	CHEVRON U S A INCORPORATED
UTU0570				-R22E-		CHEVRON U S A INCORPORATED
UTU02025	4304715274 164 (12-28B) RED 1		28 T 7S		POW	CHEVRON U S A INCORPORATED
UTU0566	4304715275 165 (32-26B) RED 1		26 T 75		TA	CHEVRON U S A INCORPORATED
UTU0562				-R22E-		CHEVRON U S A INCORPORATED
UTU0567	4304715277 167 (23-21B) RED		21 T 7S		POW	CHEVRON U S A INCORPORATED
UTU082	4304715278 168 (23-24B) RED 1		24 T 7S	R23E	TA	CHEVRON US A INCORPORATED
UTU0569	4304715146 17 (41-20B) RED W		20 T 7S	R23E	POW	CHEVRON US A INCORPORATED
UTU081	4304716495 170 (41-15B) RED 1		15 T 7S		TA	CHEVRON US A INCORPORATED
UTU0570				R22E		CHEVRON U S A INCORPORATED
UTU02030	4304715280 172 (21-30B) RED		30 T 7S		ТА	CHEVRON US A INCORPORATED
UTU0569	4304716496 173 (21-21B) RED 1		21 T 7S	R23E		CHEVRON US A INCORPORATED
UTU0933	4304715281 174 (21-20B) RED I		20 T 7S	R23E		CHEVRON U S A INCORPORATED
UTU0558				-R22E-		CHEVRON U S A INCORPORATED
UTU02030	4304715283 176 (31-28B) RED		28 T 75	R23E		CHEVRON U S A INCORPORATED
UTU02030	4304715284 177 (42-28B) RED I		28 T 7S	R23E		CHEVRON U S A INCORPORATED
UTU081	4304715285 178. (22-13B) RED (		13 T 7S	R23E		
-UTU0570				-R22E-		CHEVRON U S A INCORPORATED
-UTU02149				-R24E		CHEVRON U.S.A. INCORPORATED
UTU082	4304715287 180 (31-23B) RED I		23 T 7S	R23E		CHEVRON U S A INCORPORATED CHEVRON U S A INCORPORATED
UTU02025	4304715288 181 (34-30B) RED 1		30 T 7S	R23E		CHEVRON US A INCORPORATED
UTU0933	4304716497 182 (14-21B) RED		21 T 7S		TA	CHEVRON U S A INCORPORATED
UTU081	4304715289 183 (33-13B) RED I		13 T 7S	R23E		CHEVRON US A INCORPORATED
UTU0566	4304715290 184 (23-26B) RED (		26 T 7S	R23E		CHEVRON US A INCORPORATED
UTU081	4304716498 185 (41-14B) RED (		14 T 7S		WIWSI	CHEVRON U S A INCORPORATED
UTU02030	4304716499 186 (41-148) RED 1			R23E		CHEVRON U S A INCORPORATED
UTU02030	4304715291 188 (23-20B) RED 1		20 T 7S	R23E		CHEVRON U S A INCORPORATED
STATE	4304715292 189 (41-16B) RED 1		16 T 7S	R23E		CHEVRON U S A INCORPORATED
UTU0566	4304715148 19 (34-26B) RED W		26 T 7S	RZJE		CHEVRON US A INCORPORATED
UTU0560	4304715146 19 (34-208) KED W	-00 9 <b>4</b> 9C	20 1 / 5	REJE	921	GREVIUM U S A INCOMPORATED

### Division of Oil, Gas and Mining

### **OPERATOR CHANGE WORKSHEET**

Enter date after each listed item is completed

# X Change of Operator (Well Sold)

Operator Name Change (Only)

The operator of the well(s) listed below has changed, effective:

 FROM: (Old Operator):

 CHEVRON USA INC

 Address: 11002 E. 17500 S.

 VERNAL, UT 84078-8526

 Phone: 1-(435)-781-4300

 Account No.
 N0210

CA No.

ROUTING

 1. GLH
 4-KAS

 2. CDW
 5-St

 3. JLT
 6-FILE

Designation of Agent

Merger

### 01-01-2000

TO: (New Operator): SHENANDOAH ENERGY INC Address: 11002 E. 17500 S. VERNAL, UT 84078

**RED WASH** 

Phone: 1-(435)-781-4300 Account N4235

Unit:

WELL(S)				TEACE	WELL	WELL
	API		SEC. TWN	LEASE TYPE	TYPE	STATUS
NAME	NO.	<u>NO.</u>	RNG	FEDERAL		PA
RWU 166 (23-14A)	43-047-15276	5670	the second se			PA PA
RWU 146 (12-21A)	43-047-16492	99998		FEDERAL		PA PA
RWU 175 (34-28A)	43-047-15282	5670	28-07S-22E	FEDERAL		PA PA
RWU 149 (21-33A)	43-047-15262	5670	33-07S-22E	FEDERAL		the second se
RWU 155 (23-33A)	43-047-15266	5670	33-07S-22E	FEDERAL		PA
RWU 159 (14-33A)	43-047-15269	5670	33-07S-22E	FEDERAL		PA
RWU 163 (34-33A)	43-047-15273	5670	33-07S-22E	FEDERAL		PA
RWU 171 (32-33A)	43-047-15279	5670	33-07S-22E	FEDERAL		PA
RWU 160 (32-15B)	43-047-15270	5670	15-07S-23E	FEDERAL		Р
RWU 162 (12-20B)	43-047-15272	5670	20-07S-23E	FEDERAL		TA
RWU 17 (41-20B)	43-047-15146	5670	20-07S-23E	FEDERAL		TA
RWU 167 (23-21B)	43-047-15277	5670	21-07S-23E	FEDERAL		P
RWU 147 (22-22B)	43-047-15260	5670	22-07S-23E	FEDERAL	the second se	Р
RWU 168 (23-24B)	43-047-15278	5670	24-07S-23E	FEDERAL	the second se	TA
RWU 165 (32-26B)	43-047-15275	5670	26-07S-23E	FEDERAL		S
RWU 164 (12-28B)	43-047-15274	5670	28-07S-23E	FEDERAL		Р
RWU 153 (14-29B)	43-047-15265	5670	29-07S-23E	FEDERAL		Р
RWU 158 (32-30B)	43-047-15268	5670	30-07S-23E	FEDERAL	OW	Р
RWU 178 (52-30B)	43-047-15280	5670	30-07S-23E	FEDERAL	OW	TA
	43-047-16494	5670	32-07S-23E	FEDERAL	OW	PA
RWU 154 (41-32B)	43-047-15145	99998	17-07S-24E	FEDERAL	OW	Р
RWU 15 (32-17C)	43-047-16493	5670	17-07S-24E	FEDERAL		PA
RWU 152 (41-17C)	45-047-10495					

# **OPERATOR CHANGES DOCUMENTATION**

1.	(R649-8-10) Sundry or legal documentation was received from the	ne FORMER operator on:
----	---	------------------------

12-30-1999

2. (R649-8-10) Sundry or legal documentation was received from the NEW operator on:

08-09-2000

3.	The new company has been checked through the Department of Commerce, Division of Corporations Database on: 08-23-2000
4.	Is the new operator registered in the State of Utah: YES Business Number: 224885
5.	If NO, the operator was contacted contacted on:
6.	Federal and Indian Lease Wells: The BLM and or the BIA has approved the (merger, name change, or operator change for all wells listed on Federal or Indian leases on: 02/04/2000
7.	Federal and Indian Units: The BLM or BIA has approved the successor of unit operator for wells listed on: 02/04/2000
8.	Federal and Indian Communization Agreements ("CA"): The BLM or the BIA has approved the operator change for all wells listed involved in a CA on:       N/A
9.	<b>Underground Injection Control ("UIC") Pro</b> <sup>1</sup> The Division has approved UIC Form 5, <b>Transfer of Authority to Inject</b> , for the enhanced/secondary recovery unit/project for the water disposal well(s) listed on:
<b>D</b> / 1.	ATA ENTRY: Changes entered in the Oil and Gas Database on: 09/11/2000
2.	Changes have been entered on the Monthly Operator Change Spread Sheet on: 09/11/2000
3.	Bond information entered in RBDMS on: N/A
4.	Fee wells attached to bond in RBDMS on:N/A
<b>S</b> 7 1.	State well(s) covered by Bond No.:       N/A
	EE WELLS - BOND VERIFICATION/LEASE INTEREST OWNER NOTIFICATION:
1.	(R649-3-1) The NEW operator of any fee well(s) listed has furnished a bond: N/A
2.	The FORMER operator has requested a release of liability from their bond on:       N/A         The Division sent response by letter on:       N/A
3.	(R649-2-10) The <b>FORMER</b> operator of the Fee wells has been contacted and informed by a letter from the Division of their responsibility to notify all interest owners of this change on:
<b>F</b> . 1.	ILMING: All attachments to this form have been MICROFILMED on: 03-09-0(
<b>F</b> 1.	ILING: ORIGINALS/COPIES of all attachments pertaining to each individual well have been filled in each well file on:
<u>c</u>	OMMENTS:
_	